

TEA FIRE SEWER STUBS

January 2009

TEA FIRE LATERAL
ABANDONMENT PROJECT

TEA FIRE LATERAL ABANDONMENT PROJECT

updated 1/22/09

#	APN	ADDRESS	START MH	END MH	SIZE	TYPE	FOOTAGE	DEPTH	CCTV DATE	CAPPED	DATE	SURFACE DIRT PAVE
1	019-282-003	14 CAMINO VERDE	J05-034	J06-034	5.5	LINER	31' FROM MH J05-034	7'	12/30/2008	YES	1/16/2009	x
2	019-142-013	17 CAMINO VERDE	J05-010	J05-033	6	VCP	MARKED ON PROPERTY	2'	12/30/2008	YES	12/31/2008	x
3	019-142-012	19 CAMINO VERDE	J05-010	J05-033	6	VCP	MARKED ON PROPERTY	4'	12/30/2008	YES	12/31/2008	x
4	019-282-027	20 CAMINO VERDE	J05-034	J06-034	5.5	LINER	14' FROM MH J05-034	4'	12/30/2008	YES	12/31/2008	X
5	013-122-002	684 CIRCLE DR	K04-007	K04-008	6	VCP	87' FROM MH K04-008	5'7"	12/23/2008	YES	1/5/2009	X
6	013-102-004	710 CIRCLE DR	K04-003	K04-007	6	VCP	216' FROM MH K04-007	4'6"	12/23/2008	YES	1/5/2009	X
7	013-101-006	715 CIRCLE DR	K04-005	K04-003	6	VCP	44' FROM MH K04-003	6'3"	12/23/2008	YES	1/5/2009	X
8	019-041-033	217 CONEJO RD	J04-UNK	J04-001	6	PVC			11/24/2008	YES	12/19/2008	X
9	019-041-021	219 CONEJO RD	J04-034	J04-033	6	VCP	15' FROM MH J04-034	4'9"	11/24/2008	YES	12/19/2008	X
10	019-041-022	223 CONEJO RD	J04-034	J04-033	6	VCP	115' FROM MH J04-034	5'	11/24/2008	YES	12/19/2008	X
11	019-041-023	225 CONEJO RD	J04-034	J04-033	6	VCP	209' FROM MH J04-034	5'9"	11/24/2008	YES	12/19/2008	X
12	019-041-014	241 CONEJO RD	J04-034	J04-033	6	VCP	224' FROM MH J04-034	5'6"	11/24/2008	YES	12/19/2008	X
13	019-041-008	265 CONEJO RD	J04-013	J04-012	6	VCP			11/25/2008	YES	12/19/2008	X
14	019-050-025	317 CONEJO RD/SHERMAN	J04-017	J04-035	6	VCP	31' FROM MH J04-017	7.5'	11/25/2008	YES	1/13/2009	X
15	019-050-026	327 CONEJO RD	J04-017	J04-035	6	VCP	75' FROM MH J04-017	6'4"	11/22/2008	YES	1/13/2009	X
16	019-050-031	331 CONEJO RD	J04-010	J04-009	6	LINER	63' FROM MH J04-010	8'	11/25/2008	YES	12/23/2008	x
17	019-050-030	333 CONEJO RD	J04-010	J04-009	6	LINER	92' FROM MH J04-010	8'	11/25/2008	YES	12/23/2008	x
18	019-050-028	345 CONEJO RD	J04-010	J04-009	6	LINER	172' FROM MH J04-010	6'	11/25/2008	YES	1/13/2009	x
19	019-061-001	350 CONEJO RD	J04-009	J04-008	6	LINER	56' FROM MH J04-009		11/25/2008	YES	12/23/2008	x
20	019-061-030	352 CONEJO RD	J04-004	J04-003	6	HDPE	2' FROM END OF LINE	2'	11/25/2008	YES	11/19/2008	X
21	019-061-029	357 CONEJO RD	J04-009	J04-008	6	LINER	129' FROM MH J04-009	7'	11/25/2008	YES	12/23/2008	X
22	019-050-008	403 CONEJO RD	J04-022		6	PVC	TIES INTO MH J04-022		11/20/2008	NO	N/A	x
23	019-050-009	407 CONEJO RD	J04-022		6	PVC	TIES INTO MH J04-022		11/20/2008	NO	N/A	x
24	019-061-011	428 CONEJO RD	J04-015	J04-036	6	HDPE	11' FROM MH J04-015	5'	11/20/2008	YES	12/29/2008	X
25	019-050-013	430 CONEJO RD (LN)	C0 J04-004	J04-025	6	DI	SAND BAG AT MH			NO	N/A	
26	019-061-012	434 CONEJO RD	J04-015	J04-036	6	HDPE	65' FROM MH J04-015	5'3"	11/20/2008	YES	12/30/2008	X
27	019-061-013	438 CONEJO RD	J04-015	J04-036	6	HDPE	118' FROM MH J04-015	6'4"	11/20/2008	YES	12/29/2008	X
28	019-061-029	444 CONEJO RD (LN)	J04-015	J04-036	6	HDPE	208' FROM MH J04-015	7.5'	11/20/2008	YES	12/29/2008	X
29	019-050-017	447 CONEJO RD	J04-020	J04-019	6	HDPE	54' FROM MH J04-019	6.5'	11/21/2008	YES	1/7/2009	X
30	019-061-037	450 CONEJO RD	J04-015	J04-036	6	HDPE	290' FROM MH J04-015	7.5'	11/18/2008	YES	12/29/2008	X
31	019-061-036	456 CONEJO RD	J04-015	J04-036	6	HDPE	365' FROM MH J04-015	5'10"	11/18/2008	YES	12/29/2008	X
32	019-061-016	462 CONEJO RD	J04-015	J04-036	6	HDPE	389' FROM MH J04-015	6'	11/18/2008	YES	12/30/2008	X
33	019-061-017	468 CONEJO RD	J04-036	J05-007	6	HDPE	86' FROM MH J04-015		11/18/2008	YES	12/30/2008	X
34	019-061-018	474 CONEJO RD	J04-036	J05-007	6	HDPE	85' FROM MH J04-007		11/20/2008	YES	12/30/2008	X
35	019-061-019	478 CONEJO RD	UNK	J04-007	6	HDPE		3	11/19/2008	YES	11/19/2008	X
36	019-062-011	501 CONEJO RD	J04-019	J04-032	6	HDPE	36' FROM MH J04-019	3'	11/22/2008	YES	1/7/2009	X
37	019-062-010	507 CONEJO RD	J04-019	J04-032	6	HDPE	149 FROM MH J04-019	4'	11/22/2008	YES	1/5/2009	X
38	019-062-009	515 CONEJO RD	J04-019	J04-032	6	HDPE	214 FROM MH J04-019	3.5'	11/22/2008	YES	1/6/2009	X

TEA FIRE LATERAL ABANDONMENT PROJECT


#	APN	ADDRESS	START MH	END MH	SIZE	TYPE	FOOTAGE	DEPTH	CCTV DATE	CAPPED	DATE	SURFACE DIRT PAVE
39	019-062-008	523 CONEJO RD	J04-019	J04-032	6	HDPE	271' FROM MH J04-019	2'	11/22/2008	YES	1/7/2009	X
40	019-062-004	525 CONEJO RD	J05-005	J04-031	6	VCP		6'	1/5/2009	YES	1/14/2009	X
41	019-062-007	529 CONEJO RD	J04-032	J04-030	5.5	LINER	5' FROM MH J04-032	3.5'	11/22/2008	YES	1/7/2009	X
42	019-062-003	533 CONEJO RD	J04-032	J04-030	5.5	LINER	2' FROM MH J04-030	6'	11/22/2008	YES	12/19/2008	X
43	019-062-005	535 CONEJO RD	J04-032	J04-030	5.5	LINER		2'	1/5/2009	YES	1/6/2009	X
44	019-062-002	545 CONEJO RD						3'4"	1/5/2009	YES	1/8/2009	X
45	021-141-038	695 COYOTE RD	K04-020	K04-019	8	PVC	1' FROM MH K04-020	3.5'	12/23/2008	YES	1/9/2009	X
46	019-061-026	10 EALAND PL	J04-008	J04-035	6	HDPE	14' FROM MH J04-008	6'	11/18/2008	NO	ACTIVE	X
47	019-061-034	11 EALAND PL	UNK C.O.	UNK MH	6	HDPE		2'	11/19/2008	YES	11/19/2008	X
48	019-061-027	16 EALAND PL	J04-007	J04-002	6	HDPE	8' FROM MH J04-007	3'	11/19/2008	YES	11/19/2008	X
49	019-061-035	17 EALAND PL	J04-007	J04-002	6	HDPE	95' FROM MH J04-007	3'	11/19/2008	YES	11/19/2008	X
50	021-084-003	272 EL CIELITO RD	H03-002	H04-021	8	VCP	PUSH CAMERA/LAT	2'	1/7/2009			X
51	021-083-004	1944 GIBALTAR RD	C0 H03-002	H03-006	8	CI	PUSH CAMERA/ LAT	1'	1/7/2009	YES	1/9/2009	X
52	019-333-001	20 LAS ALTURAS CIR	J05-015	J05-010	6	VCP	80' FROM MH H05-010	5'	1/7/2009	YES	1/14/2009	X
53	019-130-032	1050 LAS ALTURAS RD	J05-009	J05-014	6	VCP	236' FROM MH J05-014	6'	1/6/2009	YES	1/14/2009	X
54	019-130-031	1052 LAS ALTURAS RD	J05-009	J05-014	6	VCP	240' FROM MH J05-014	5.5'	1/6/2009	YES	1/14/2009	X
55	019-113-020	1105 LAS ALTURAS RD	J05-018	J05-019	5.5	LINER	25' FROM MH J04-018	3'	11/24/2008	YES	12/18/2008	X
56	019-113-022	1117 LAS ALTURAS RD	J05-017	J05-018	5.5	LINER	60' FROM MH J04-017	6'	11/24/2008	YES	12/18/2008	X
57	019-113-030	1131 LAS ALTURAS RD	J05-016	J05-017	5.5	LINER	74' FROM MH J04-016	16'	11/24/2008	NO	N/A	
58	019-312-021	376 LAS ALTURAS RD	C0 J06-007	J06-056	8	PVC						X
59	019-282-010	444 LAS ALTURAS RD	J06-039	J06-040	6	PVC	27' FROM MH J06-039	3.5'	1/6/2009	YES	1/8/2009	X
60	019-282-033	638 LAS ALTURAS RD	J06-033	J06-037	6	PVC	LAT NEEDS TO BE CLEARED		1/6/2009	NO		X
61	019-282-007	642 LAS ALTURAS RD	J06-034	J06-033	6	VCP	67' FROM MH J06-034	3.5'	12/30/2008	YES	1/5/2009	X
62	019-282-006	646 LAS ALTURAS RD	J05-034	J06-034	6	VCP	3.5' FROM MH J06-034	4'	12/30/2008	YES	1/5/2009	X
63	019-282-005	656 LAS ALTURAS RD	J05-034	J06-034	6	VCP	NOT LOCATED		12/30/2008	NO	N/A	X
64	019-282-026	660 LAS ALTURAS RD	J05-034	J06-034	6	VCP	UNDER BRICK PATIO BY POOL	4'	12/30/2008	NO	N/A	X
65	019-142-005	900 LAS ALTURAS RD	J05-011	J05-010	6	VCP	166' FROM MH J05-010	4'	12/30/2008	YES	1/12/2009	X
66	021-040-039	2400 MOUNT CALVARY	H02-003	H02-001	8	PVC	62' FROM MH H02-003	2'	12/29/2008	NO	N/A	
66	021-081-009	2114 MOUNT CALVARY	H03-004	H03-010	8	VCP	TIES INTO MH H03-010		1/7/2009	YES	1/13/2008	X
67	021-040-013	2220 MOUNT CALVARY	H02-007	H02-006	8	PVC	6' FROM MH H02-006	2'	12/29/2008	YES	1/7/2009	X
68	019-282-020	47 RINCON VISTA RD	J06-031	J06-038	6	VCP		2'3"	1/6/2009	YES	1/7/2009	X
69	019-282-019	50 RINCON VISTA RD	J06-031	J06-038	6	VCP	61' FROM MH J06-038	3'	1/6/2009	YES	1/7/2009	X
70	019-050-022	305 SHERMAN RD	CO J04-002	J04-018	8	VCP		12'	11/22/2008	NO	N/A	X
72	019-050-003	306 SHERMAN RD	CO J04-002	J04-018	8	VCP		12'	11/22/2008	NO	N/A	X
73	019-050-023	311 SHERMAN RD	J04-018	J04-017	8	VCP	37' FROM MH J04-018	13.5'	11/22/2008	NO	N/A	X
73	019-050-004	312 SHERMAN RD	CO J04-002	J04-018	8	VCP		13.5	11/22/2008	NO	N/A	X
74	019-050-005	318 SHERMAN RD	J04-018	J04-017	8	VCP		13.5	11/22/2008	NO	N/A	X
75	019-050-006	324 SHERMAN RD	J04-018	J04-017	8	VCP		13.5	11/22/2008	NO	N/A	X

TEA FIRE LATERAL ABANDONMENT PROJECT



#	APN	ADDRESS	START MH	END MH	SIZE	TYPE	FOOTAGE	DEPTH	CCTV DATE	CAPPED	DATE	SURFACE DIRT	PAVE
76	019-050-007	330 SHERMAN RD	J04-018	J04-017	8	VCP		13.5	11/22/2008	NO	N/A	X	
77	019-050-024	331 SHERMAN RD	J04-018	J04-017	8	VCP		13.5	11/22/2008	NO	N/A	X	
78	019-050-001	1957 STANWOOD DR	J04-018	J04-017	8	VCP		13.5	11/22/2008	NO	N/A	x	
79	013-163-001	595 SYCAMORE VISTA	K04-026	K05-009	8	VCP	170' FROM MH K04-009	4'	12/29/2008	YES	11/12/2009	X	
80	013-070-059	1014 WESTMONT RD	K03-001	K04-033	8	PVC	194' FROM MH K04-033	6' PRP	12/22/2008	YES	12/29/2008	X	
81	013-070-067	1031 WESTMONT RD	K03-001	K04-033	8	PVC	60' F ROM MH K04-033	6' PROP	12/22/2008	YES	12/24/2008	X	
82	013-070-065	1049 WESTMONT RD	K04-032	K04-031	8	PVC	20' FROM MH K04-032	5' PROP	12/23/2008	YES	12/23/2008	X	
83	013-070-064	1103 WESTMONT RD	K04-031	K04-030	8	PVC	109' FROM MH K04-030	2' PROP	12/23/2008	YES	12/24/2008	X	
84	013-070-083	1108 WESTMONT RD	K04-031	K04-030	8	PVC	100' FROM MH K04-030	7' PROP	12/30/2008	YES	12/31/2008	X	
85	013-070-075	1125 WESTMONT RD	UNK C.O.	K04-029	8	PVC	30' FROM MH K04-029	2' PROP	12/23/2008	YES	12/30/2008		X
86	013-070-081	1132 WESTMONT RD	UNK EASE	UNK MH	8	PVC	200' FROM MH K04-UNK	4' PROP	12/23/2008	YES	12/29/2008	X	
87	013-102-006	733 WESTMONT RD	K04-005	K04-003	8	VCP	192' FROM MH K04-003	7'4"	12/23/2008	YES	1/5/2009	X	
88	013-103-001	762 WESTMONT RD	K04-002	K04-004	8	VCP	342' FROM MH K04-004	5'6"	12/23/2008	YES	1/5/2009	X	
89	013-070-046	824 WESTMONT RD	K04-035	K04-028	8	PVC	201' FROM MH K04-028	4' PROP	12/22/2008	YES	12/23/2008	X	
90	013-070-077	825 WESTMONT RD	K04-035	K04-028	8	PVC	121' FROM MH K04-028	6' PROP	12/22/2008	YES	12/29/2008	X	
91	013-070-048	840 WESTMONT RD	K04-034	K04-035	8	PVC	12' FROM MH K04-035	4' PROP	12/22/2008	YES	12/23/2008	X	
92	013-070-073	849 WESTMONT RD	K04-034	K04-035	8	PVC	62' FROM MH K04-035	2' PROP	12/22/2008	YES	12/23/2008	X	
93	013-070-049	850 WESTMONT RD	K04-034	K04-035	8	PVC	90' FROM MH K04-035	6.5' PRP	12/22/2008	YES	12/23/2008	X	
94	013-070-054	928 WESTMONT RD	K03-002	K03-003	8	PVC	165' FROM MH K03-003	3' PROP	12/22/2008	YES	12/23/2008	X	
95	013-070-057	952 WESTMONT RD	CO K03-001	K03-001	8	PVC	76' FROM MH K03-001	4'2" PRP	12/22/2008	YES	12/24/2008	X	

AERIAL PHOTOGRAPHS



14 CAMINO VERDE




317 CONEJO RD

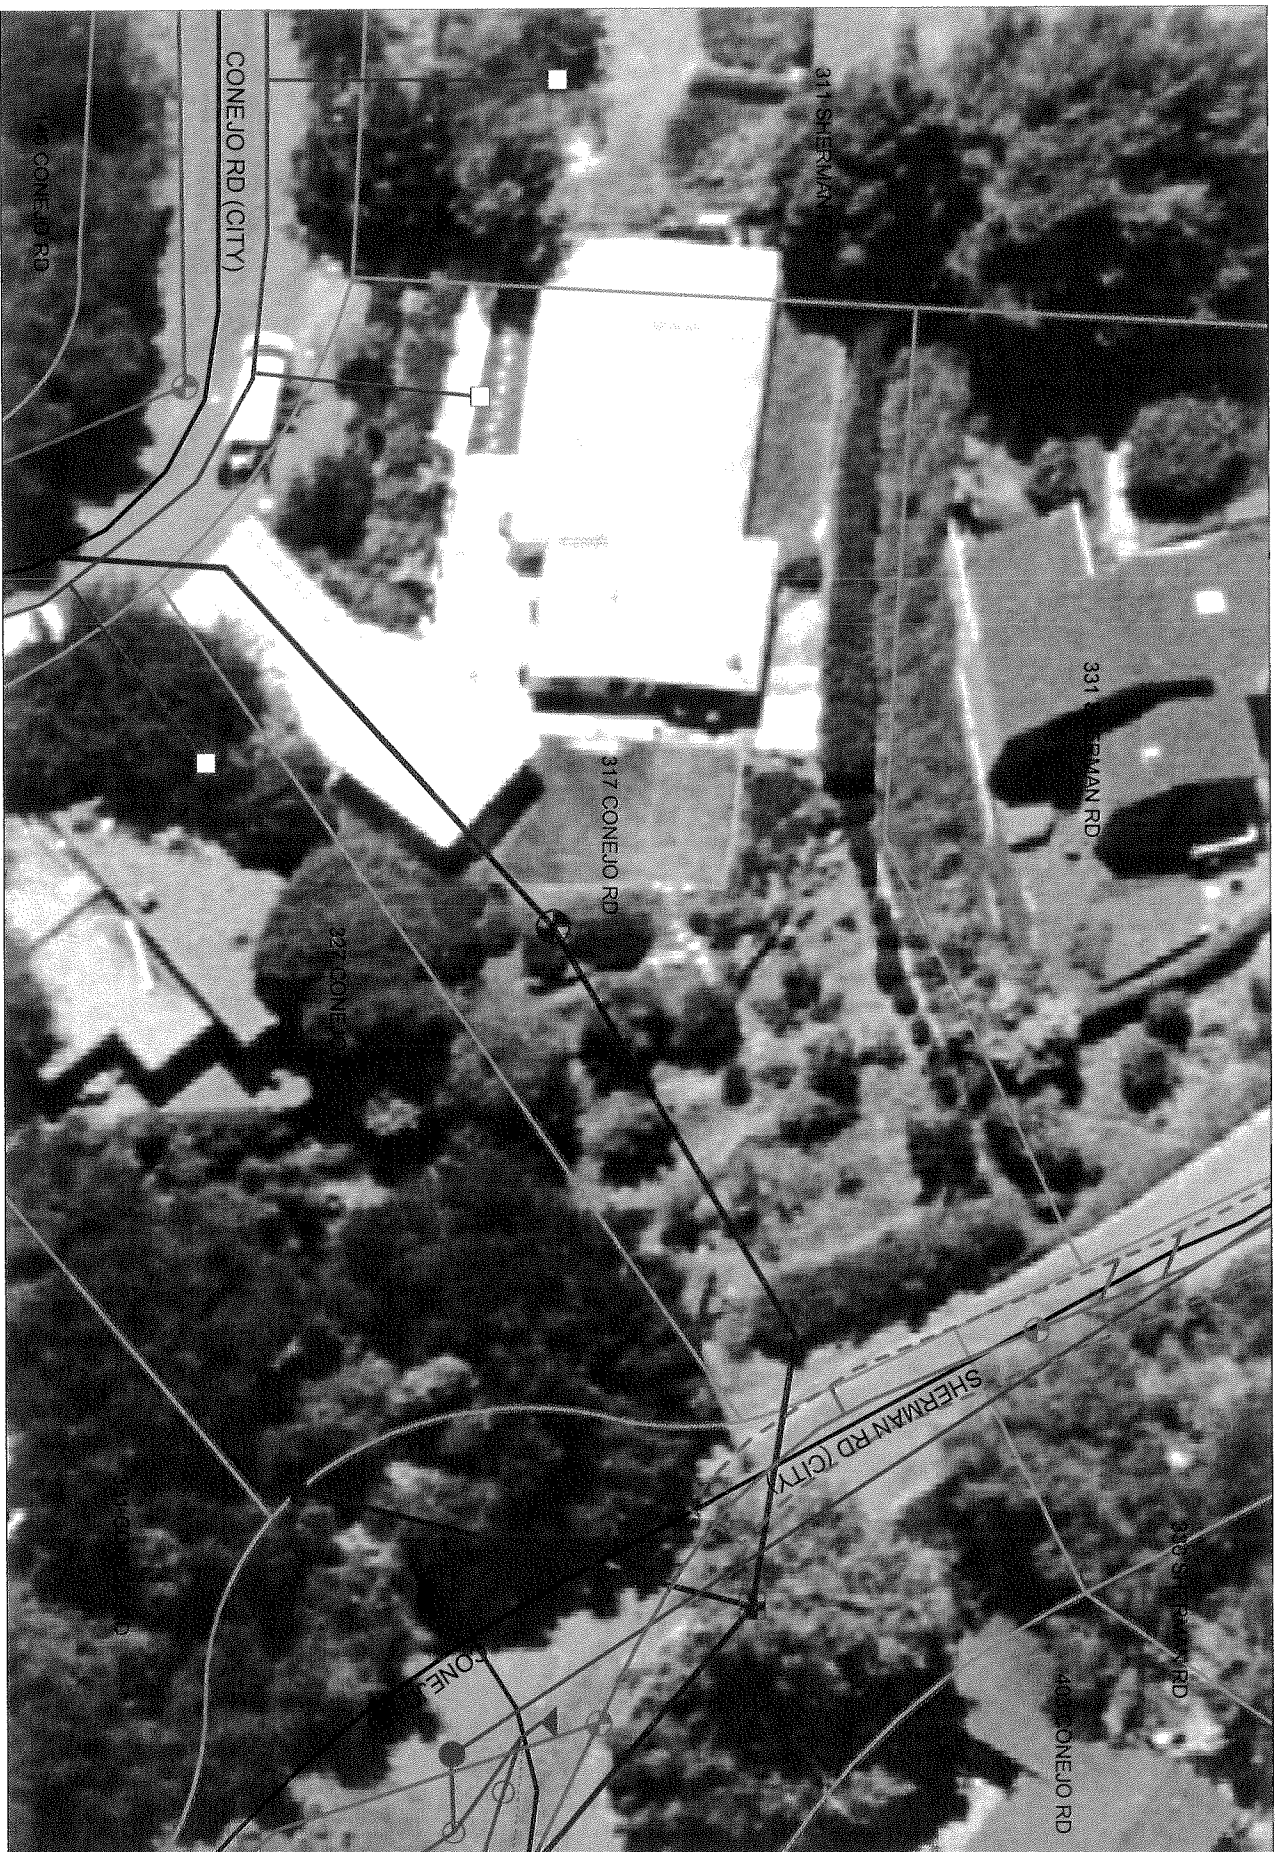

447 CONEJO RD

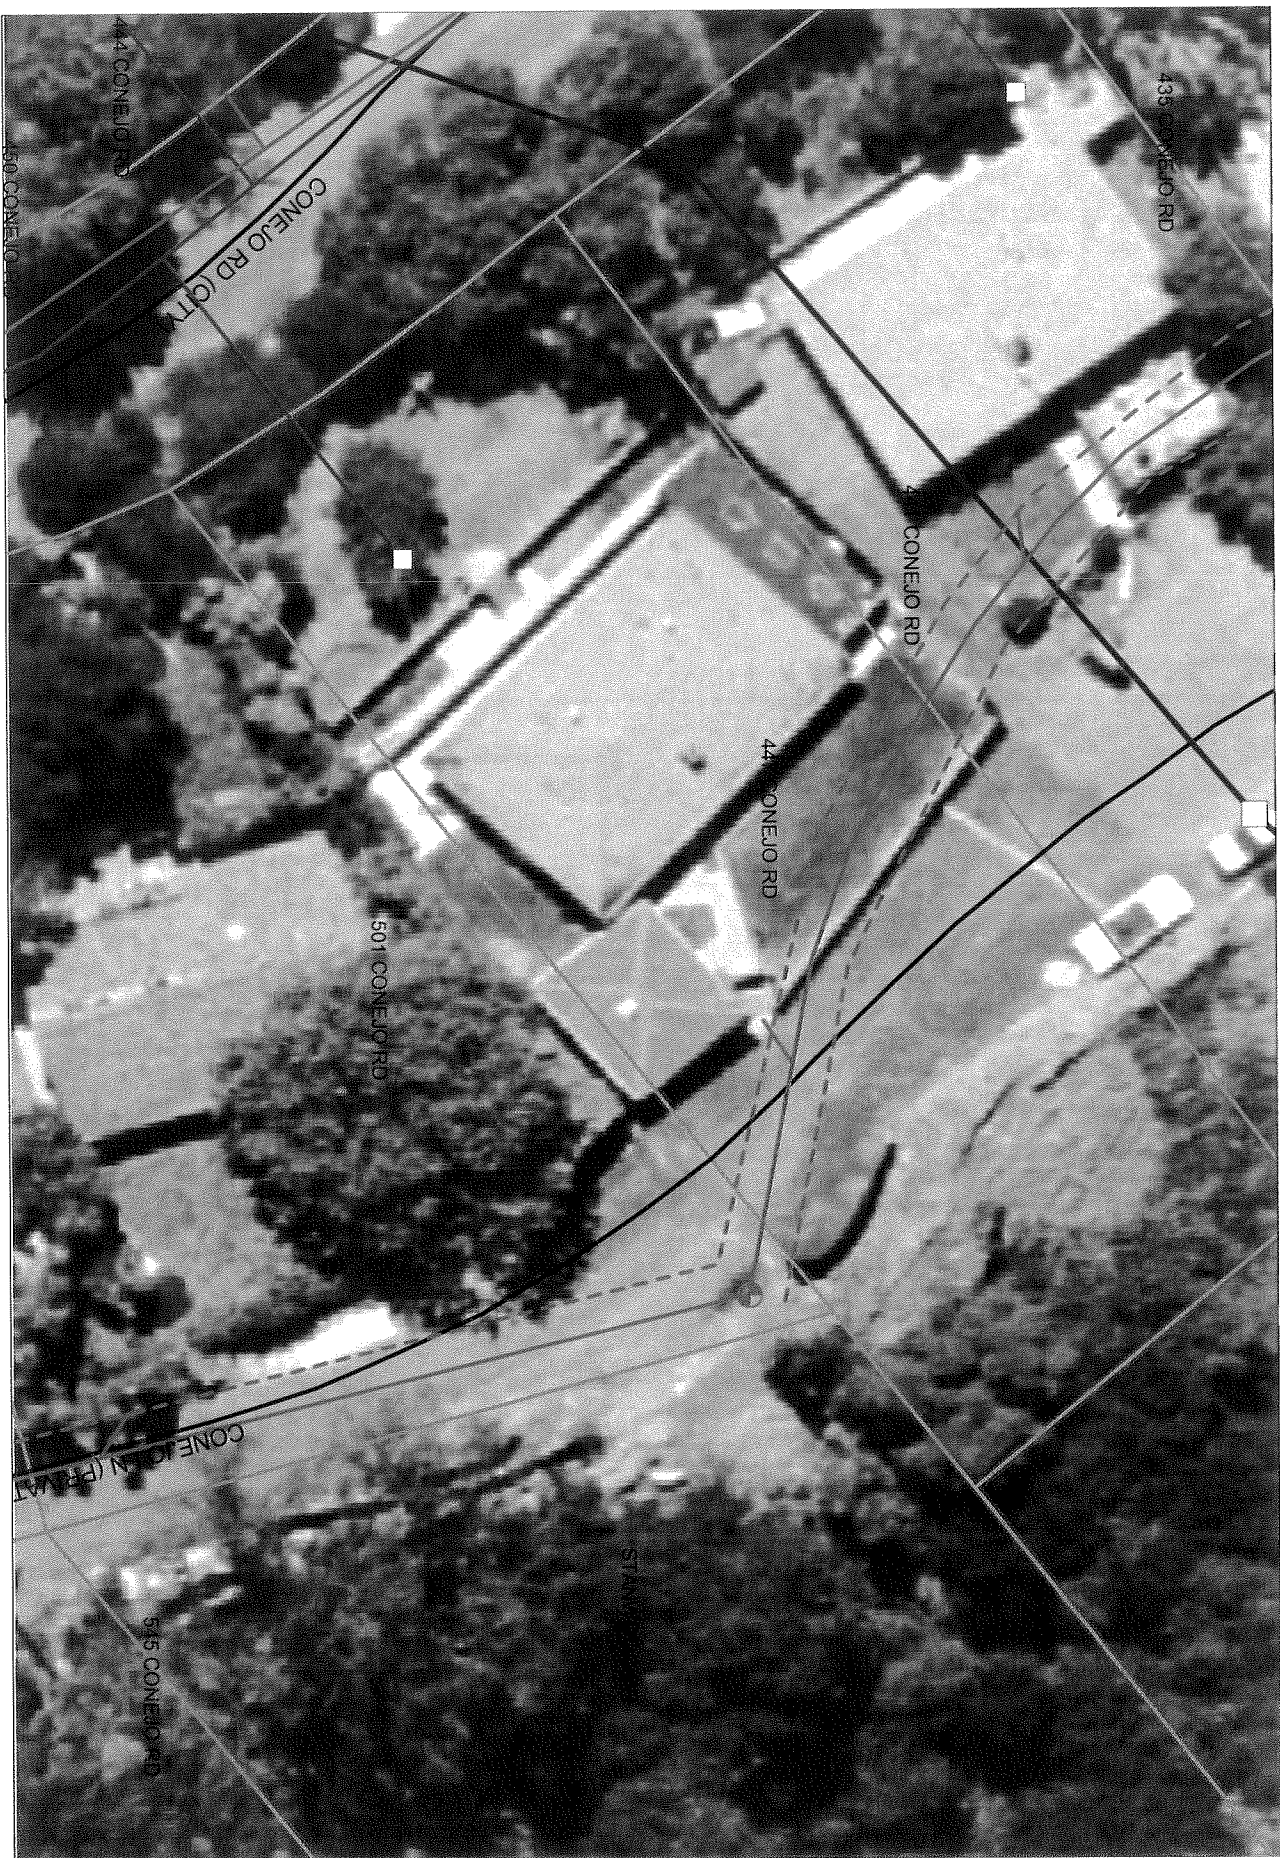

515 CONEJO RD

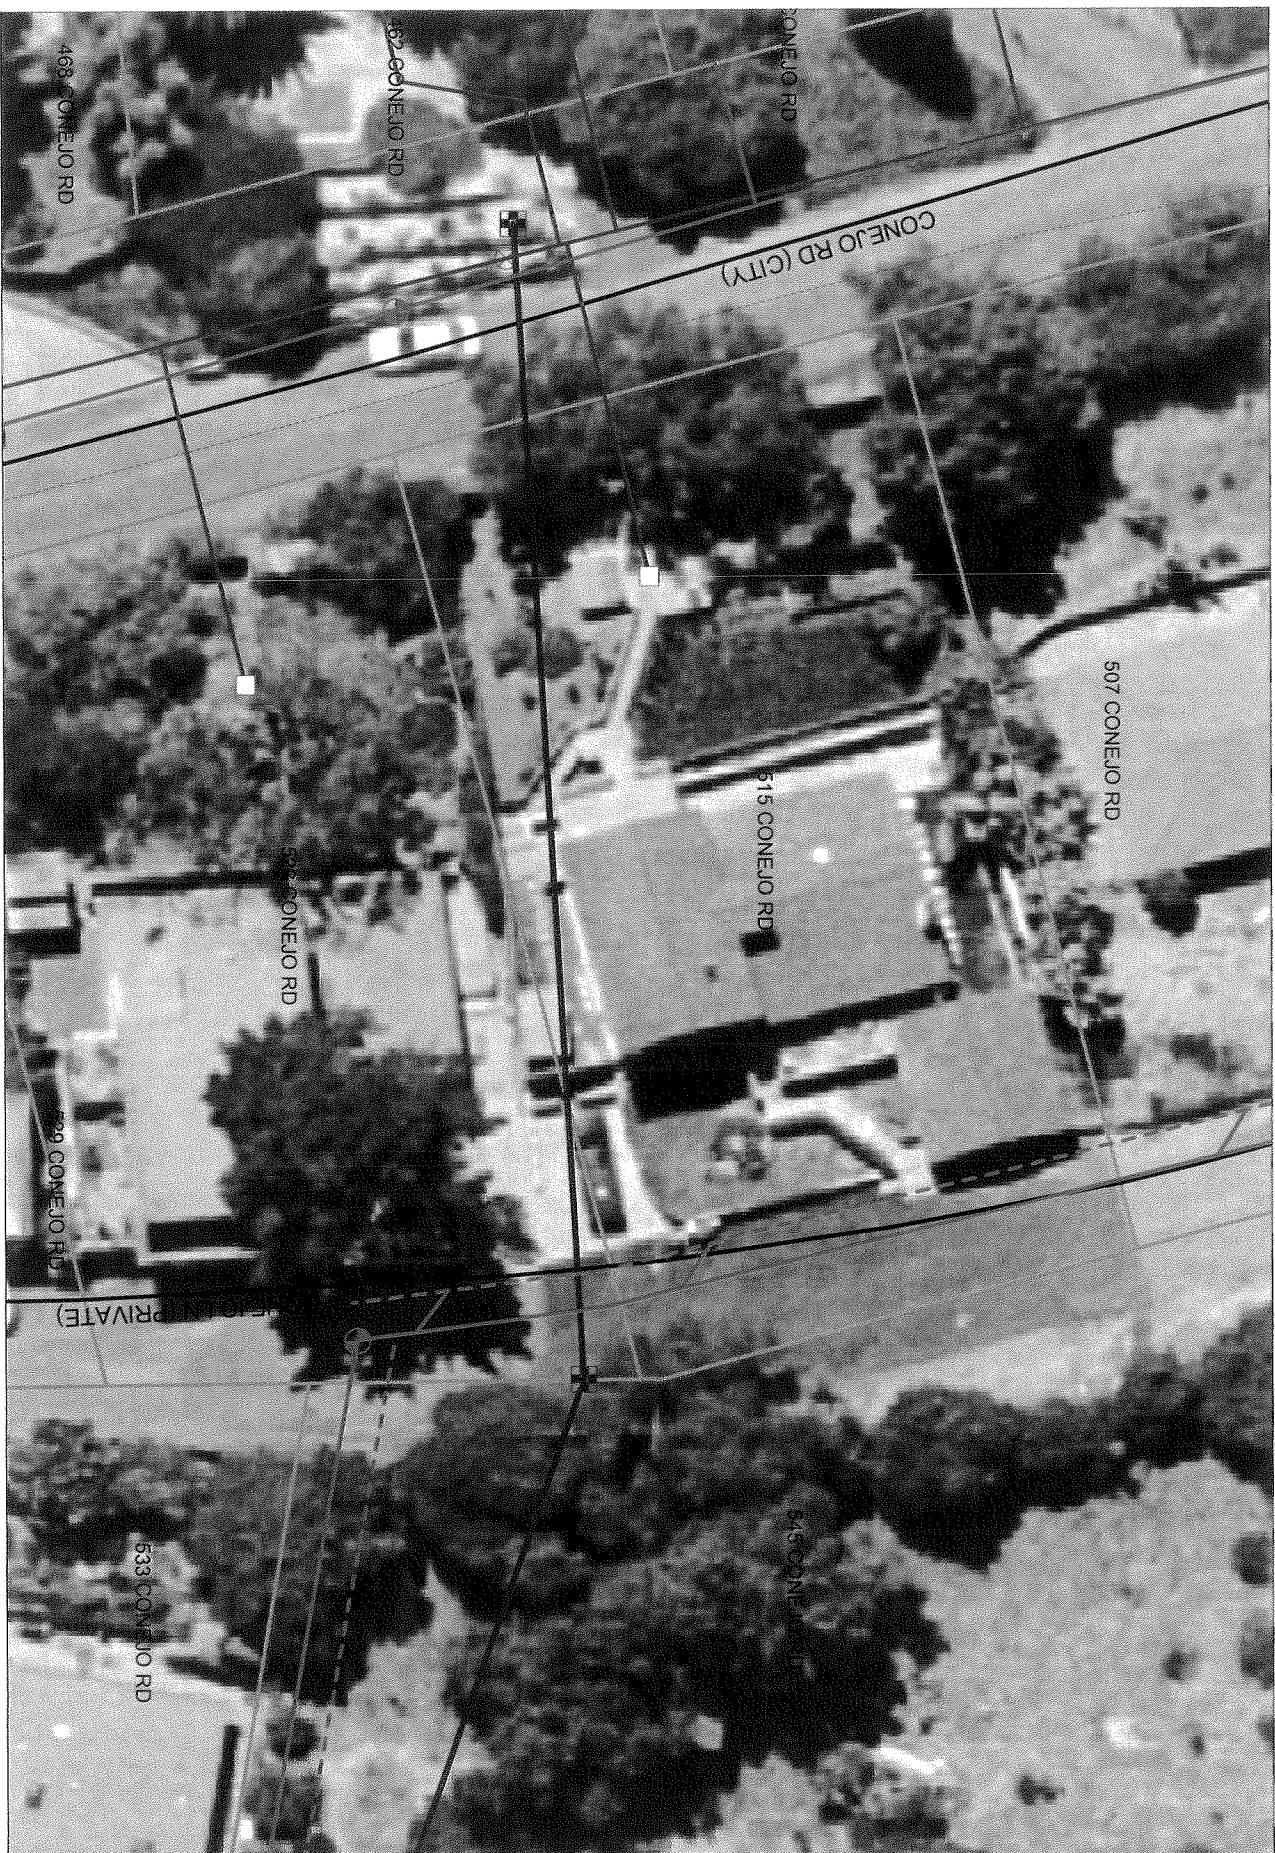

507 CONEJO RD

515 CONEJO RD

CONEJO RD (CITY)

462 CONEJO RD


468 CONEJO RD

526 CONEJO RD


429 CONEJO RD

(PRIVATE)


533 CONEJO RD



545 CONEJO RD



17 EALAND PLACE

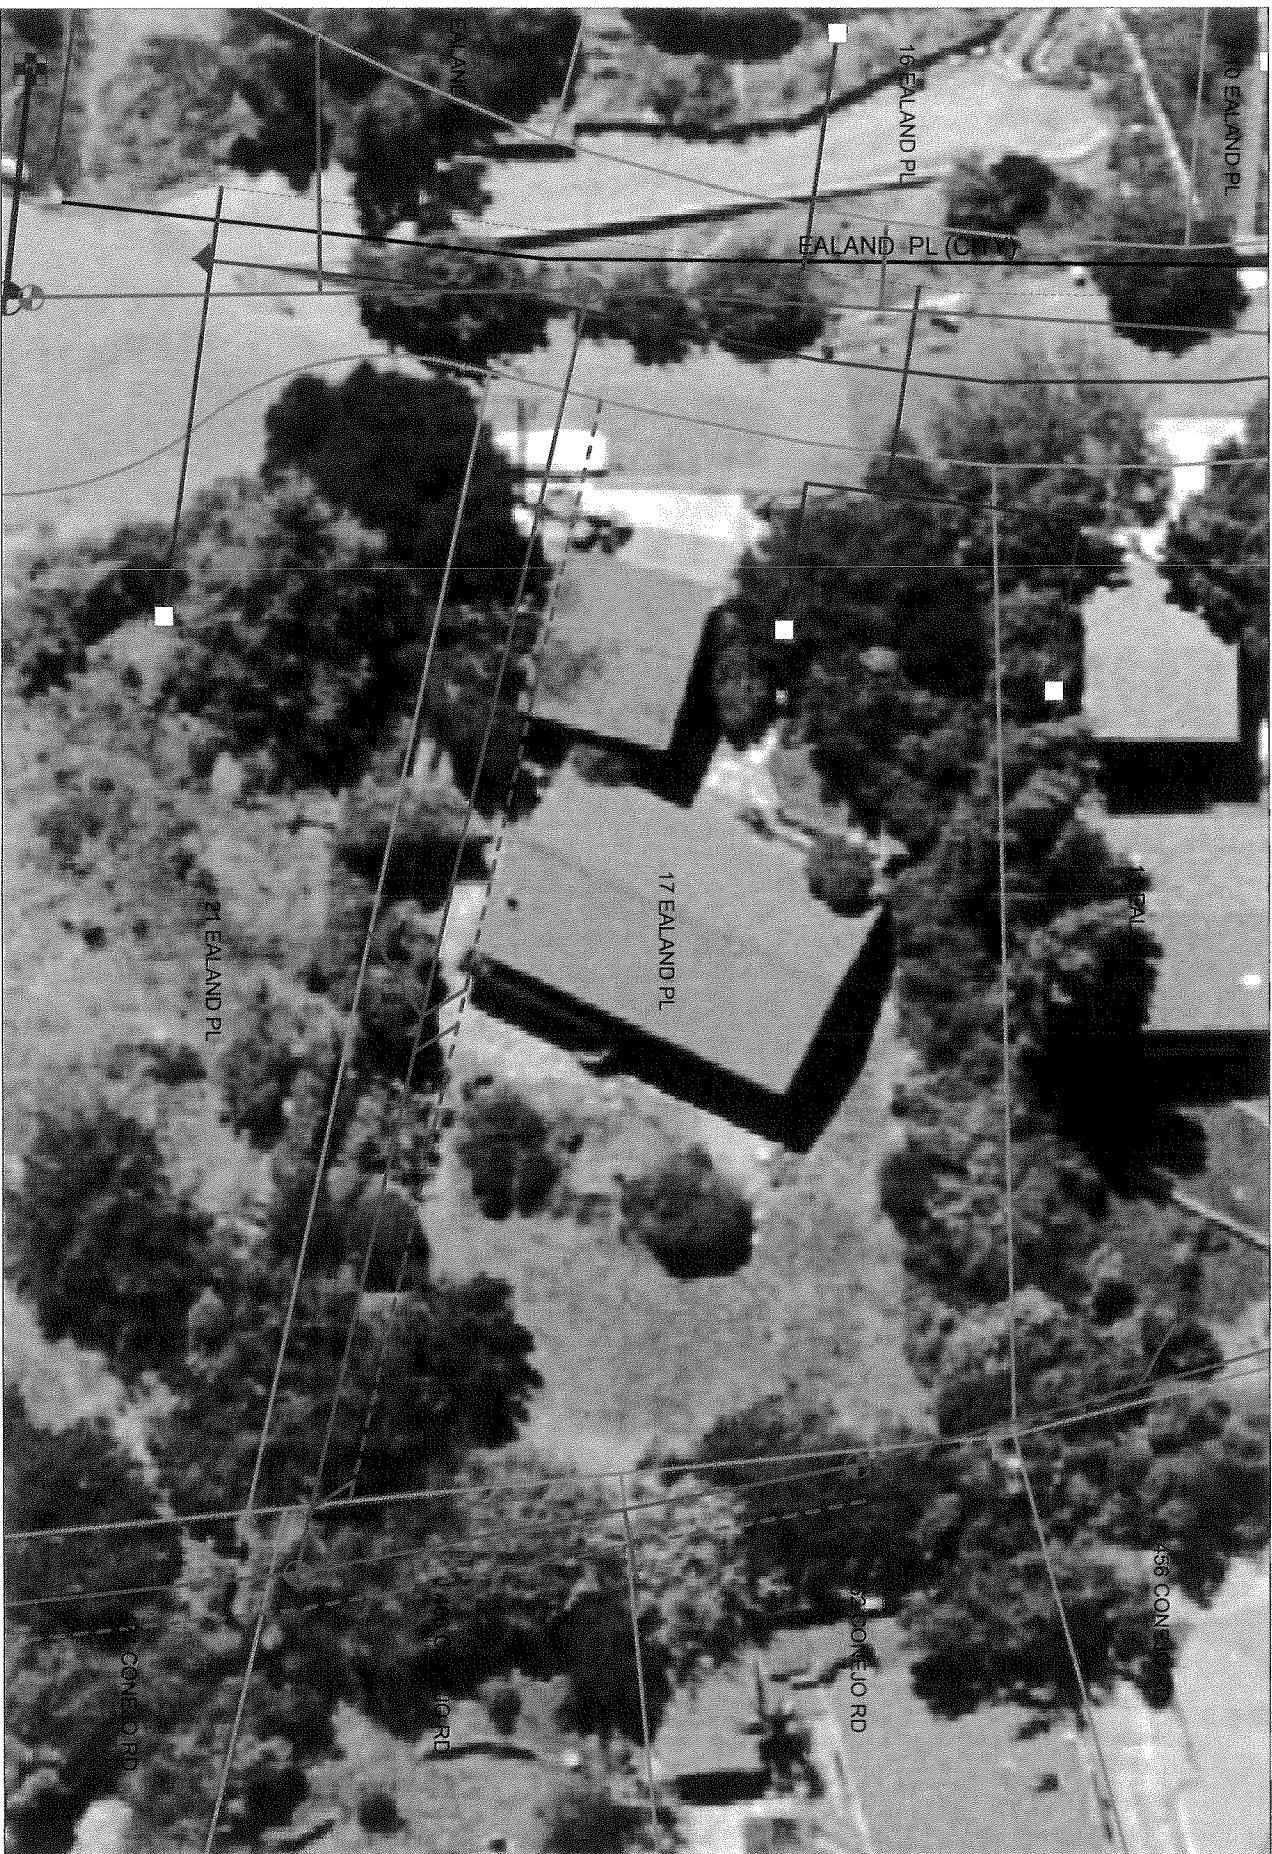


145 EL CIELITO






N

660 LAS ALTURAS RD



1117 LAS ALTURAS RD

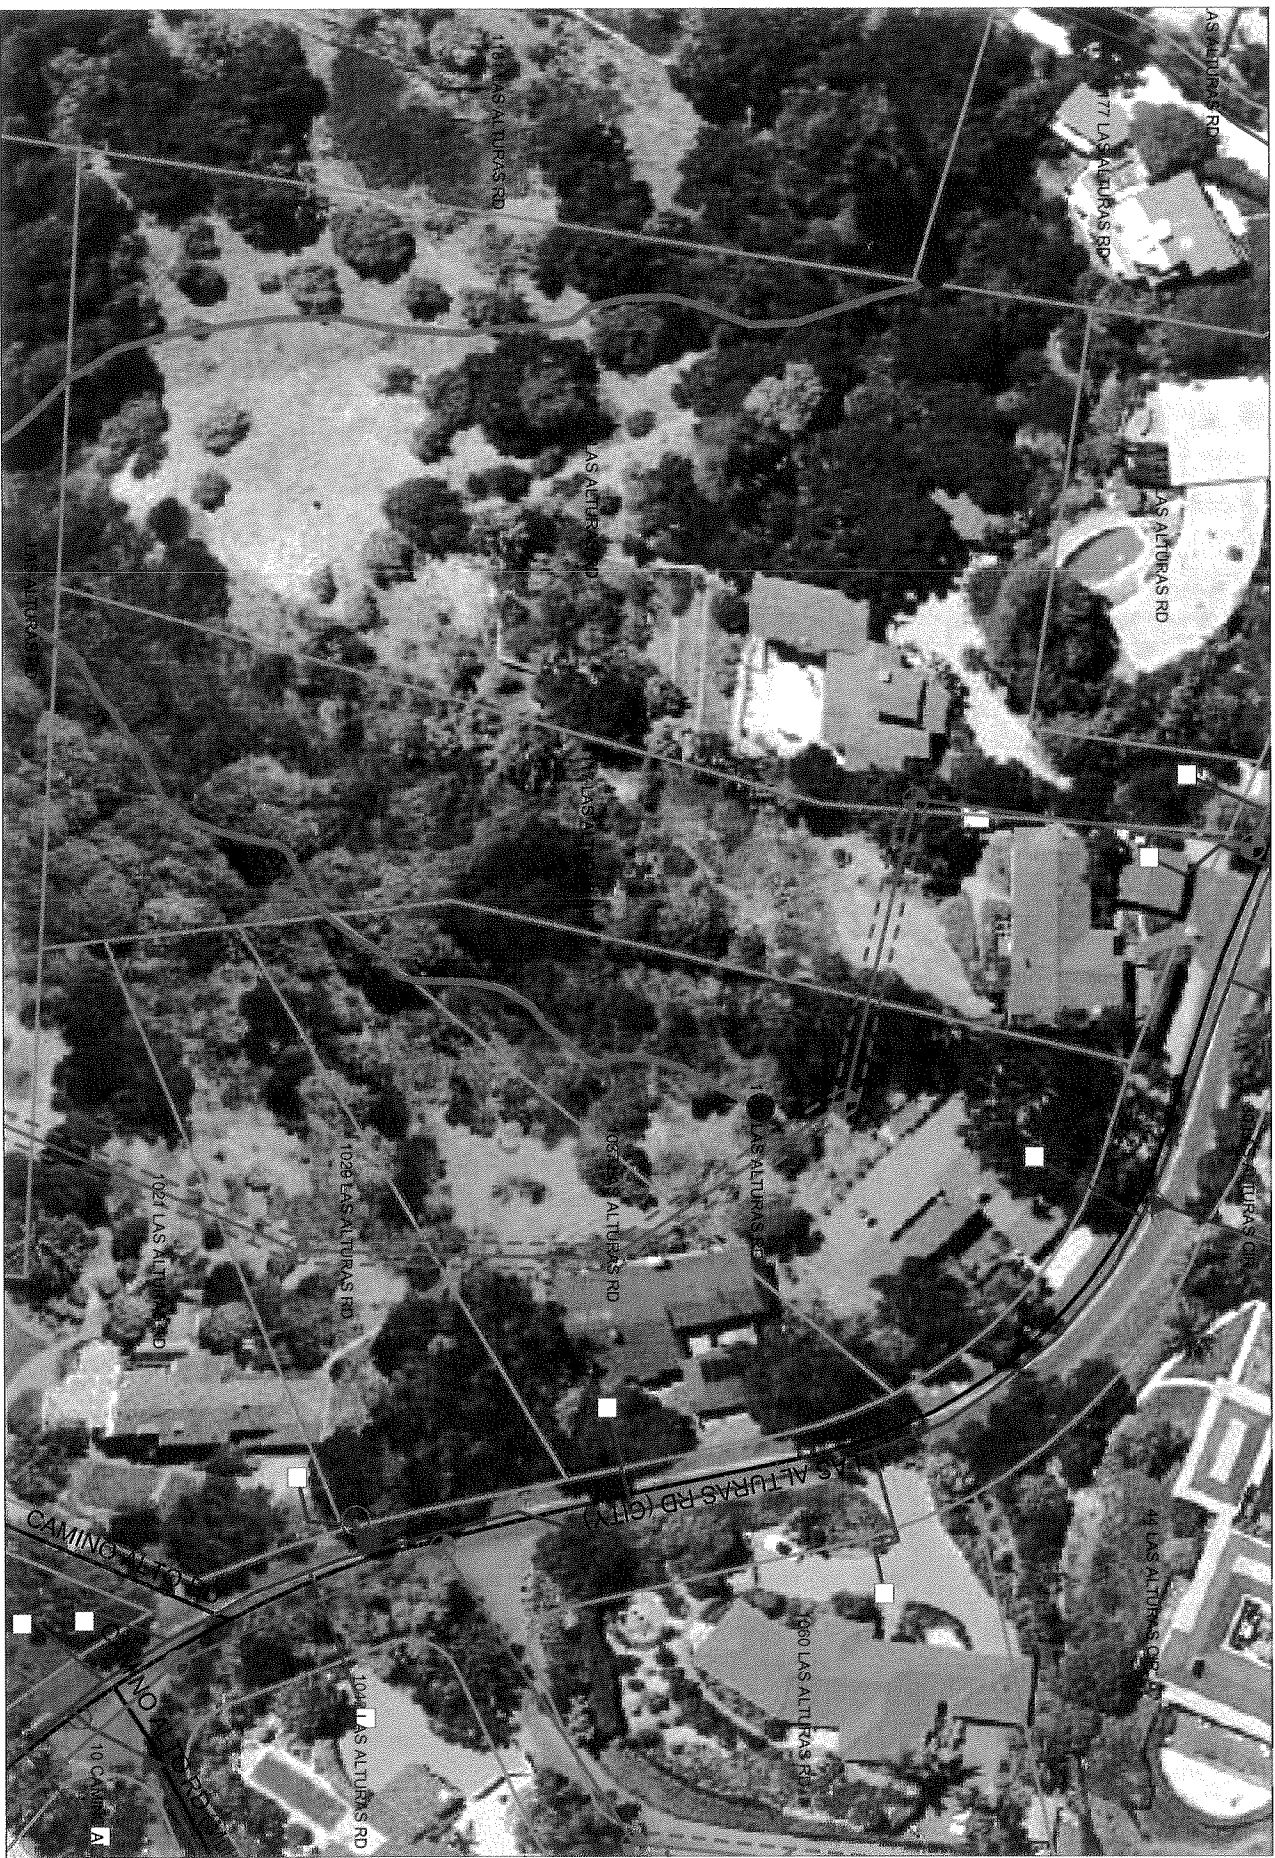

[illegible]


1957 STANWOOD




C

- Date: 1-16-09
- Property Address: 1A CAMINO VERDE
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: N/A
- Size & material type of lateral: 4" clay
- Depth of Wye connection: 30"
- Distance of lateral from centerline of downstream manhole: N/A
- Excavation dimensions: 3x3
- Brief description of the site (utility conflict/traffic/soil type/other issues):


⊗ = CAP

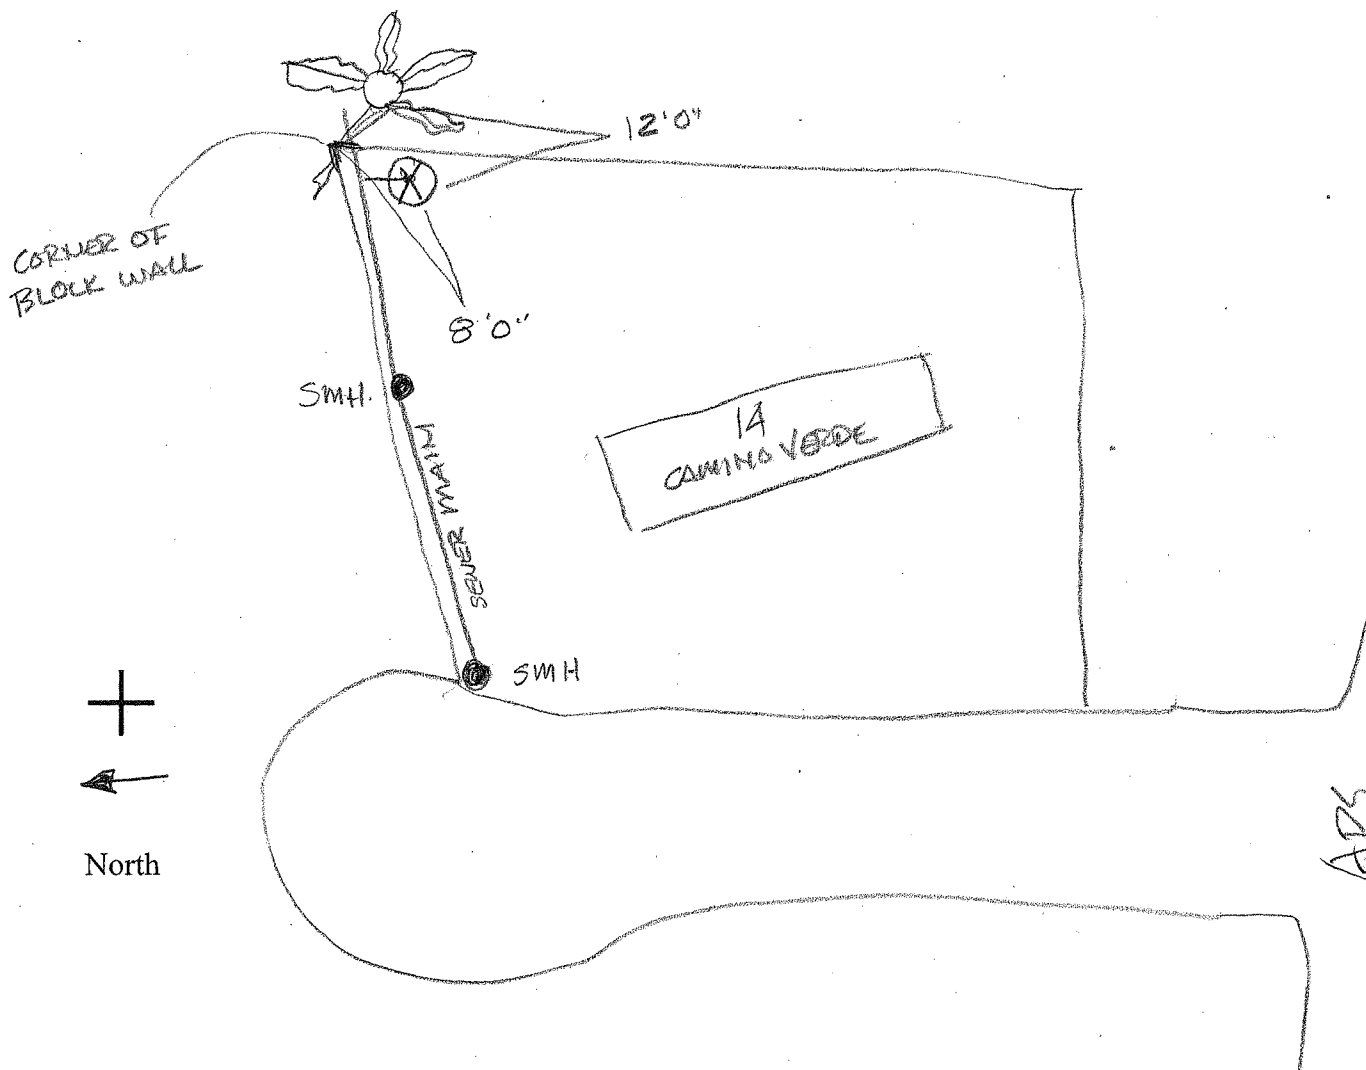


- Date: 1-5-09
- Property Address: 17 CAMINO VERDE
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: N/A
- Size & material type of lateral: 4" ABS
- Depth of Wye connection: 18"
- Distance of lateral from centerline of downstream manhole: 108
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

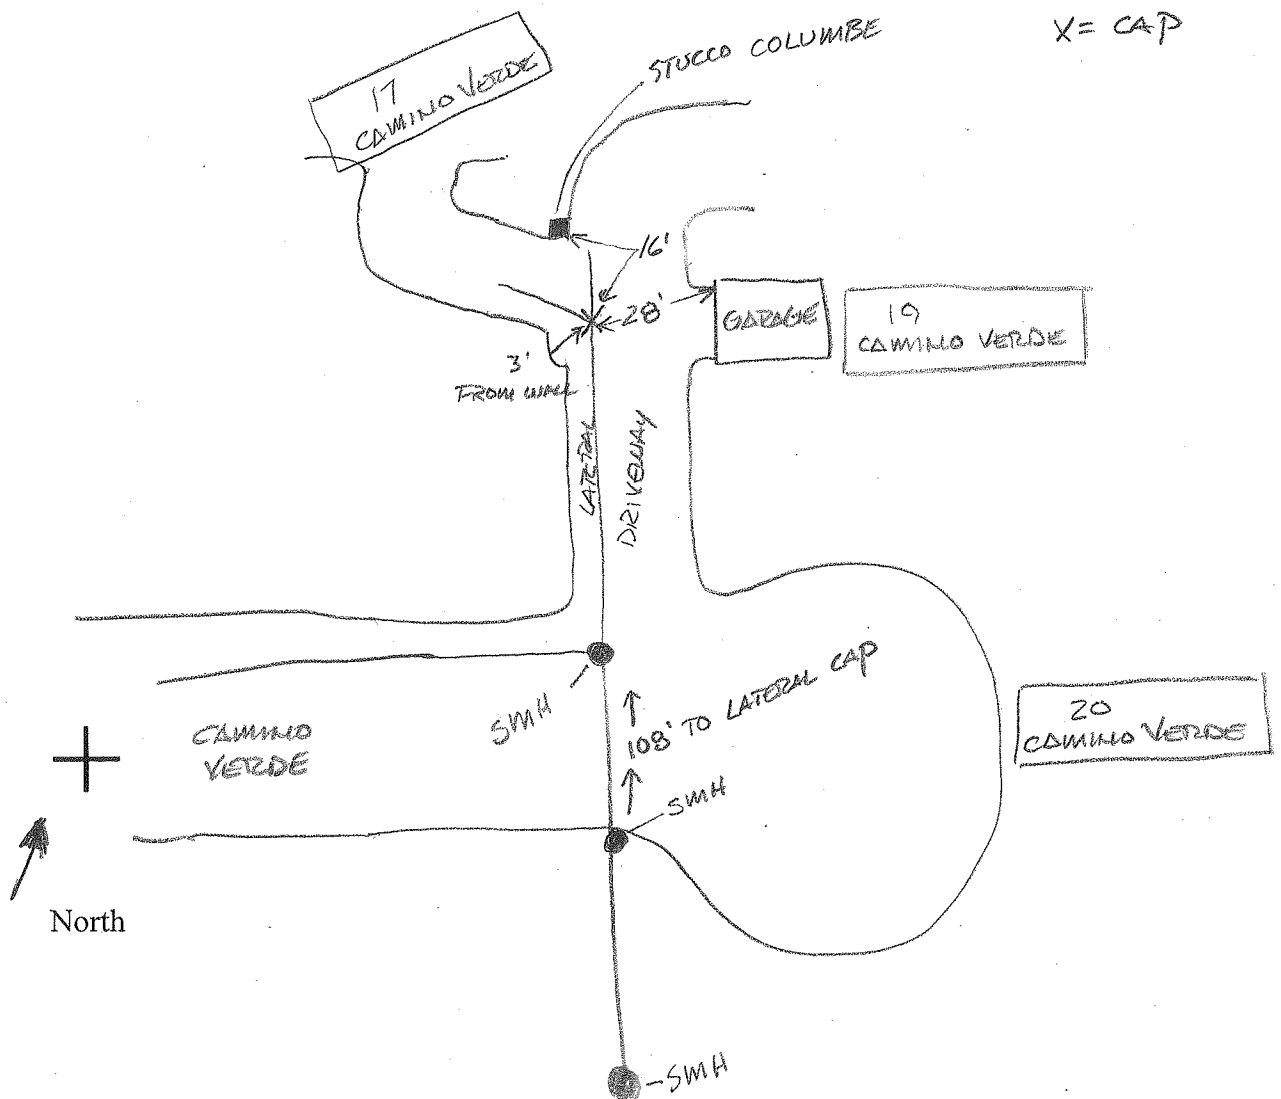


- Date: 12-31-08
- Property Address: 19 CAMINO VERDE
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral: 4" ABS
- Depth of Wye connection: 3'
- Distance of lateral from centerline of ^{UPSTREAM} ~~downstream~~ manhole: 61'
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

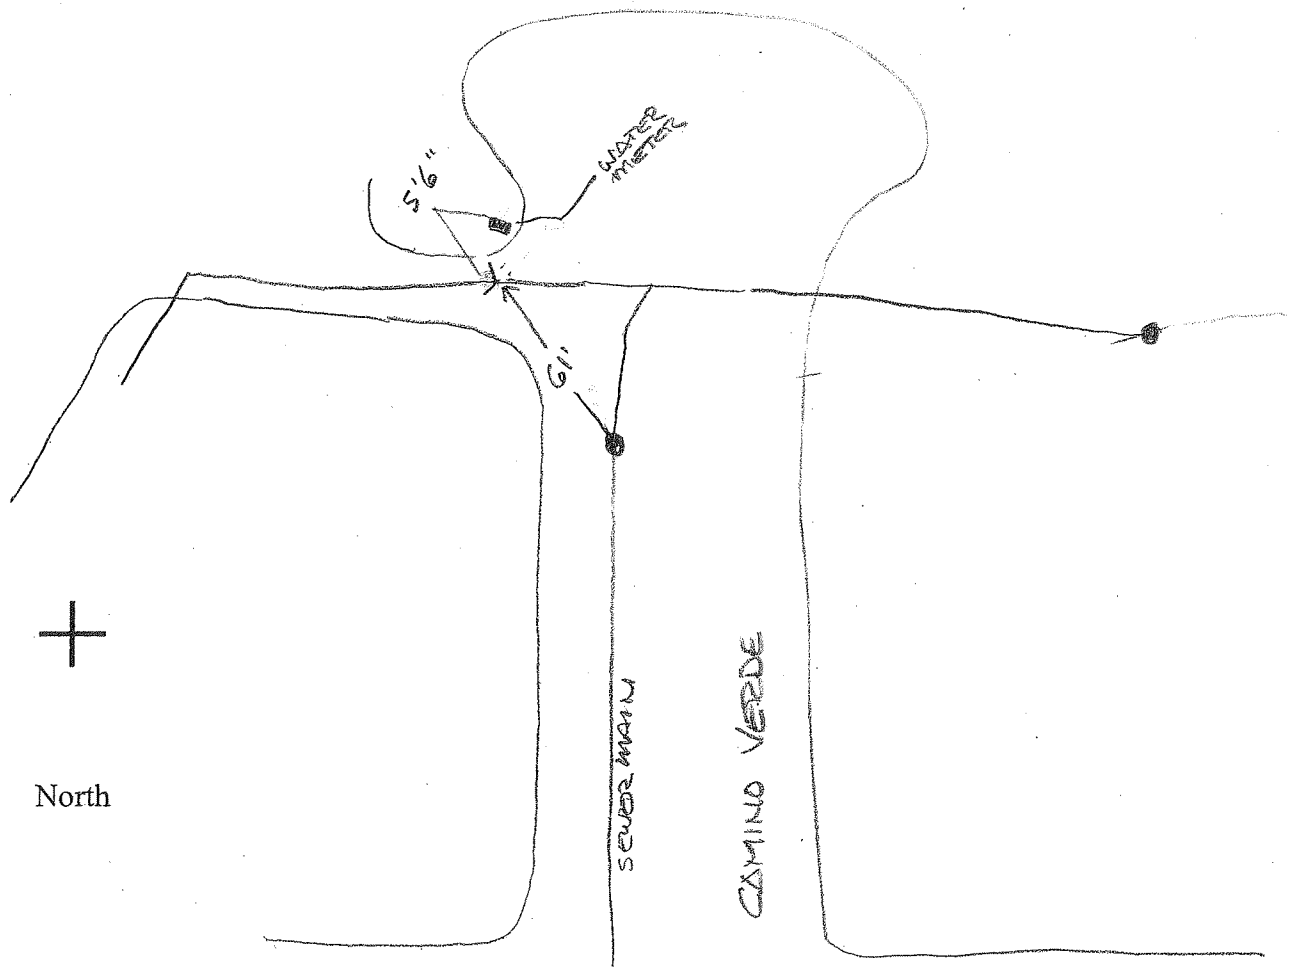


- **Date:** 1-5-09
- **Property Address:** 20 CAMINO VERDE
- **Location/Address of actual excavation (also see diagram attached):**
- **Size & material type of sewer main:**
- **Size & material type of lateral:**
- **Depth of Wye connection:** 2'
- **Distance of lateral from centerline of downstream manhole:**
- **Excavation dimensions:**
- **Brief description of the site (utility conflict/traffic/soil type/other issues):**

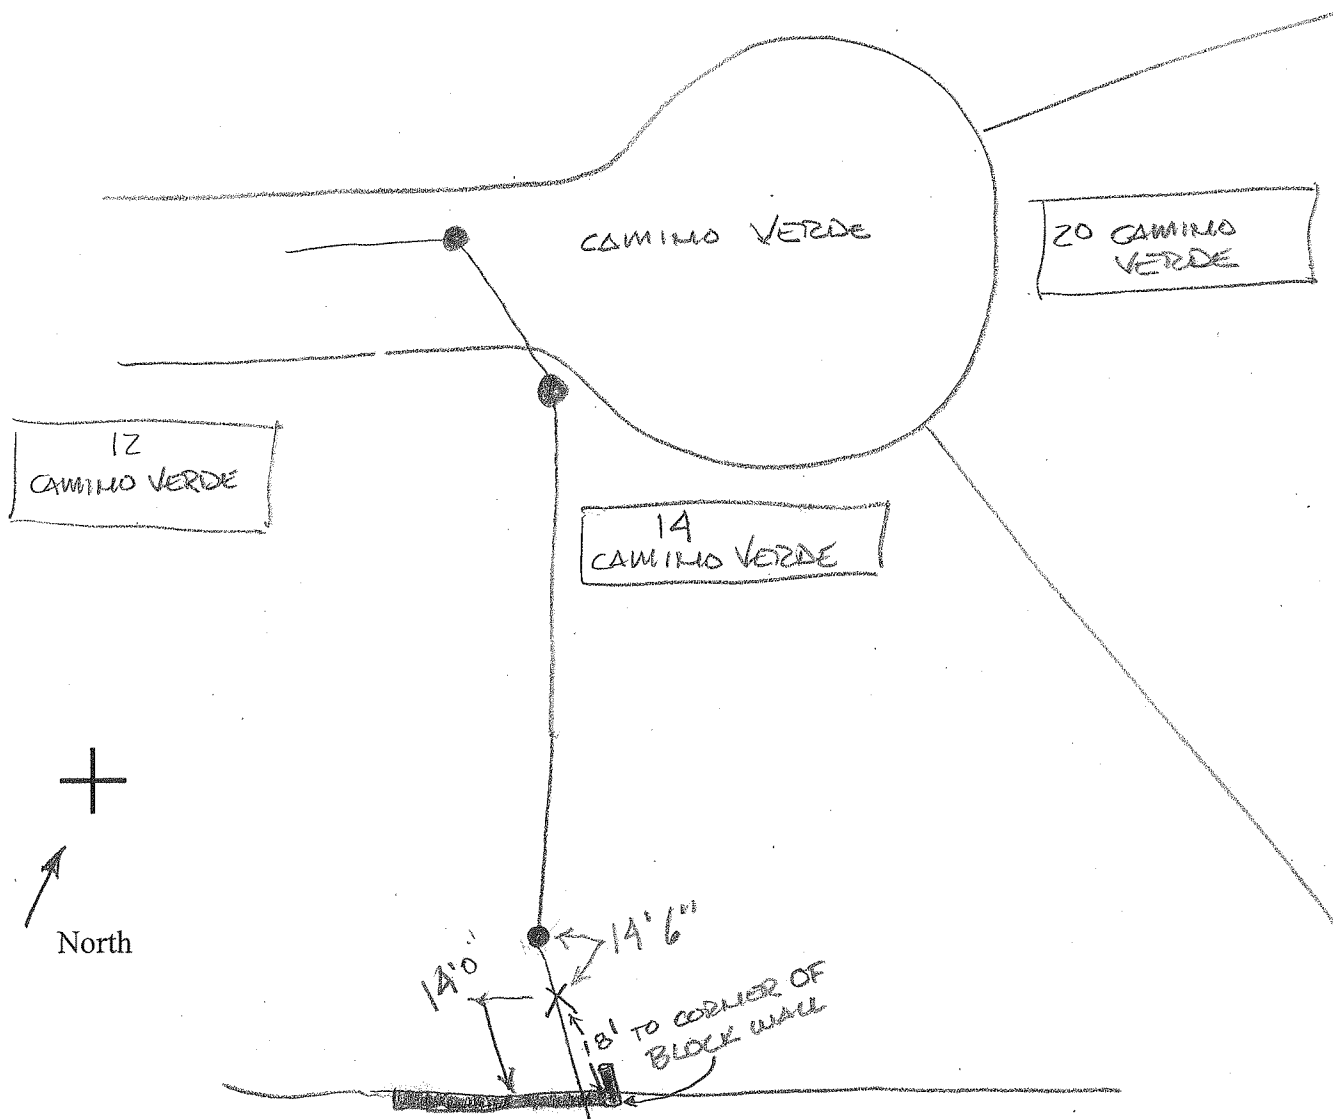


- Date: 1-5-09
- Property Address: 684 CIRCLE
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral:
- Depth of Wye connection: 5'
- Distance of lateral from centerline of downstream manhole: 88'
- Excavation dimensions: 2x3
- Brief description of the site (utility conflict/traffic/soil type/other issues): None

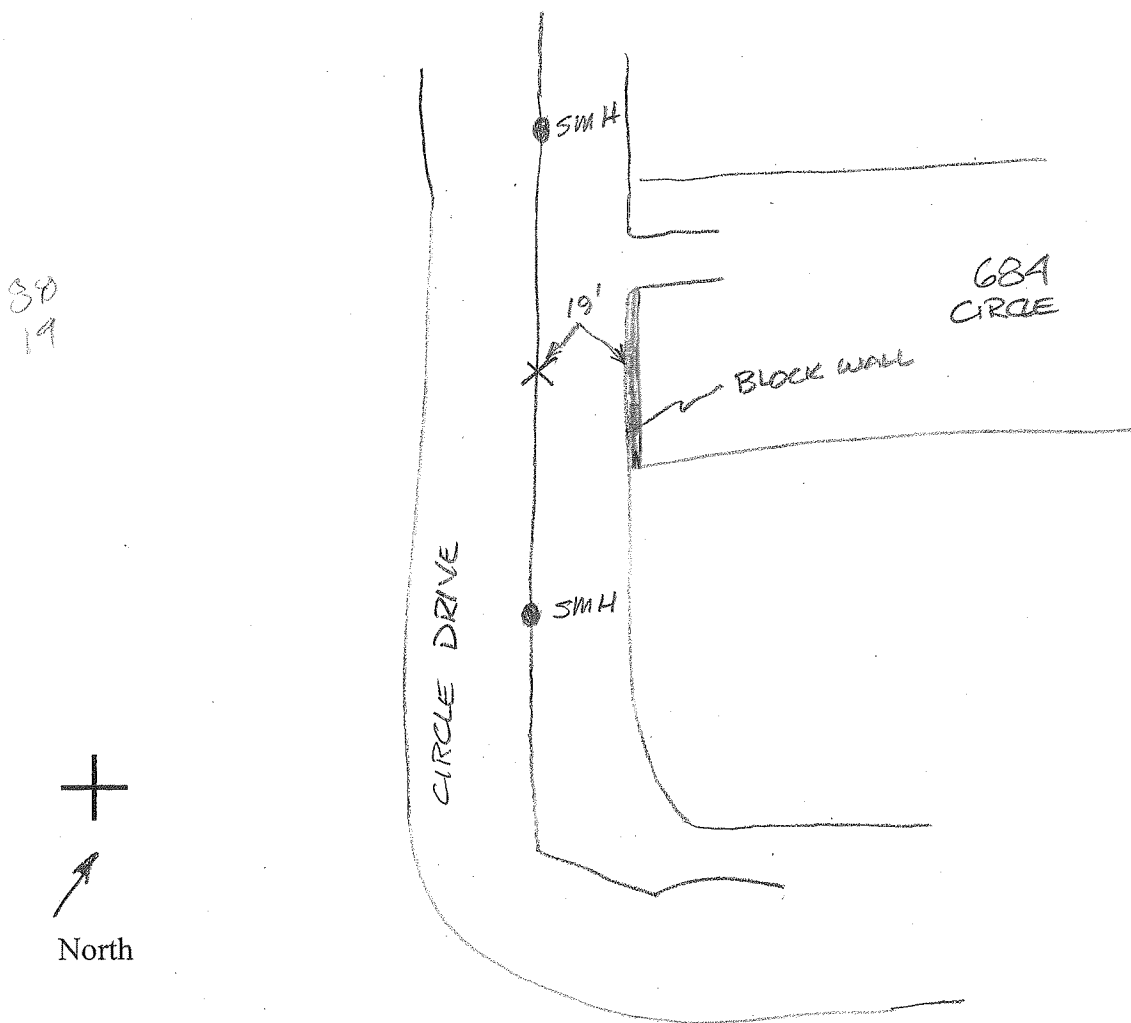


- Date: 1-5-09
- Property Address: 710 CIRCLE
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral: 4"
- Depth of Wye connection: 5'
- Distance of lateral from centerline of downstream manhole: 218'
- Excavation dimensions: 2x4
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

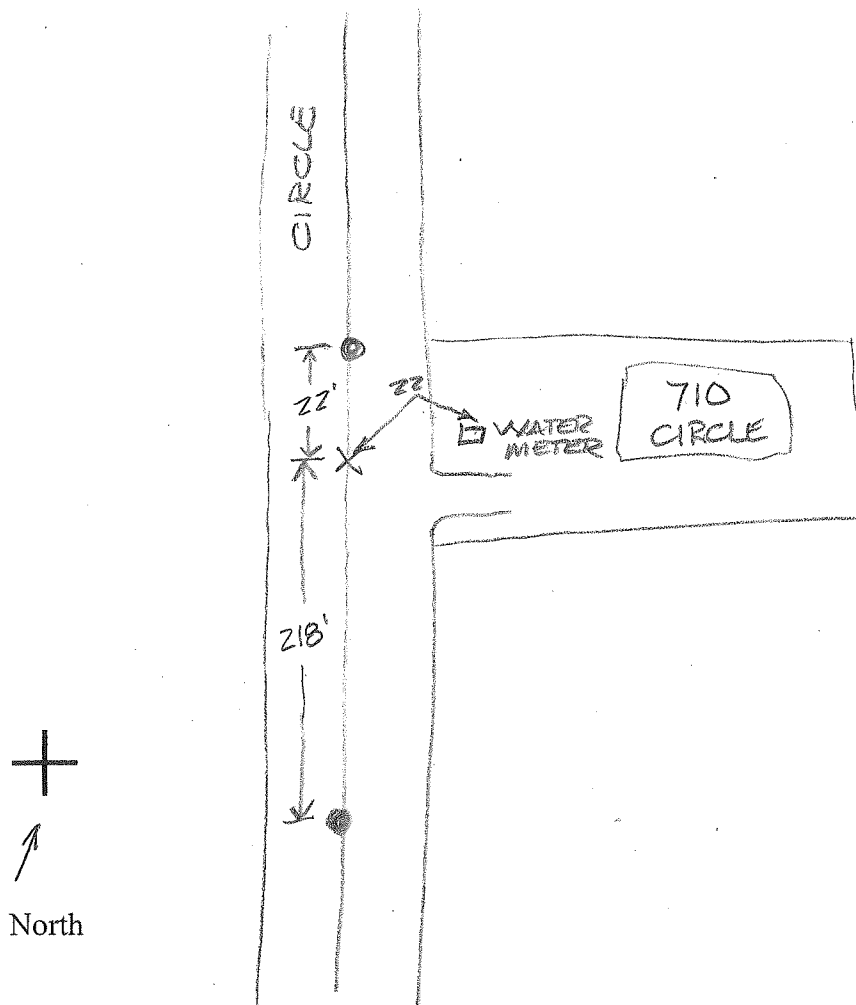


- Date: 1-5-09
- Property Address: 715 circle
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral: 4"
- Depth of Wye connection: 5'
- Distance of lateral from centerline of downstream manhole: 45'
- Excavation dimensions: 2x4
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

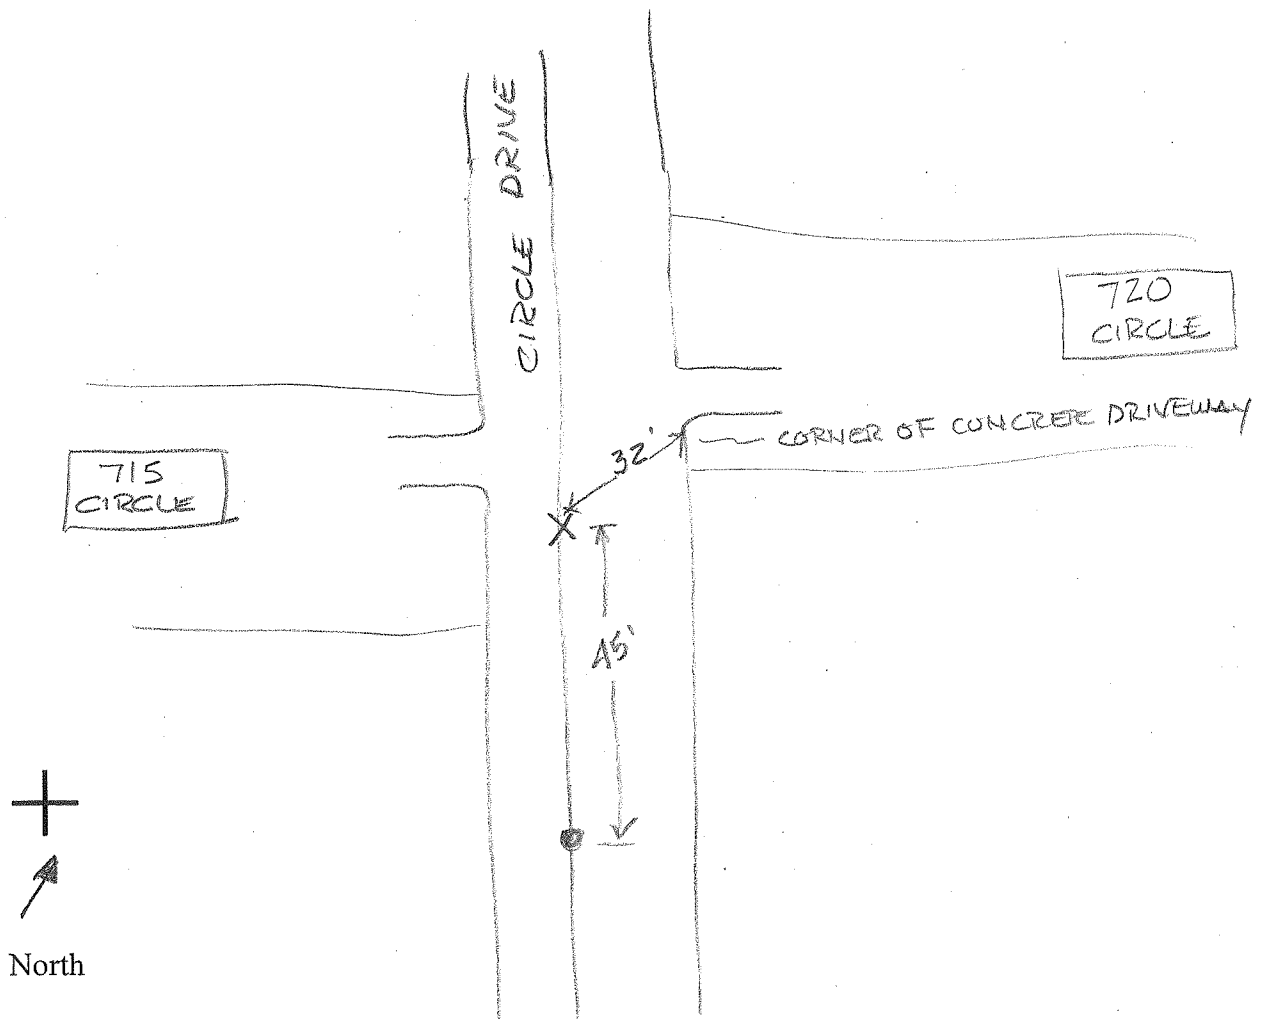

- Date: 12-19-08
- Property Address: 217 CONESO
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: 6" PVC w/ PVC SADDLE
- Size & material type of lateral: 4" ABS
- Depth of Wye connection: 3'6"
- Distance of lateral from centerline of downstream manhole: 135'6"
- Excavation dimensions: 5x2
- Brief description of the site (utility conflict/traffic/soil type/other issues): U/G NEARBY

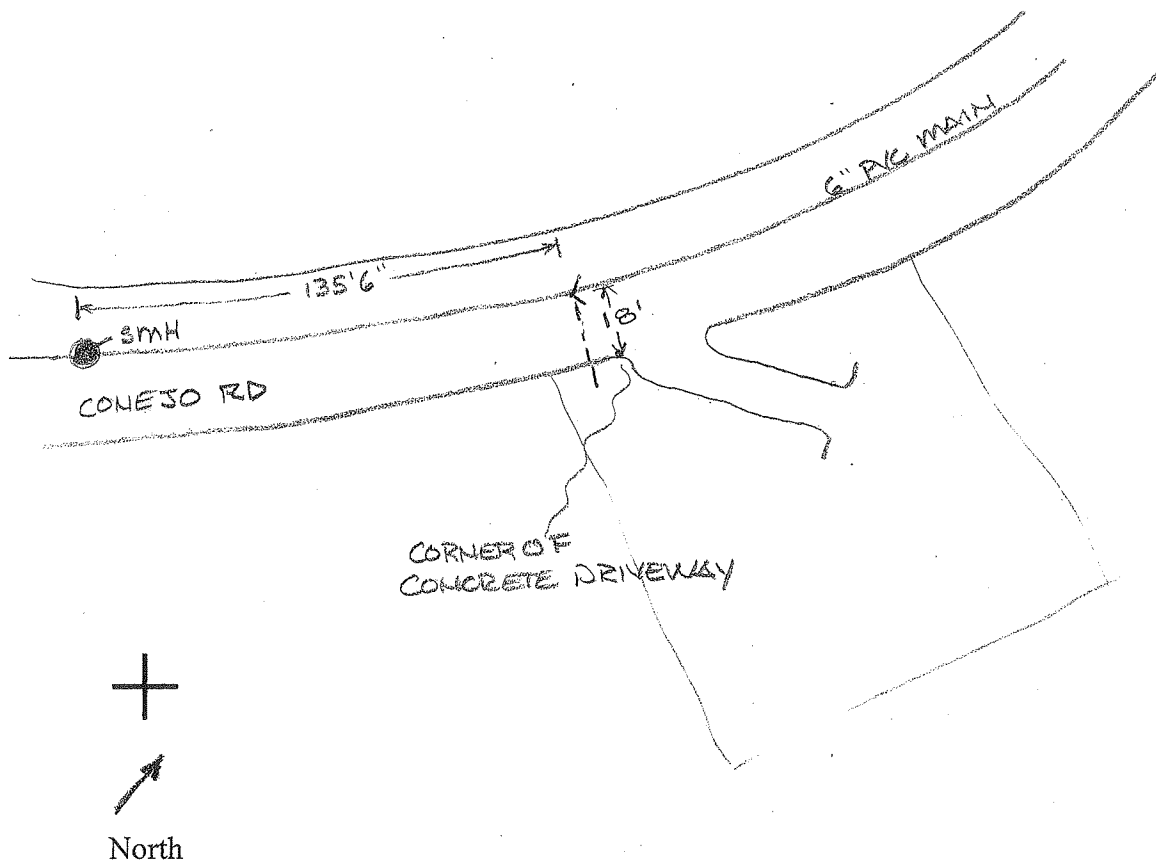


- Date: 12-23-08
- Property Address: 219
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: 6" PVC
- Size & material type of lateral: 4" ABS
- Depth of Wye connection: 3' 6"
- Distance of lateral from centerline of downstream manhole: 274'
- Excavation dimensions: 4' X 3'
- Brief description of the site (utility conflict/traffic/soil type/other issues):

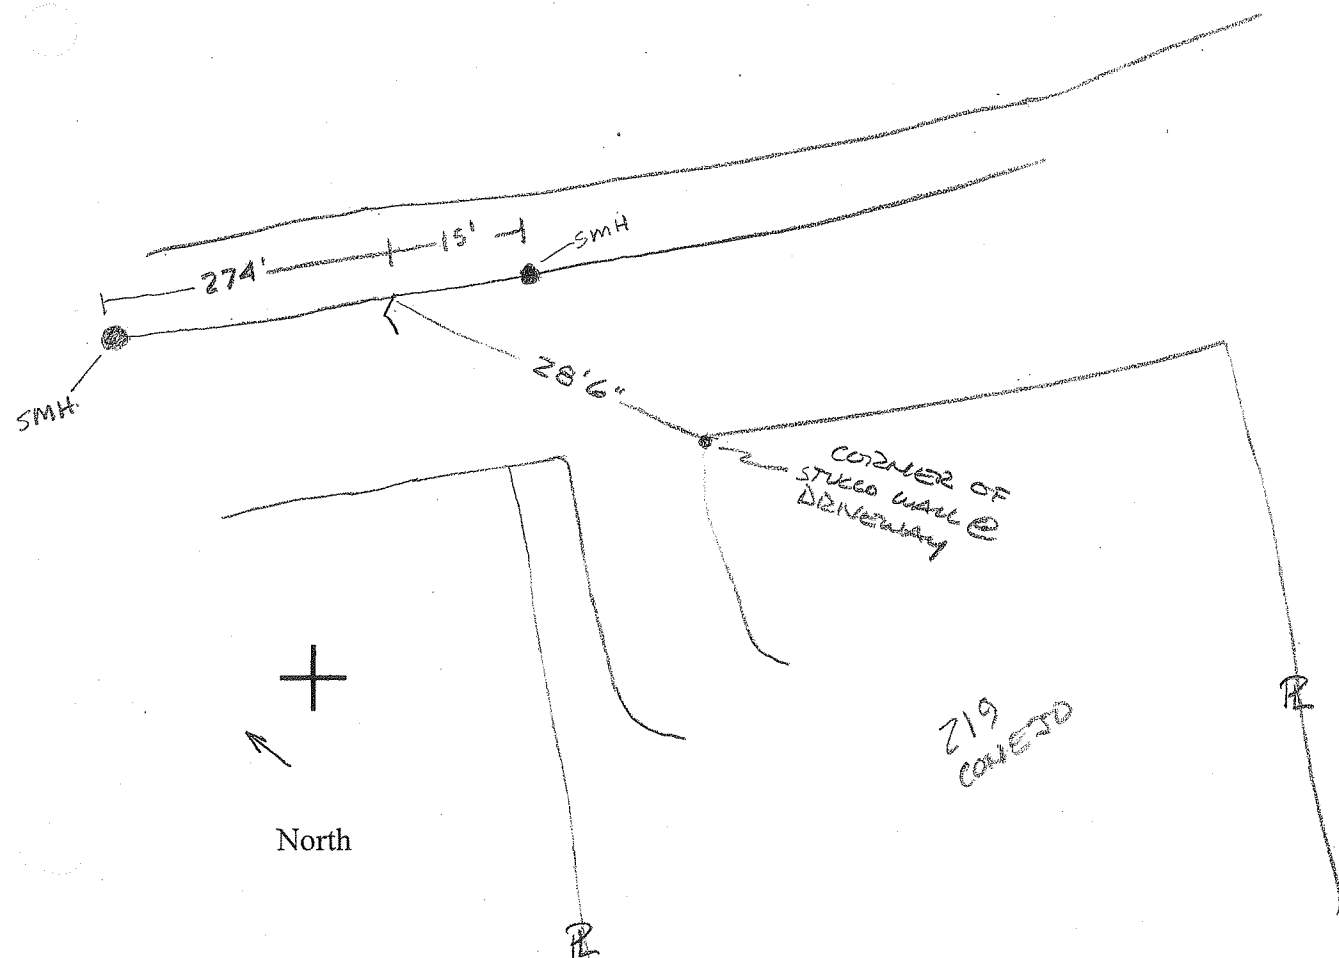


- Date: 12-19-08
- Property Address: 225 CONESO
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main:
- Size & material type of lateral:
- Depth of Wye connection:
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

80' FROM D.S. SMH
 16' FROM CORNER OF STUCCO
 WALL @ EAST SIDE OF
 DRIVEWAY.

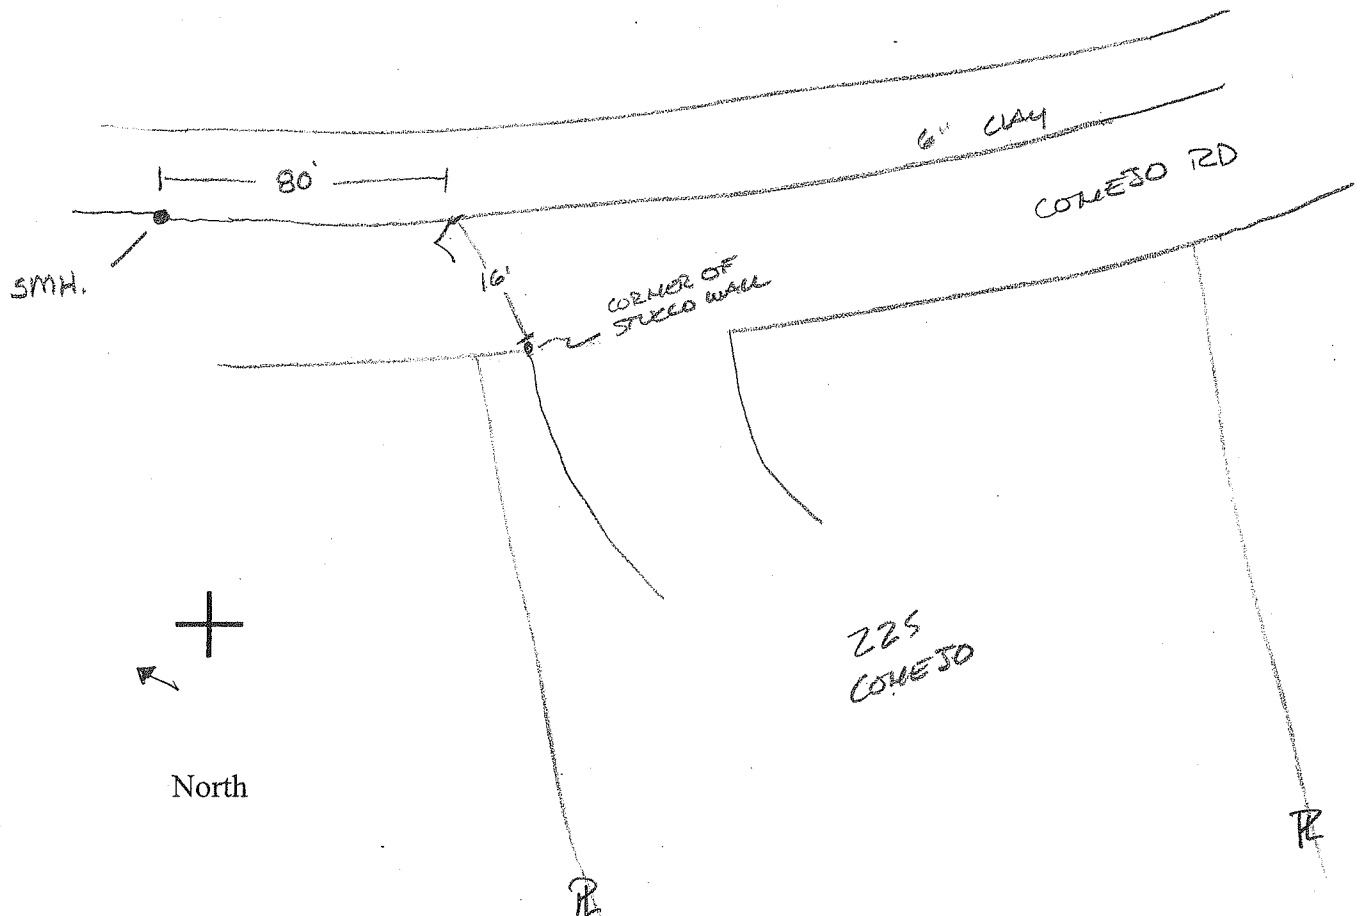


- Date: 12-19-08
- Property Address: 241 CONEJO
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral:
- Depth of Wye connection:
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

65'6" FROM D.S. SMH
16' FROM TELEPHONE POLE

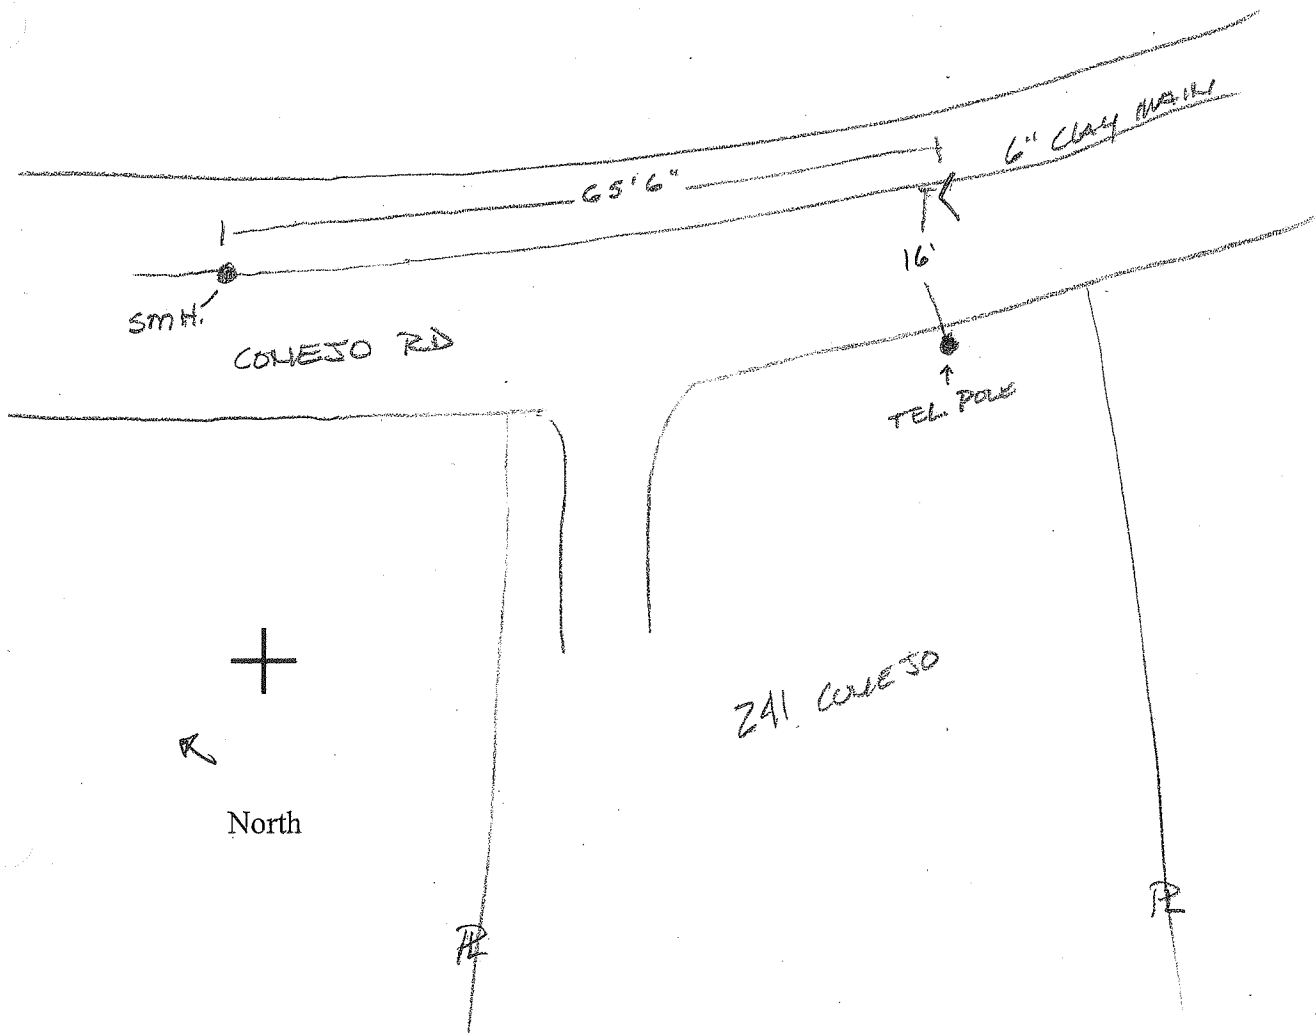


- Date: 12-23-08
- Property Address: 265 CONEJO
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: UNKNOWN - PLASTIC WYE
- Size & material type of lateral: 4" SDR
- Depth of Wye connection: 4'6"
- Distance of lateral from centerline of downstream manhole: 101'6"
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

101'6" FROM D.S. SMH
 8'0" FROM C OF STORM DRAIN GRATE

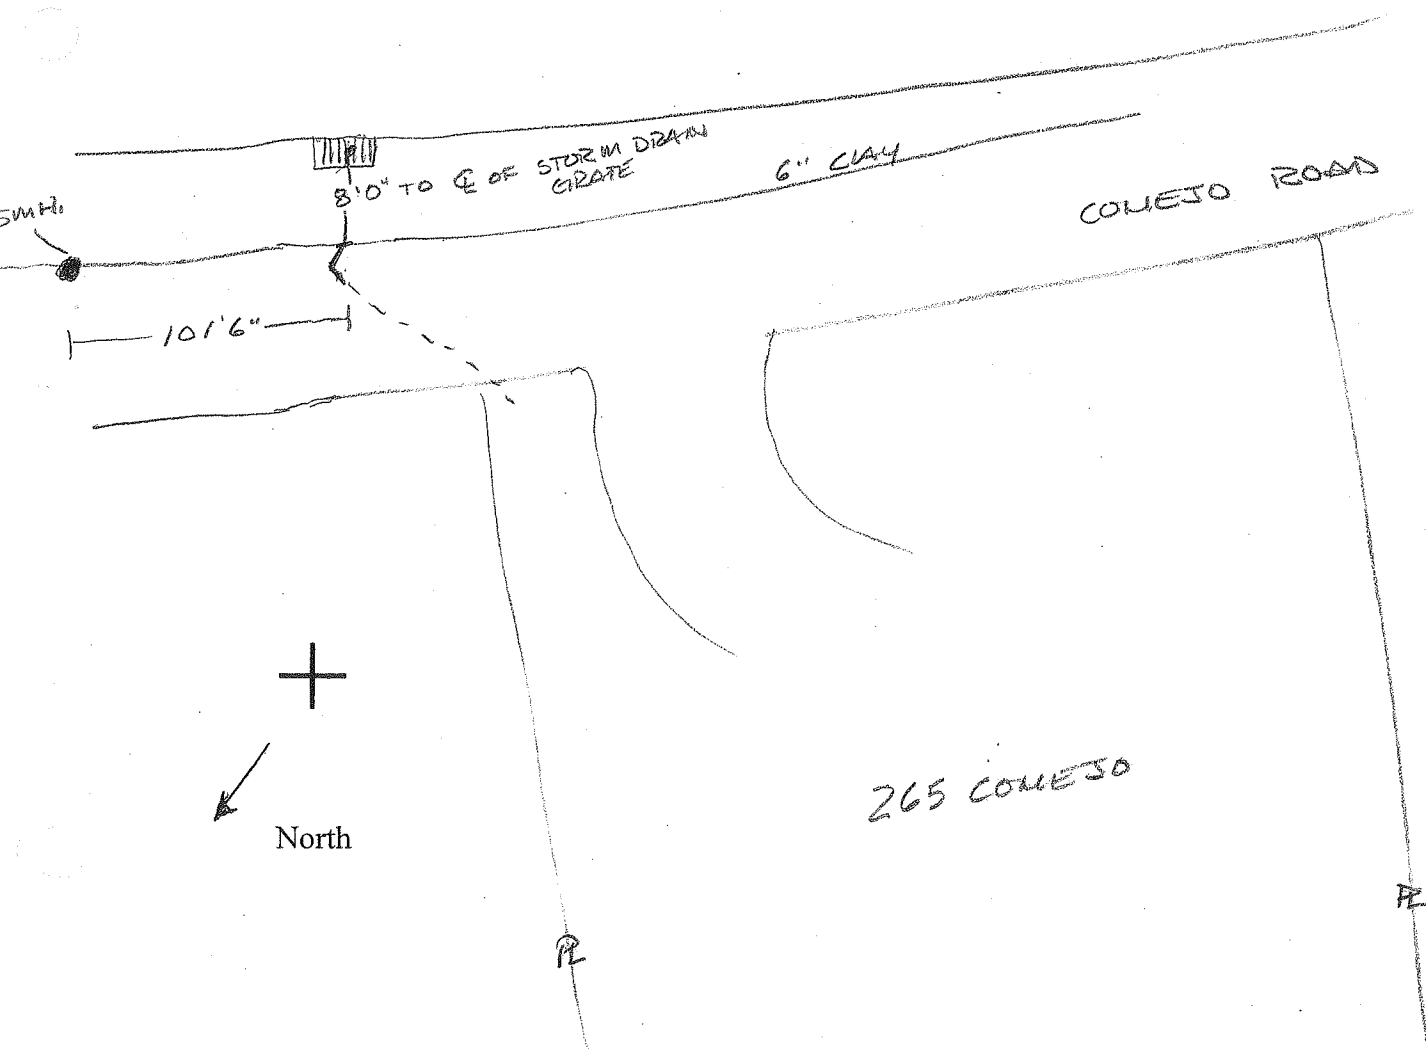


- Date: 1-13-09
- Property Address: 327 CONEJO RD
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral: 4" SLIP LINED
- Depth of ^{PLUG}Wye connection: 6'
- Distance of lateral from centerline of downstream manhole: N/A
- Excavation dimensions: 3x4
- Brief description of the site (utility conflict/traffic/soil type/other issues): LATERAL ON SHERMAN RD.

⊗ = PLUG - 3' BEHIND
Δ.C. CURB

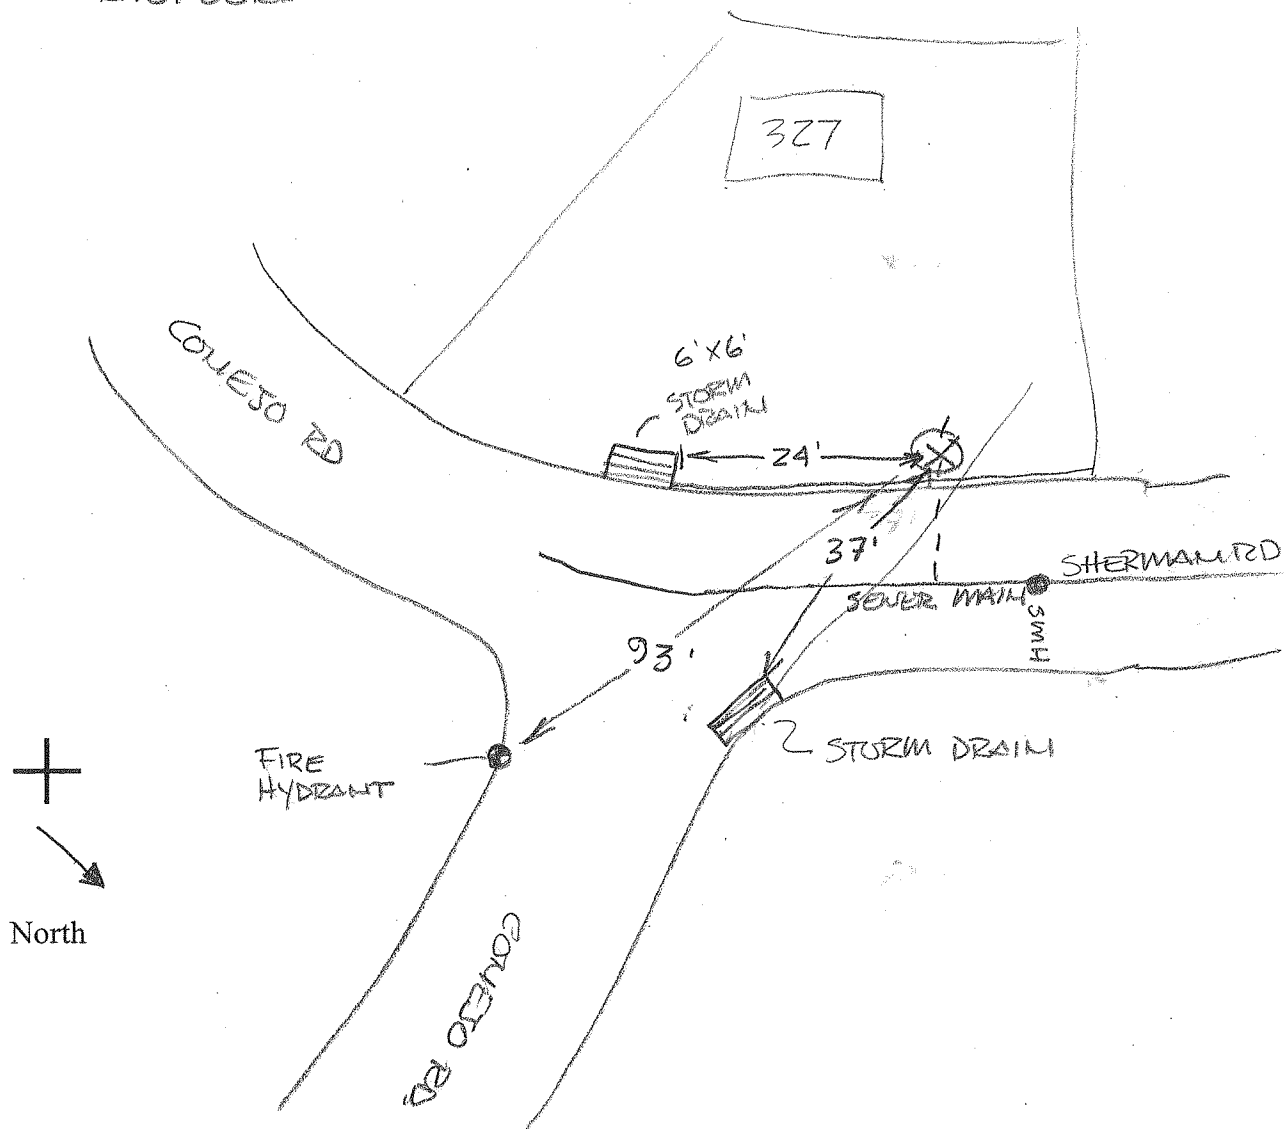


- Date: 12-23-08
- Property Address: 327 CONESO
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: 6" CLAY
- Size & material type of lateral: 4" CLAY
- Depth of Wye connection: 7'0"
- Distance of lateral from centerline of downstream manhole: 117'
- Excavation dimensions: 3' X 5'
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

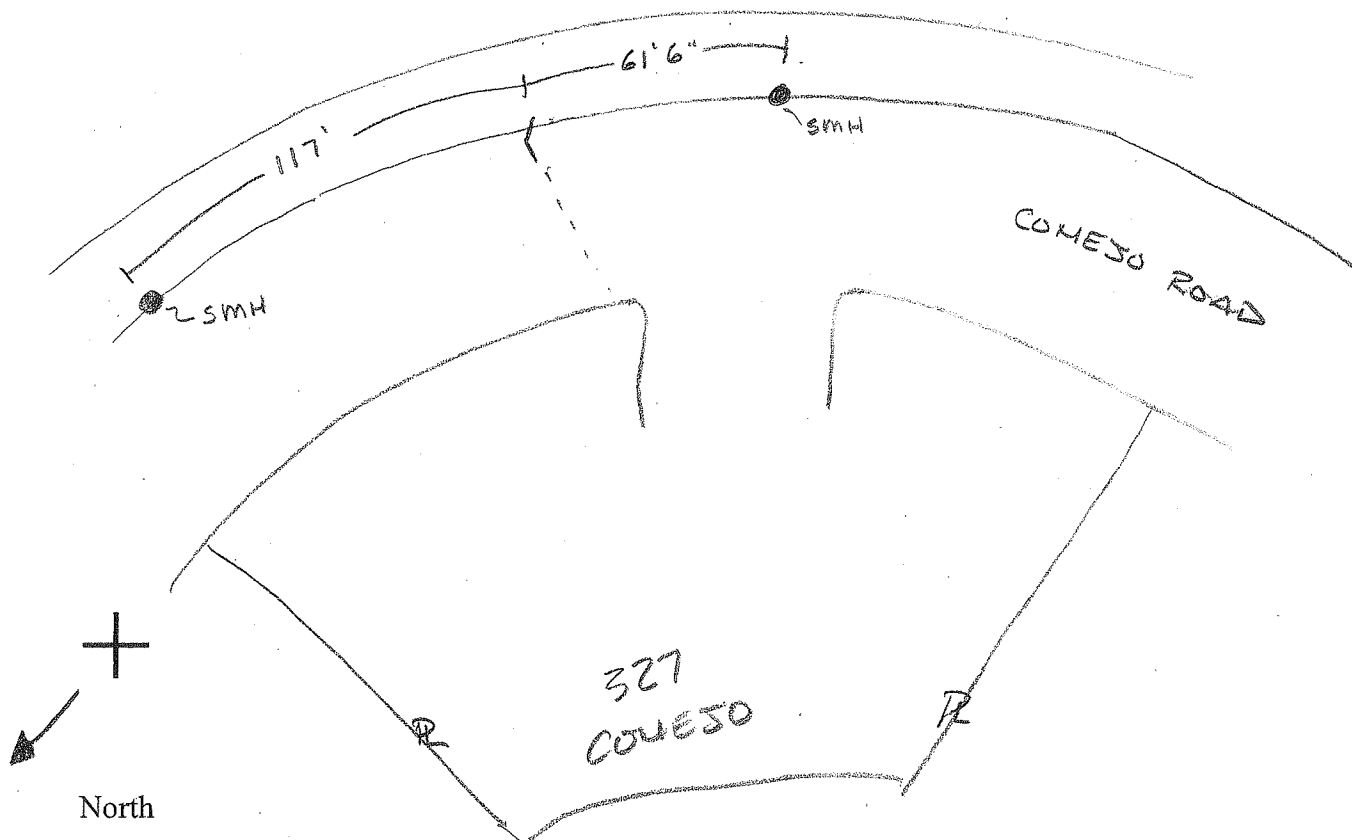


- Date: 12-23-08
- Property Address: 333 COMEJO
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: 6" VCP
- Size & material type of lateral: 4" ABS
- Depth of Wye connection: 6'
- Distance of lateral from centerline of downstream manhole: 86'
- Excavation dimensions: 3' x 4'
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

86' FROM SMH
TO LATERAL

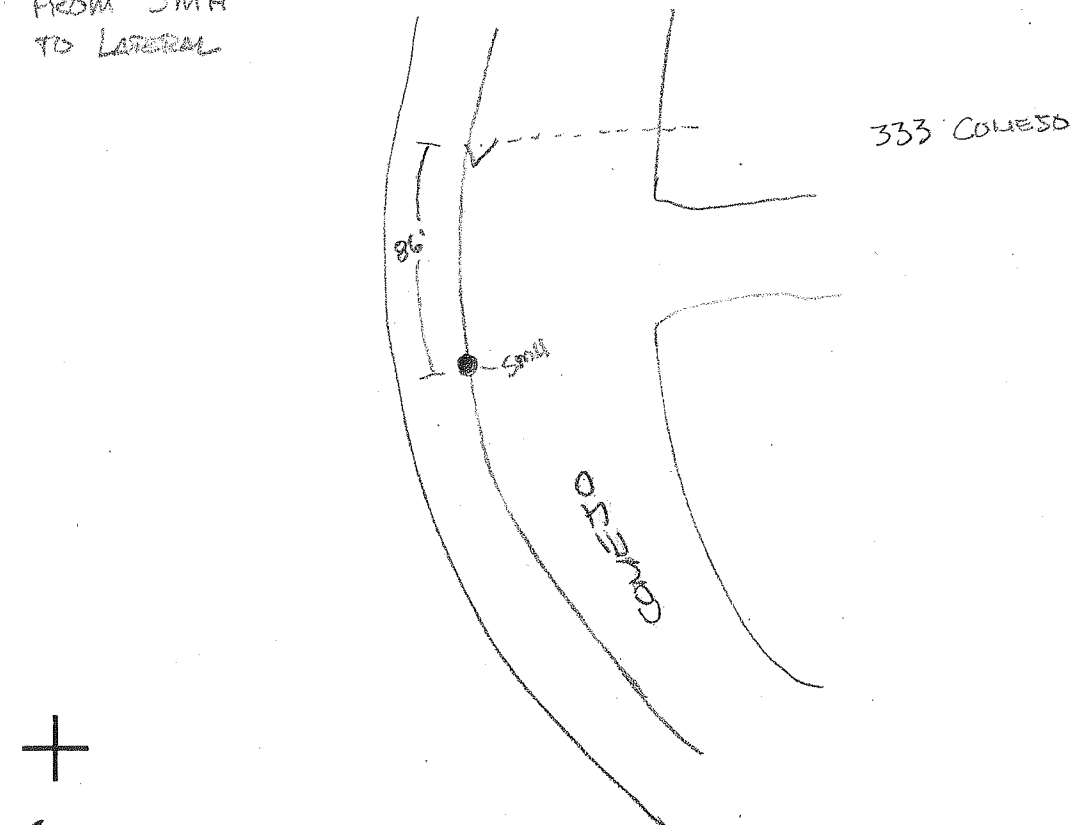

North

- Date: 1-13-09
 - Property Address: 345 CONEJO RD.
 - Location/Address of actual excavation (also see diagram attached):
 - Size & material type of sewer main: N/A
 - Size & material type of lateral: 4" CLAY
 - Depth of ^{PLUG}Wye connection: 4' 10"
 - Distance of lateral from centerline of downstream manhole: 157'
 - Excavation dimensions: 2x4
 - Brief description of the site (utility conflict/traffic/soil type/other issues): WYE "BELL" IS CRACKED @ MAIN LINE DUE TO ROOT DAMAGE
- (X) = PLUG

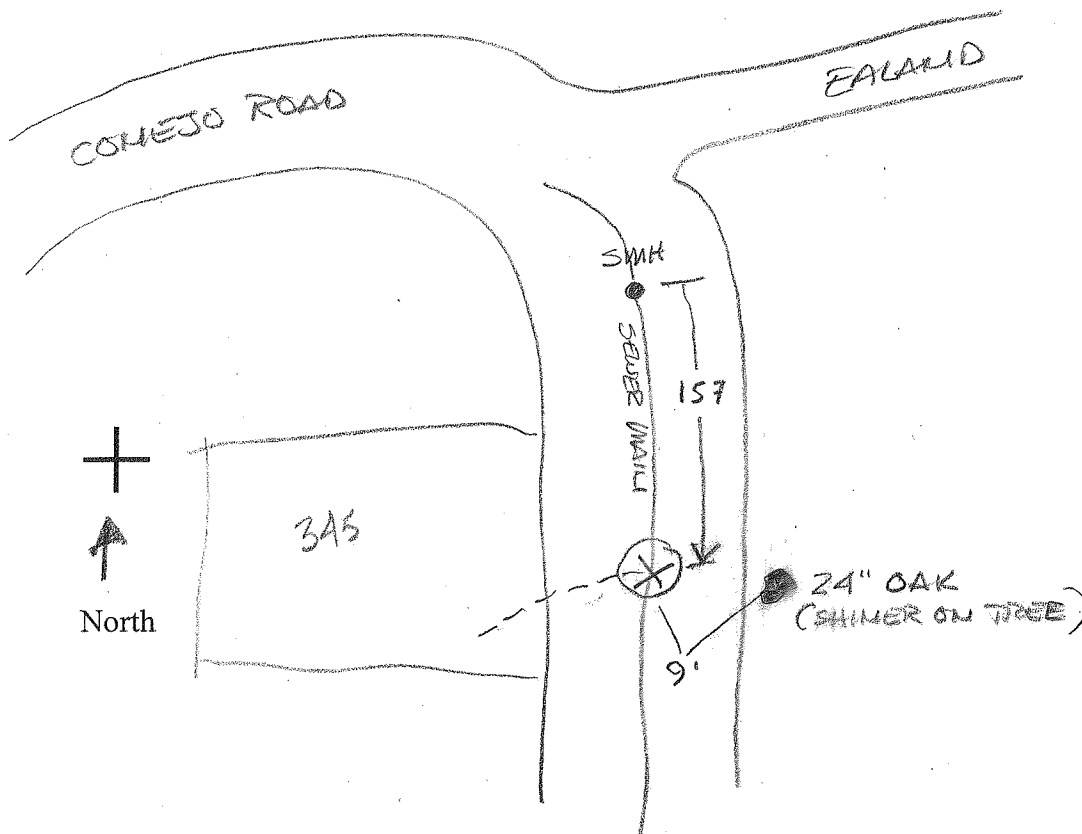

- Date: 12-24-08
- Property Address: 350 OSWEGO
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral:
- Depth of Wye connection:
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

NEED MEAS.
FROM D.S. SWH.




North


- Date: 12-24-08
- Property Address: 357 COWETO
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: 6" clay
- Size & material type of lateral: 4" ABS
- Depth of Wye connection: 5'
- Distance of lateral from centerline of downstream manhole: 22'
- Excavation dimensions: 2 x 4
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

22' FROM DOWNSTREAM
MANHOLE


10' FROM SOUTH EAST CORNER
OF DRIVEWAY

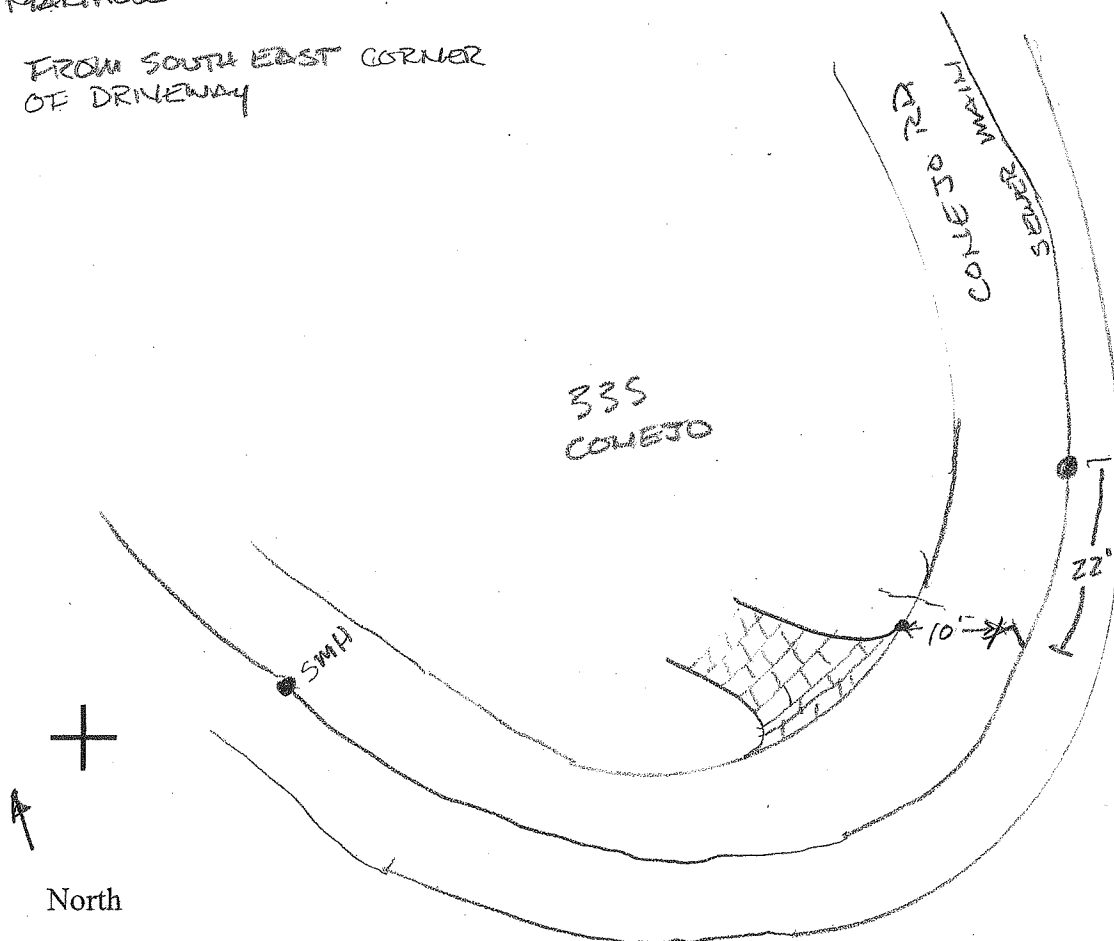

- Date: 12-29-08
- Property Address: 428 CONEJO
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral: 4" CLAY
- Depth of Wye connection:
- Distance of lateral from centerline of downstream manhole: 368' FROM D.S. SMH
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

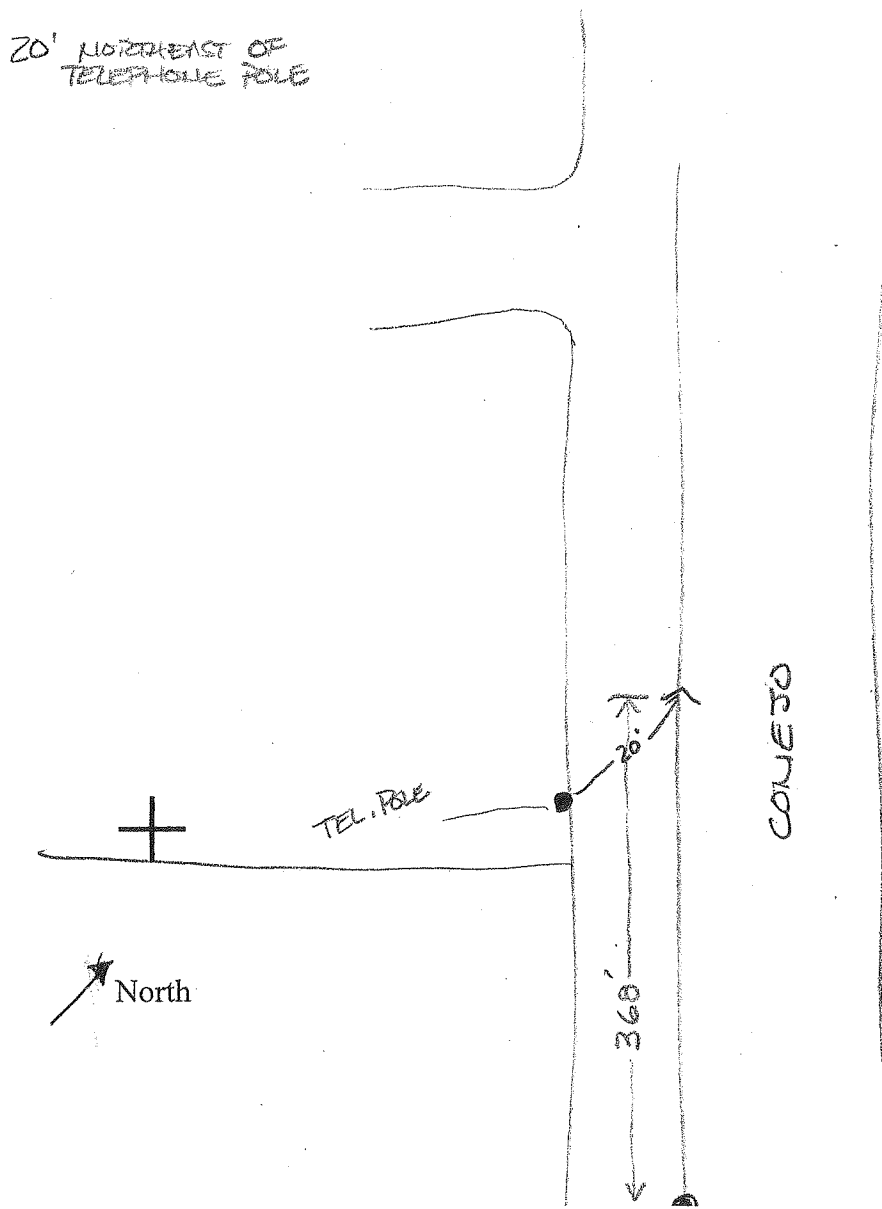


- Date: 12-30-08
- Property Address: 434 CONEJO
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main:
- Size & material type of lateral: 4" PVC
- Depth of Wye connection: 5'
- Distance of lateral from centerline of downstream manhole: 358'
- Excavation dimensions: 2x4
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

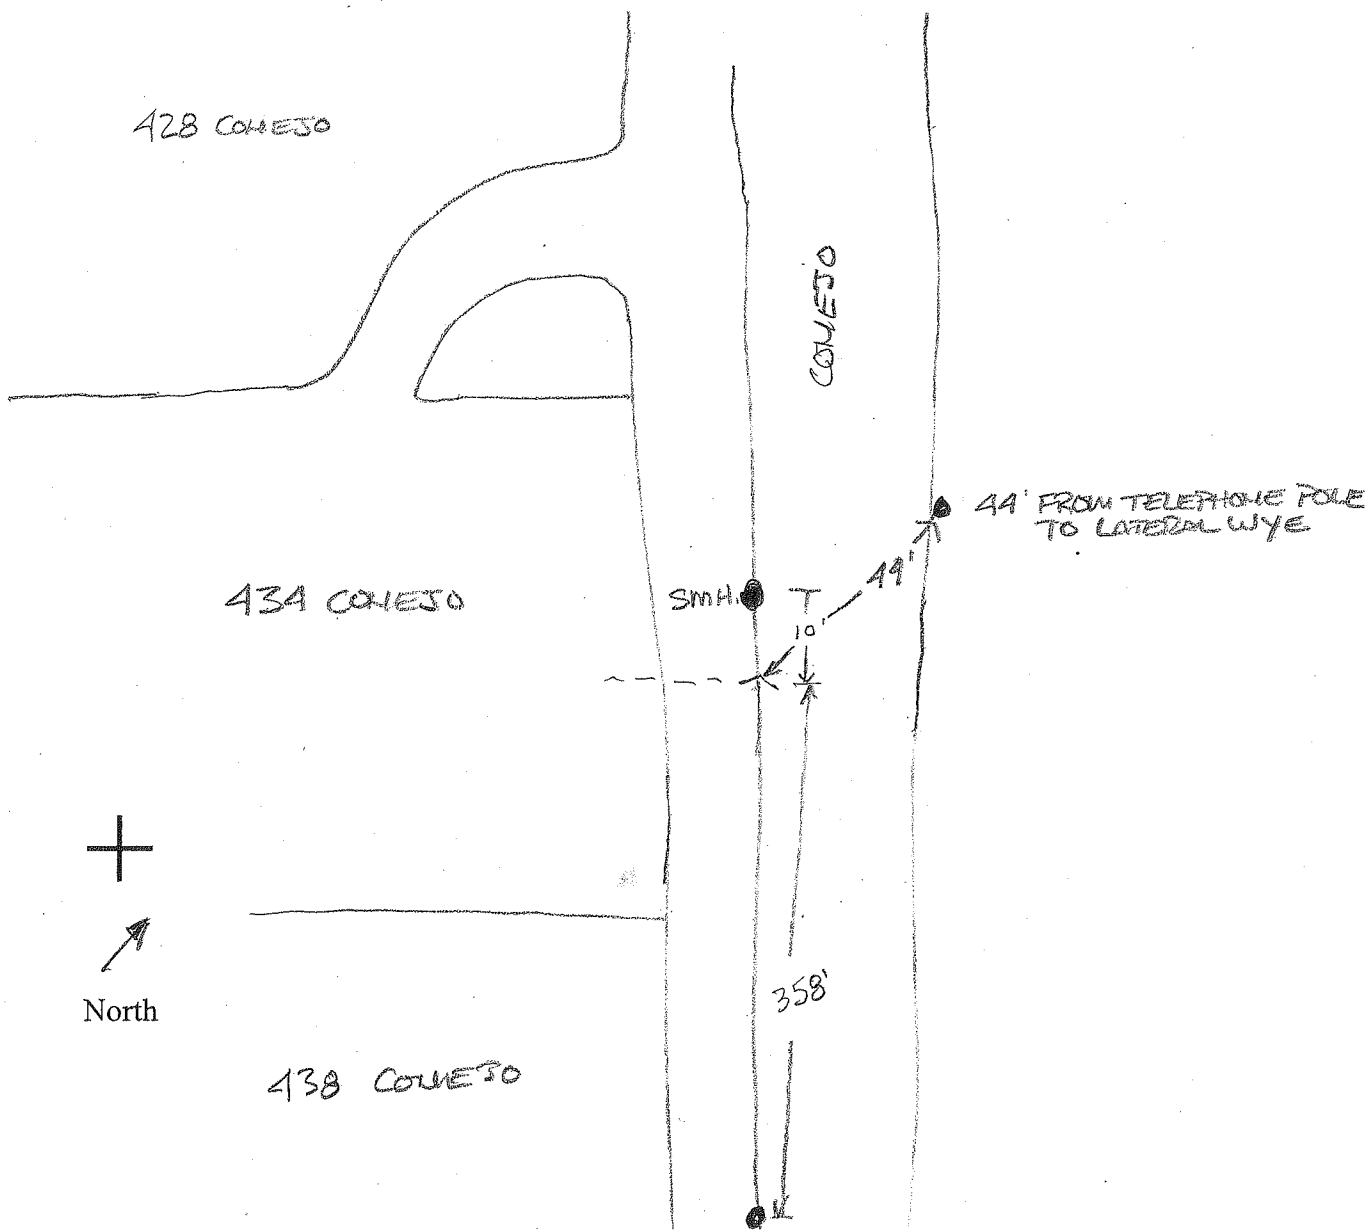


- Date: 12-29-08
- Property Address: 438 CONESO
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: 6" HDPE
- Size & material type of lateral: 4" SDR
- Depth of Wye connection: 6'
- Distance of lateral from centerline of downstream manhole: 314'
- Excavation dimensions: 2 x 4
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

14' FROM FACE OF WALL @
11' NORTH OF STEPS

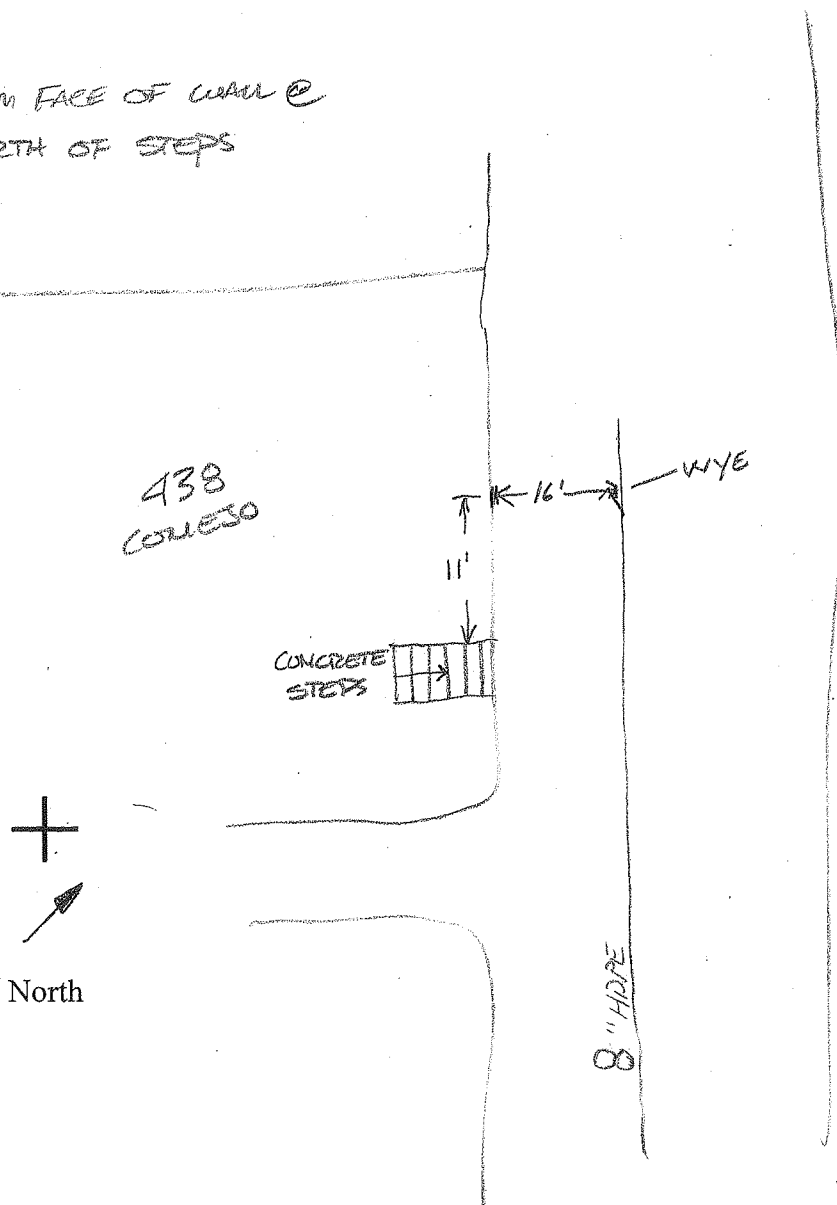

- Date: 12-29-08
- Property Address: 44A CONEJO
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral:
- Depth of Wye connection:
- Distance of lateral from centerline of downstream manhole: 225'
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

235' FROM D.S. SMH
 12' SOUTH EAST OF STORM DRAIN STRUCTURE
 6' EAST OF WATER METER

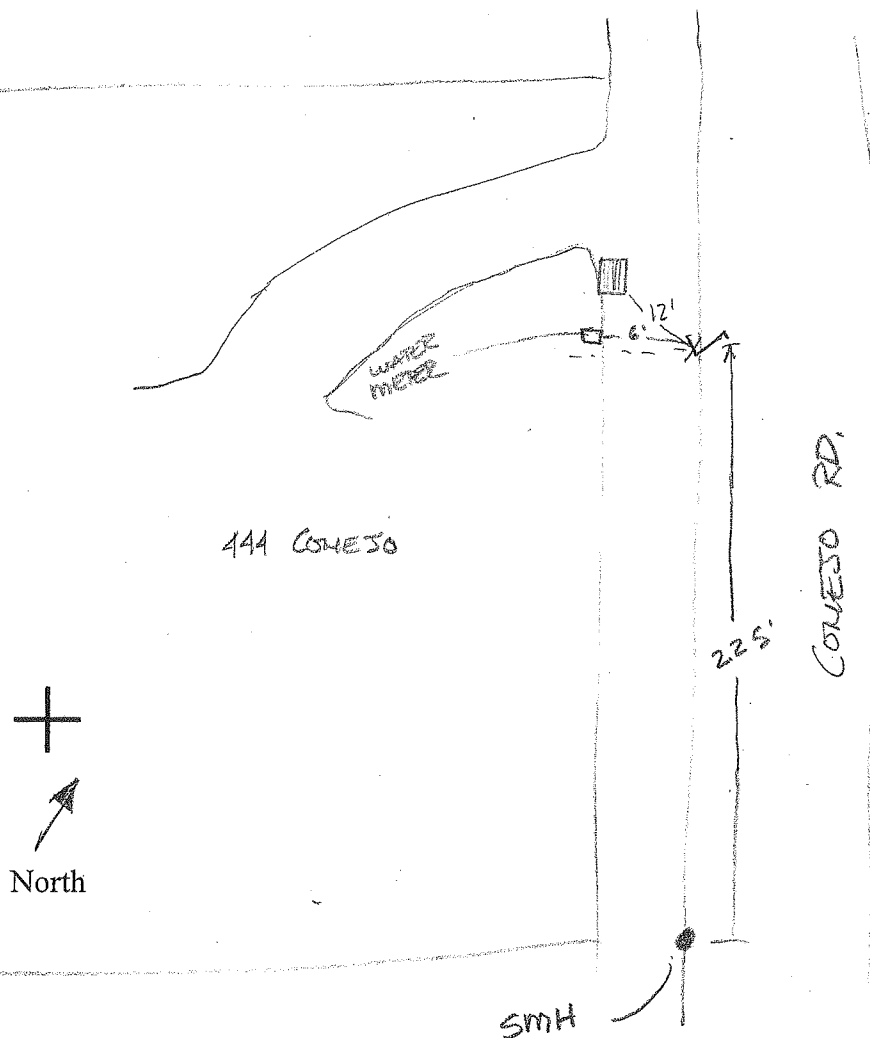


- Date: 12-29-08
- Property Address: 450 CONEJO
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: 8" HDPE
- Size & material type of lateral: 4" PVC
- Depth of Wye connection: 6'6"
- Distance of lateral from centerline of downstream manhole: 140'
- Excavation dimensions: 2x4
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

140' FROM D.S. SMH


8' FROM CENTER OF WATER METER BOX @
WEST SIDE OF CONEJO.

21' FROM CENTER OF WATER METER BOX @
EAST SIDE OF CONEJO.

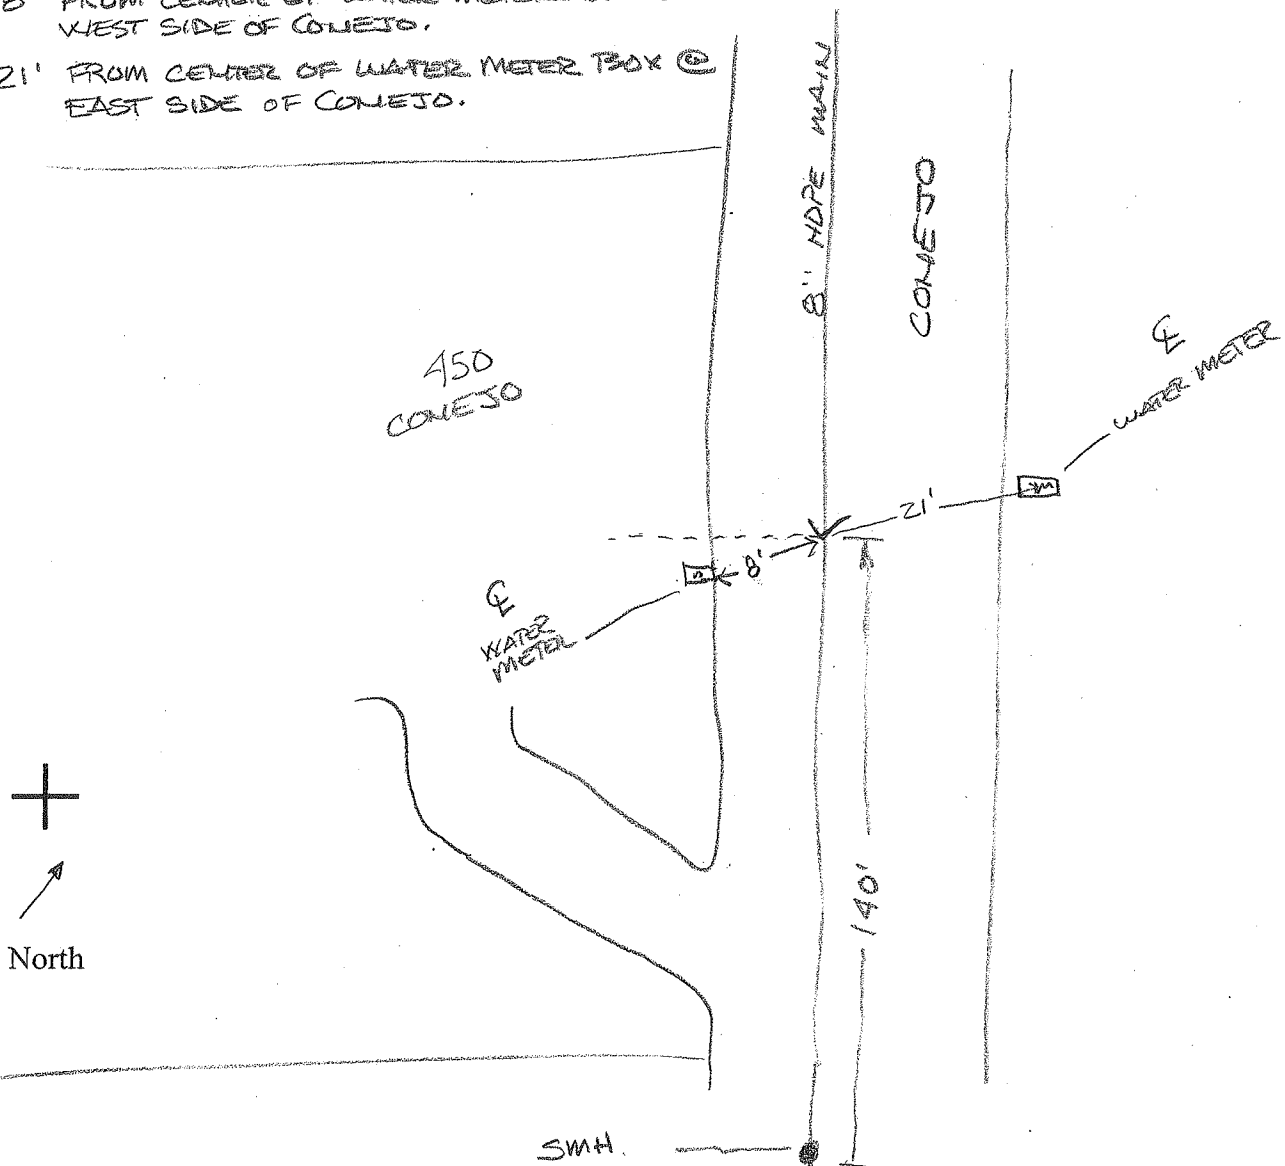


- Date: 12-29-08
- Property Address: 456 CONESO
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: 8" HDPE
- Size & material type of lateral: 4" PVC
- Depth of Wye connection: 5' 2"
- Distance of lateral from centerline of downstream manhole: 65'
- Excavation dimensions: 2' x 4'
- Brief description of the site (utility conflict/traffic/soil type/other issues): 3/4" Copper LINE (UNKNOWN WATER GAS) OVER WYE (2' DEPTH)

7' FROM GAS METER
6' FROM WATER METER
65' FROM D.S. SMH

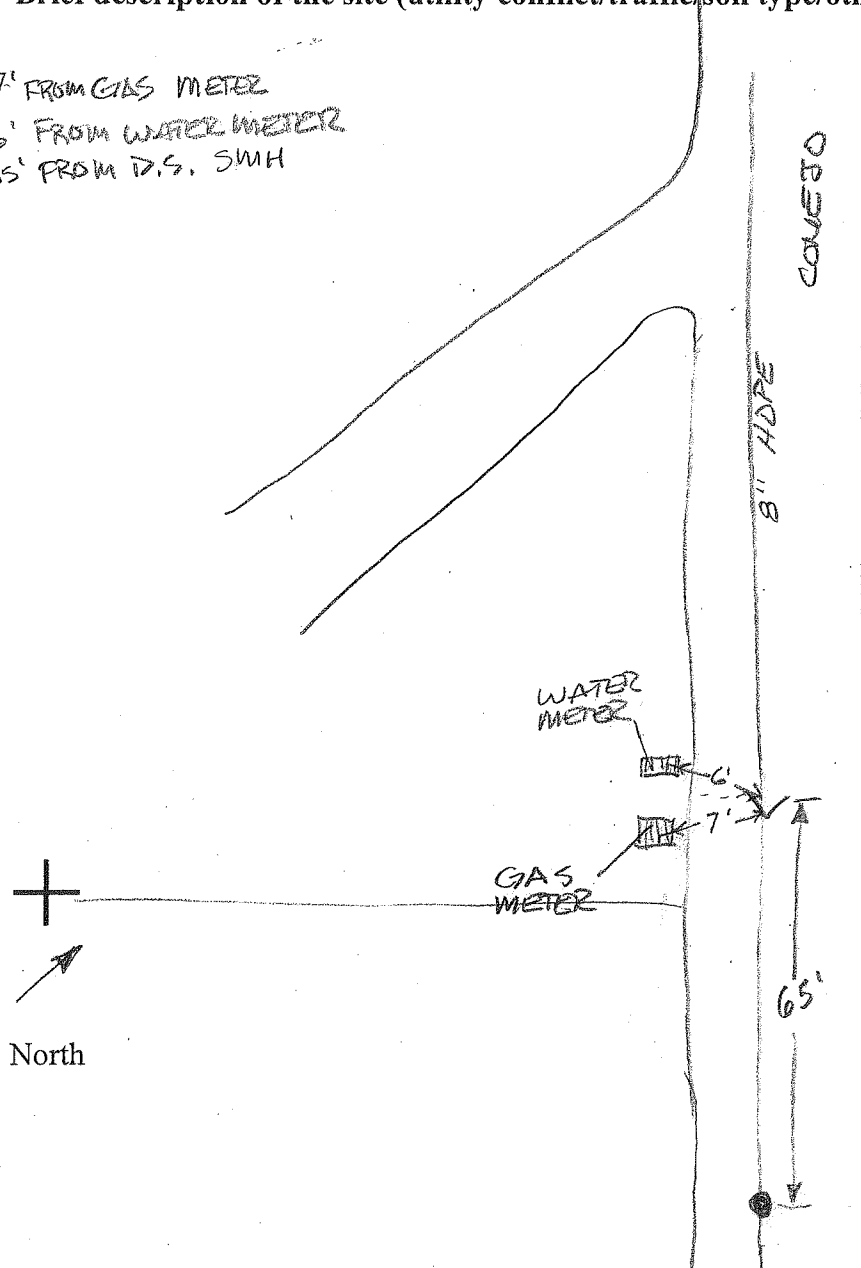


3/4" Copper LINE
(UNKNOWN WATER
GAS) OVER WYE
2' DEPTH


- 38' FROM D.S. SMH
25' FROM GAS METER (CENTER OF)
THAT SERVES 456 CONEJO

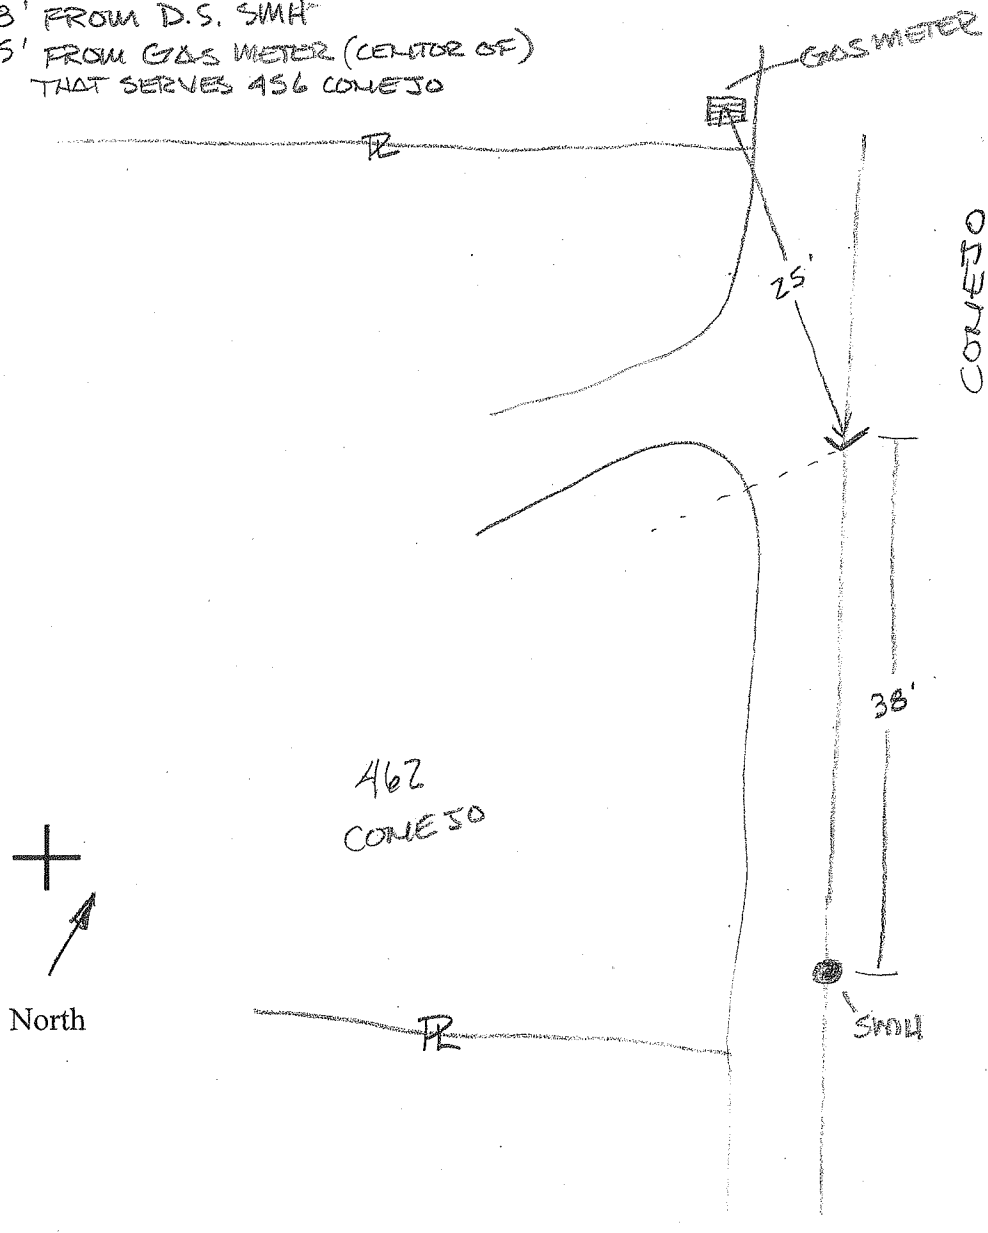

- Date: 12-30-08
- Property Address: 468 Conejo
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: 8" HDPE
- Size & material type of lateral: 4" PVC
- Depth of Wye connection: 18"
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions: 2 x 3
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

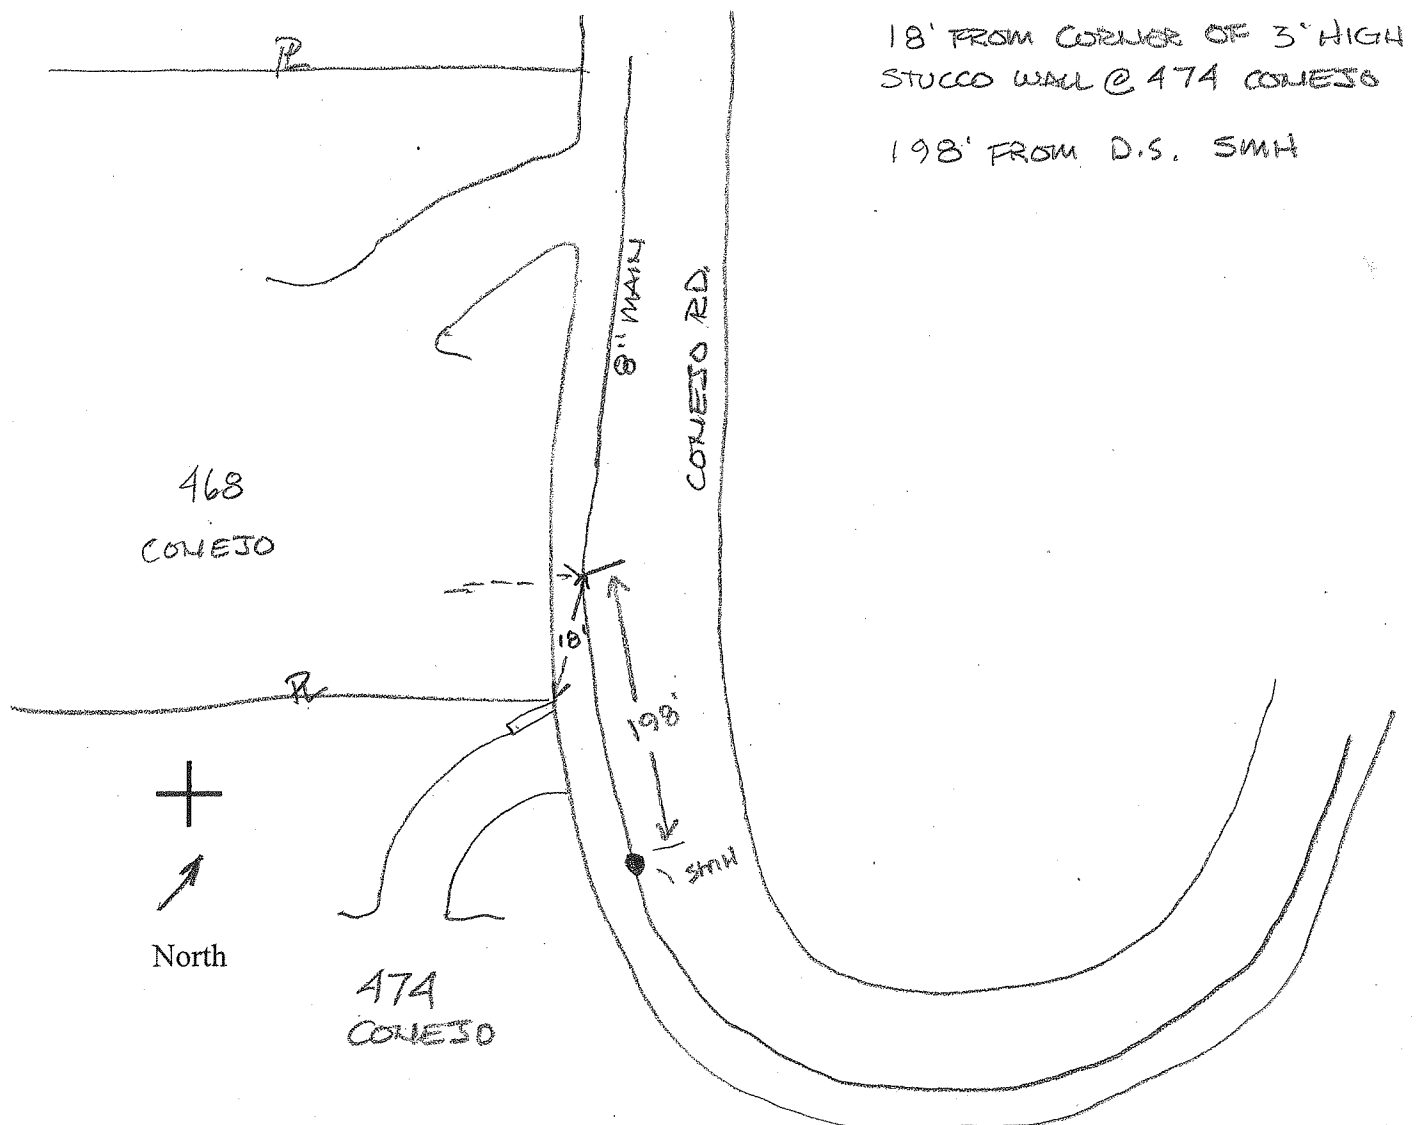

- Date: 12-30-08
- Property Address: 474 CONEJO
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: 8" HDPE
- Size & material type of lateral: 4" PVC
- Depth of Wye connection: 18"
- Distance of lateral from centerline of downstream manhole: 84' 6"
- Excavation dimensions: 2 x 2
- Brief description of the site (utility conflict/traffic/soil type/other issues):

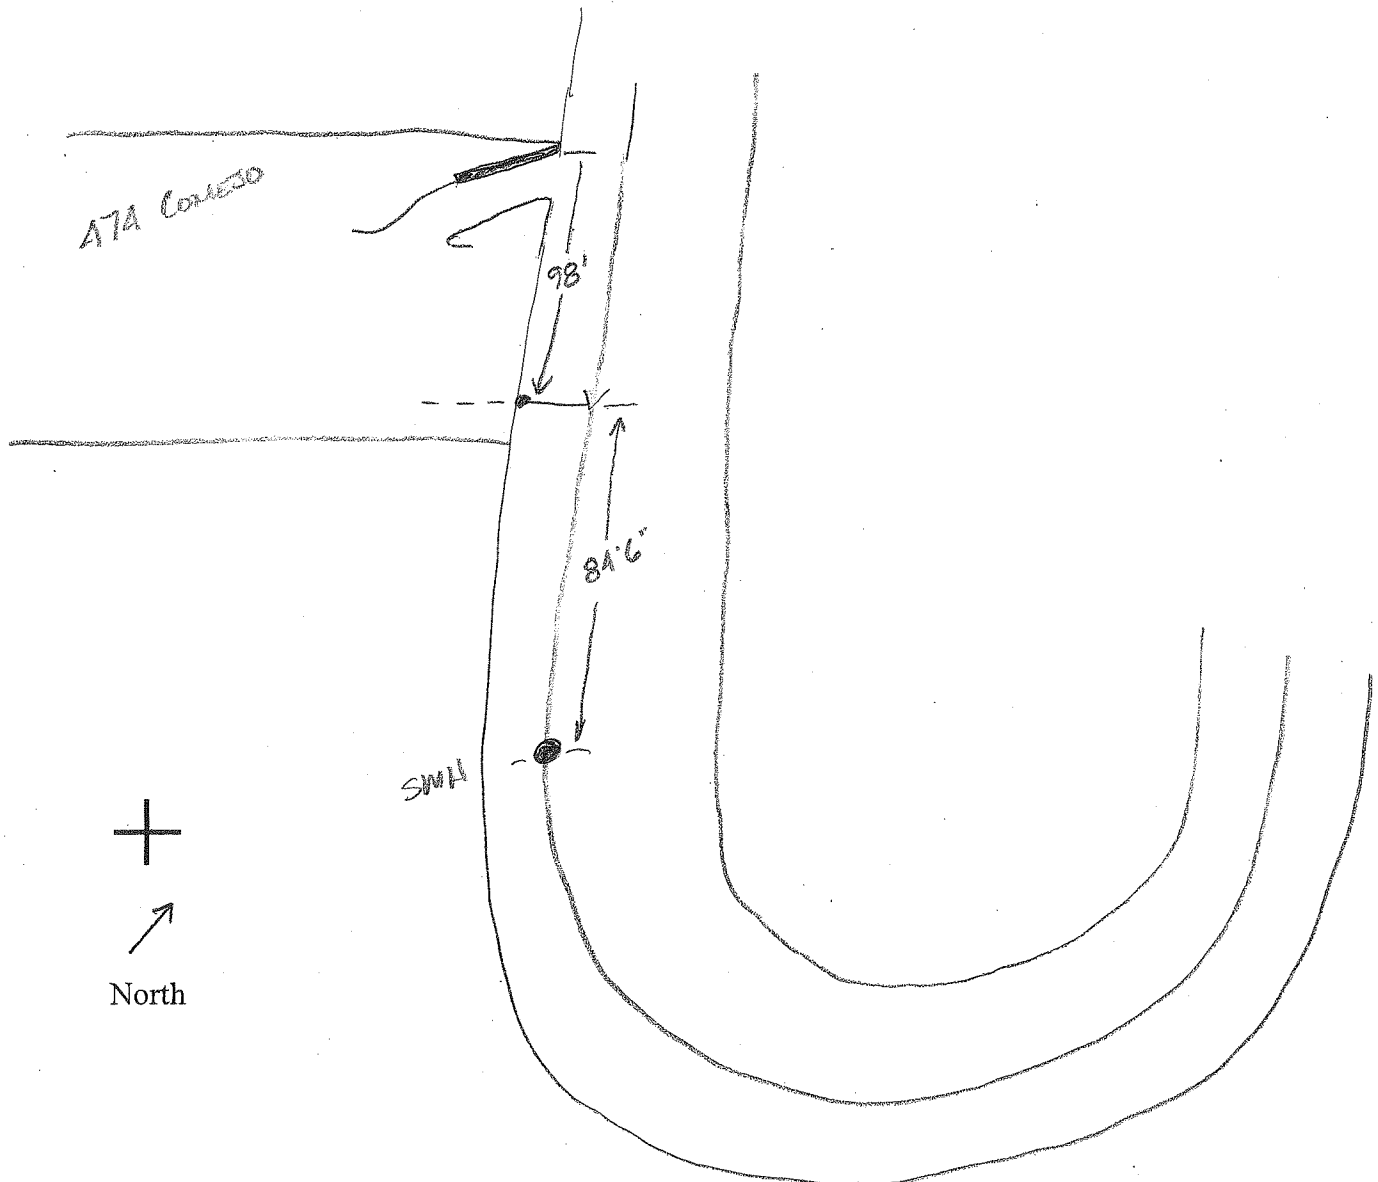

- Date: 1-7-09
- Property Address: 447 CONEJO LN.
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: N/A
- Size & material type of lateral: 4" ORANGETOWN (NO SLIP LINE)
- Depth of Wye connection: 30"
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions: 2 x 2
- Brief description of the site (utility conflict/traffic/soil type/other issues):


15'0" TO FRONT FACE
OF STONE WALL

6' NORTH OF SOUTH SIDE
BEGINNING OF STONE
WALL.

11'0" FROM SOUTH STONE
PILASTER @ GATE AREA



North

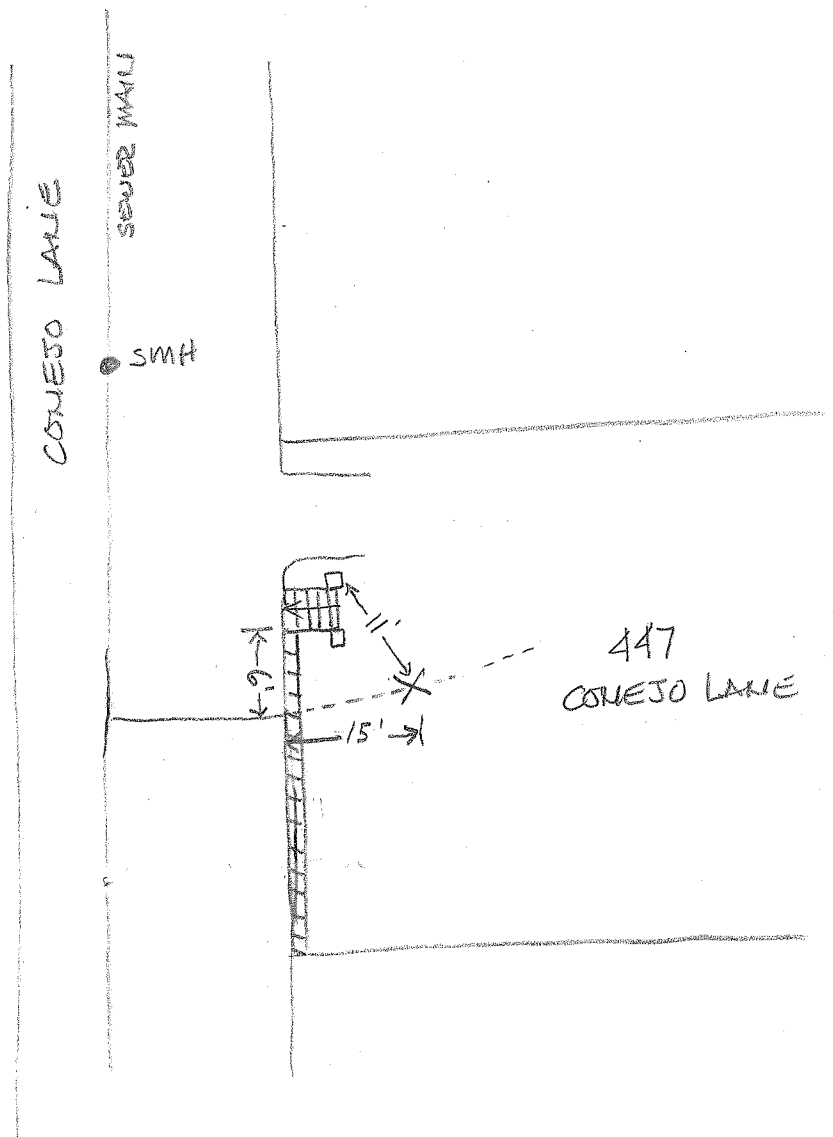


- Date: 1-7-09
- Property Address: 501 CONESO LANE
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: N/A
- Size & material type of lateral: 4" ABS
- Depth of ~~Wye~~^{CAP} connection: 4'
- Distance of lateral from centerline of downstream manhole: N/A
- Excavation dimensions: 2x2
- Brief description of the site (utility conflict/traffic/soil type/other issues):

X = CAP


MEDAL TAG &
NAIL IN ROAD




North

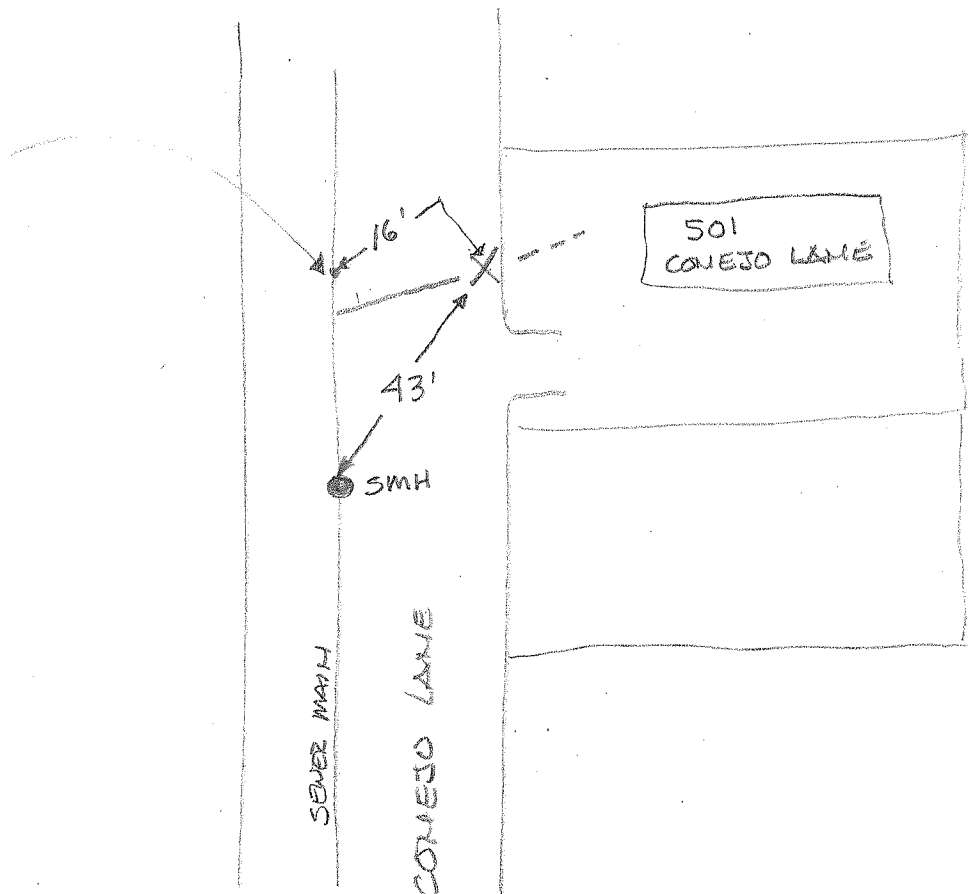

- Date: 1-5-09
- Property Address: 507 CONEJO LANE
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral: 4" ABS
- Depth of ~~Wye~~ connection: 18" TO CAP
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

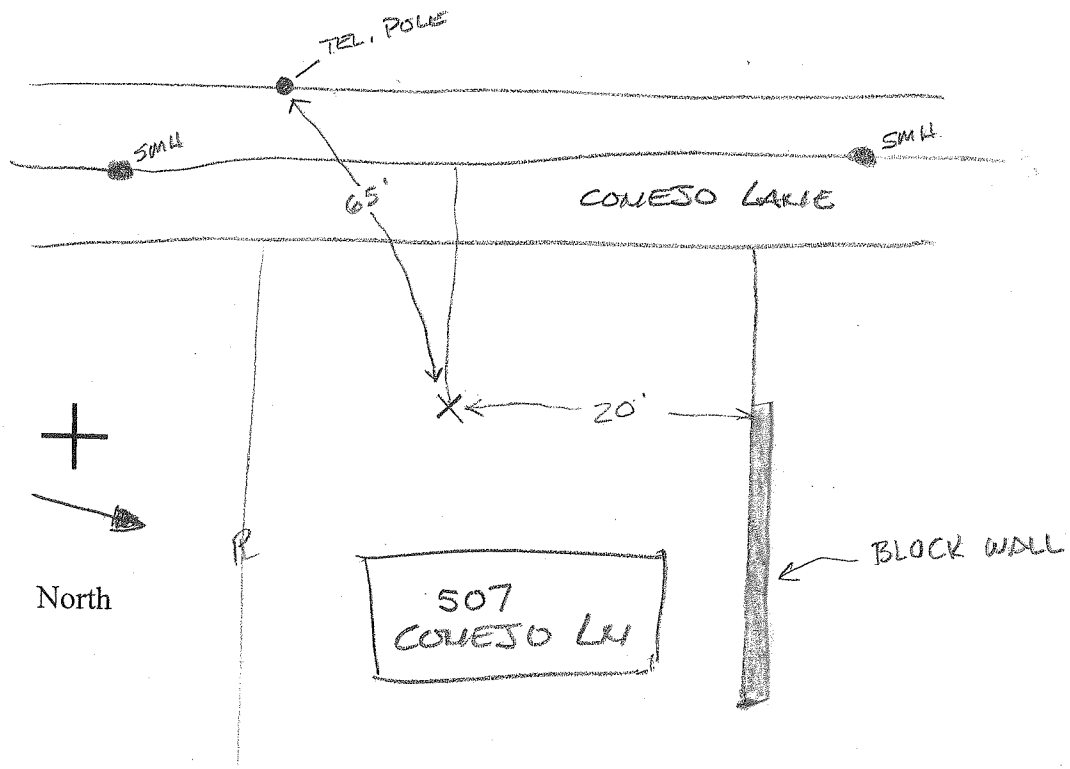


- Date: 1-6-09
- Property Address: 523 CONESO LANE
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: UNKNOWN
- Size & material type of lateral: 4" ORANBURG/SUPLINED
- Depth of ~~Wye~~^{CAP} connection: 3'6"
- Distance of lateral from centerline of downstream manhole: 9'0"
- Excavation dimensions: 4 x 2
- Brief description of the site (utility conflict/traffic/soil type/other issues): PLUGGED W/
CONCRETE

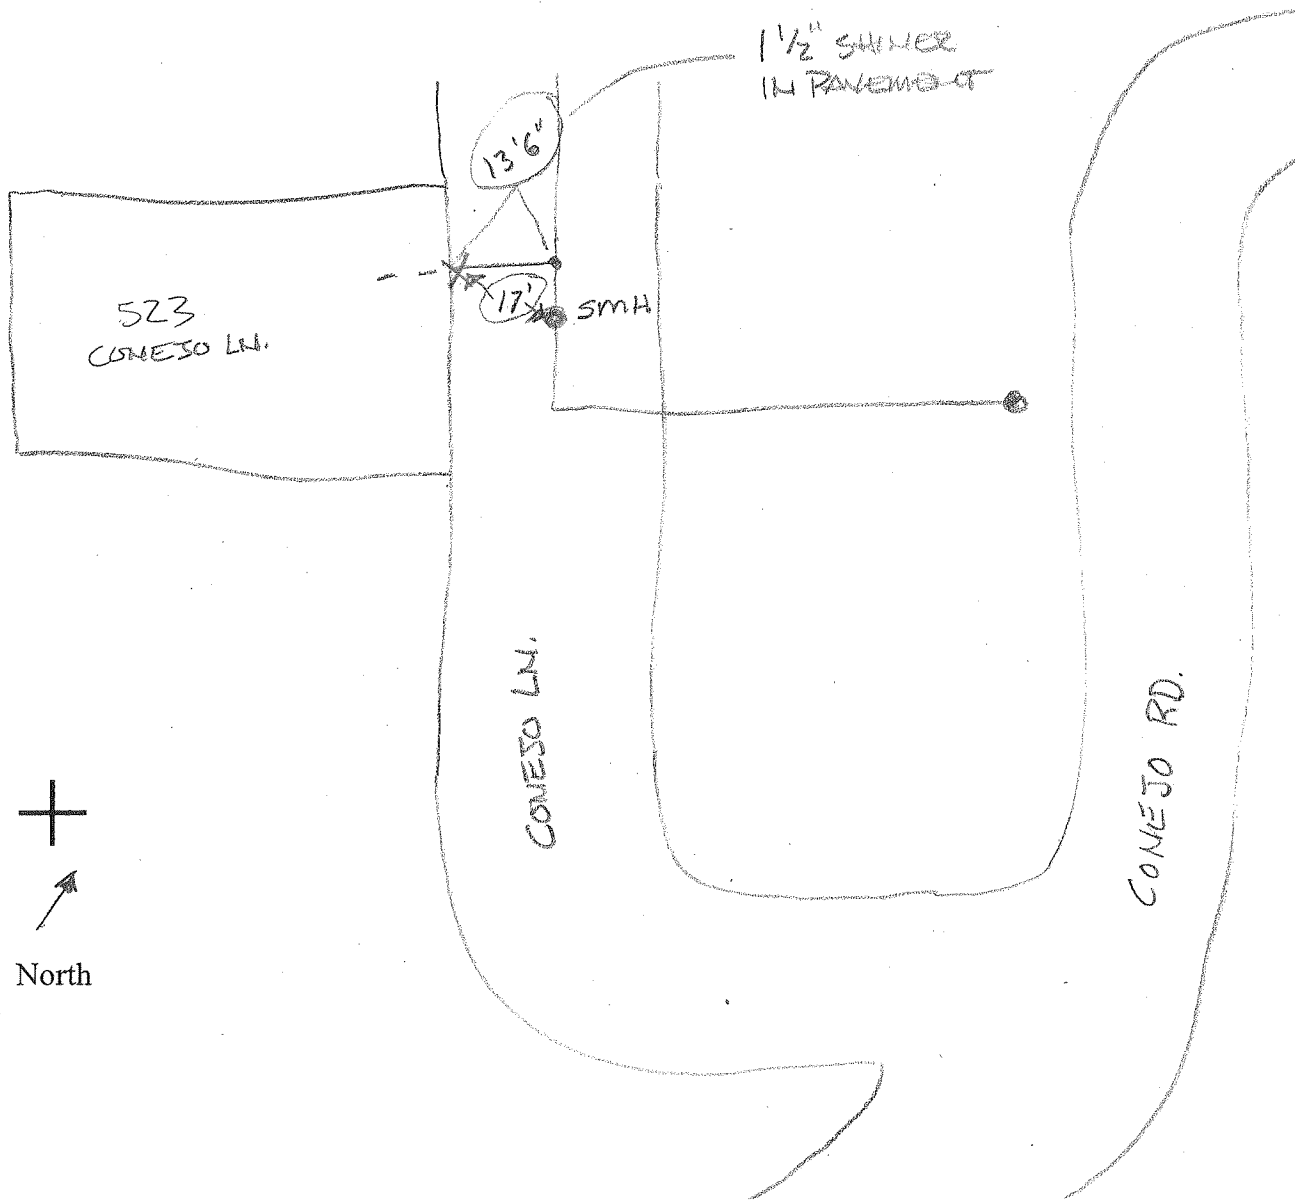


- Date: 1-14-09
- Property Address: 525 CONESO LANE
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: CLAY
- Size & material type of lateral:
- Depth of Wye connection: 5'6"
- Distance of lateral from centerline of downstream manhole: 102'
- Excavation dimensions: 2x4
- Brief description of the site (utility conflict/traffic/soil type/other issues): CLAY WYE
(BAD ALIGNMENT)

⊗ = PLUG

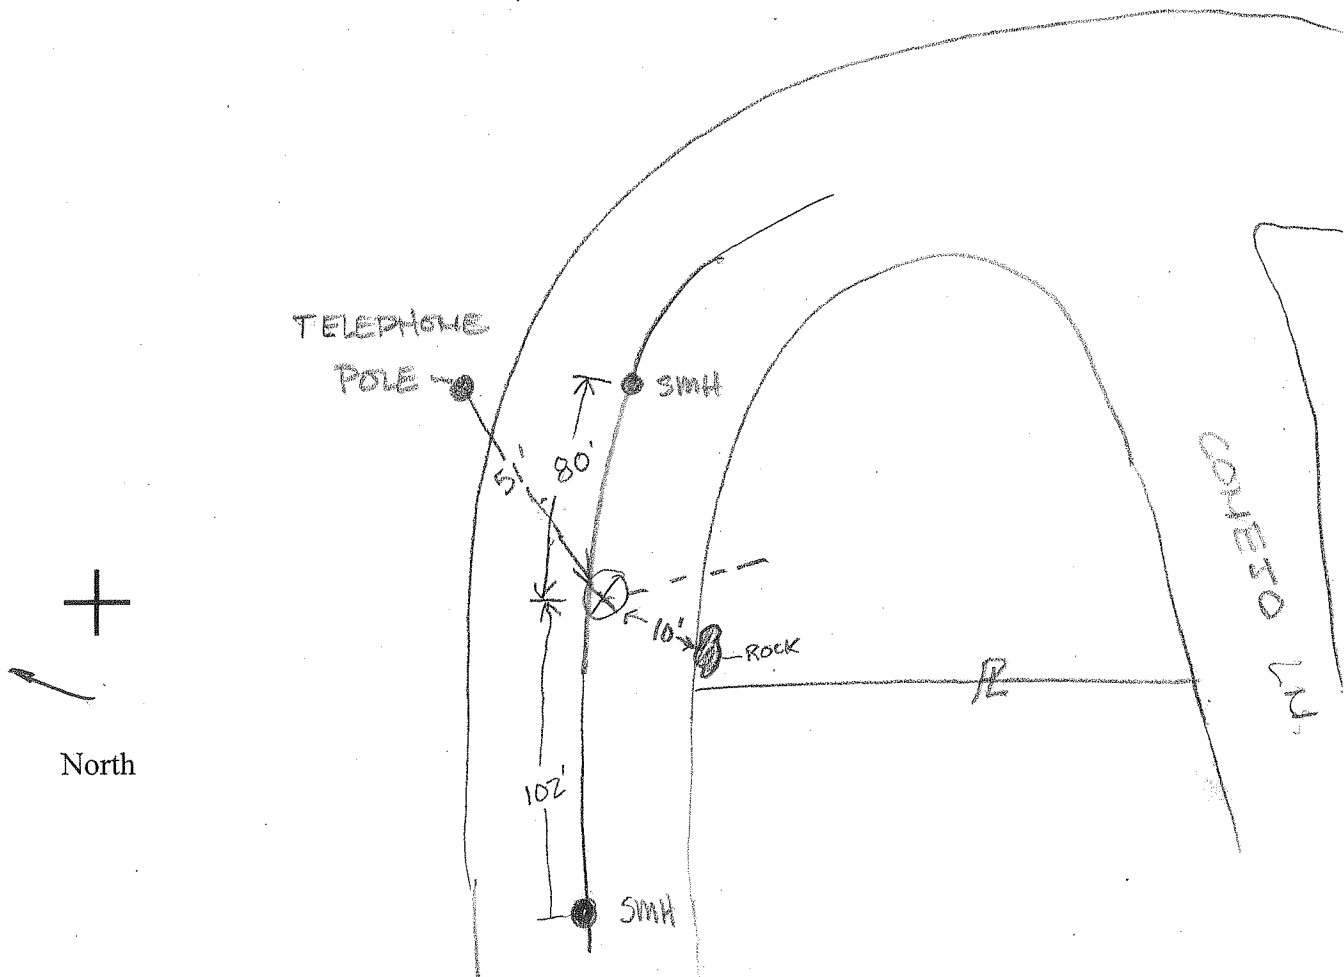

- Date: 1-6-09
- Property Address: 529 CONESO LN
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: N/A
- Size & material type of lateral: ORANGEBURG/SUPLINED
- Depth of ^{CAP}Wye connection: 3'
- Distance of lateral from centerline of downstream manhole: N/A
- Excavation dimensions: 2 x 2
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

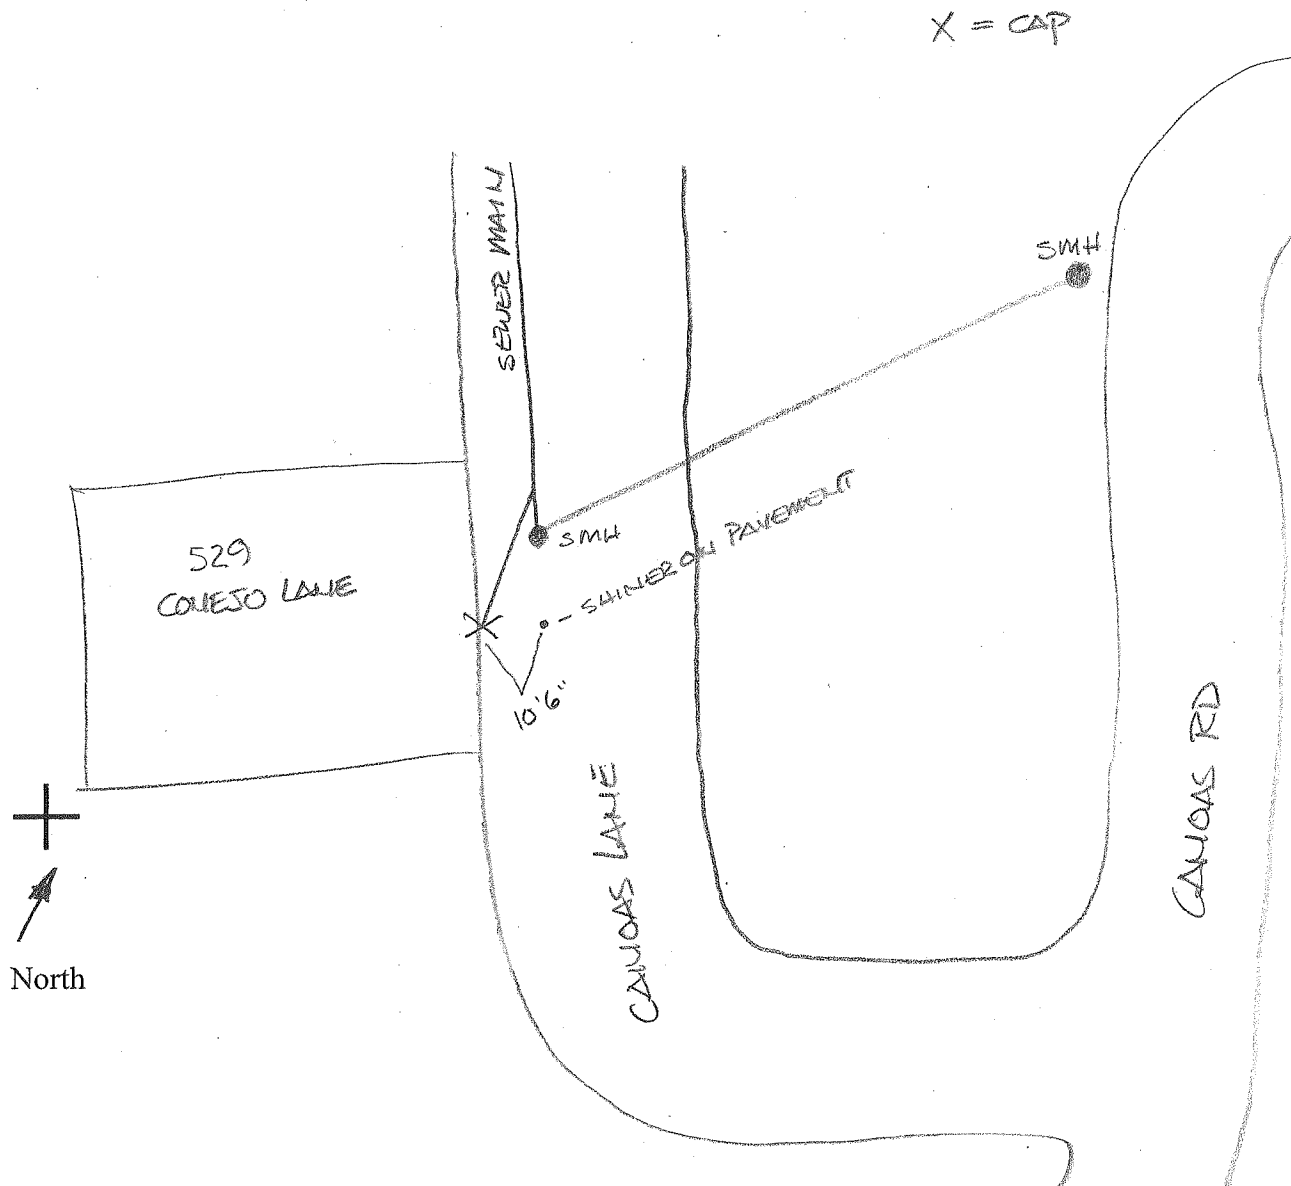


- Date: 12-19-08
- Property Address: 533 CONESO
- Location/Address of actual excavation (also see diagram attached): EASEMENT
- Size & material type of sewer main: 6" CLAY
- Size & material type of lateral: 4" ABS
- Depth of Wye connection: 3'
- Distance of lateral from centerline of downstream manhole: 4'
- Excavation dimensions: 3' x 3'
- Brief description of the site (utility conflict/traffic/soil type/other issues):

40' WEST OF EDGE OF PAVEMENT


4' WEST OF SMH



North

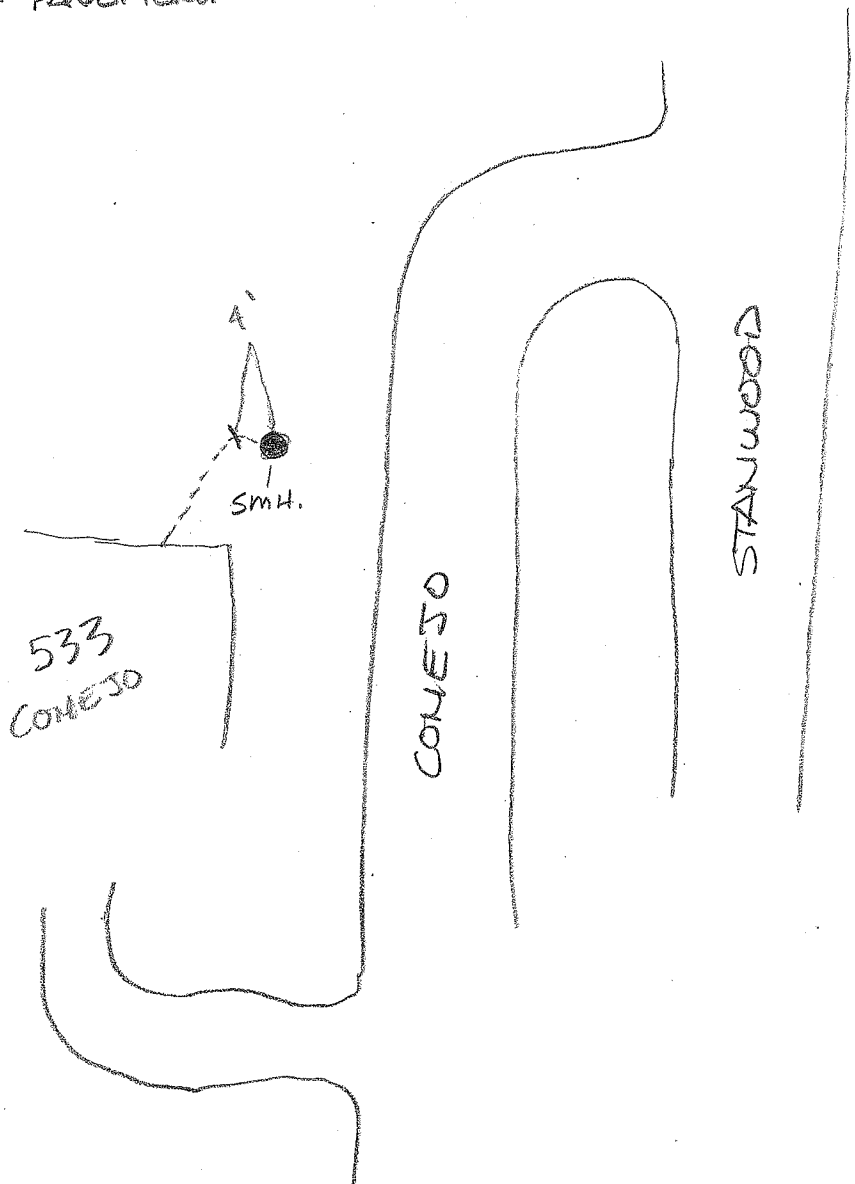


- Date: 1-6-09
- Property Address: 535 CONESO LN.
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral: ORANGEBURG / SLIP LINED
- Depth of ^{CAP} ~~Wye~~ connection:
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

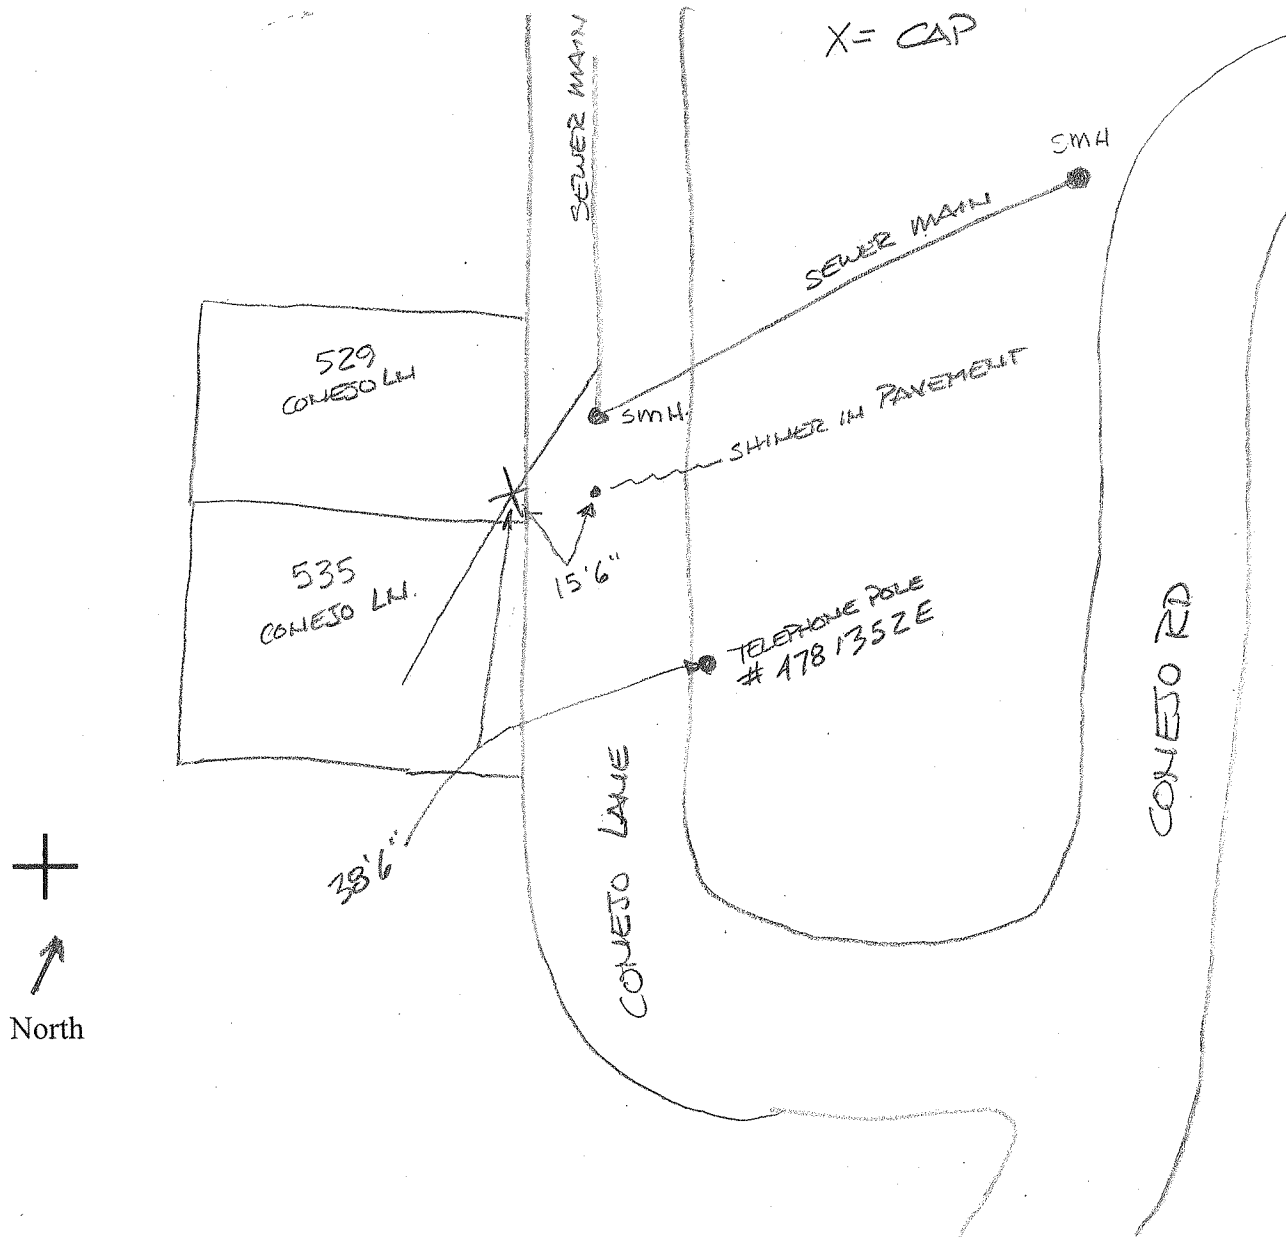

- Date: 1-8-09
- Property Address: 545 CONEJO
- Location/Address of actual excavation (also see diagram attached): SEE BELOW
- Size & material type of sewer main: N/A
- Size & material type of lateral: 4" CLAY
- Depth of ^{CAP}Wye connection:
- Distance of lateral from centerline of downstream manhole: 51' ±
- Excavation dimensions: 2X2
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE


X = CAP

- 1) 18' FROM LARGE OAK LOCATED N, EAST FROM N, EAST CORNER OF FOUNDATION OF HOUSE.
- 2) 5' SOUTH AND 6' EAST OF NORTH EAST CORNER OF STRUCTURE

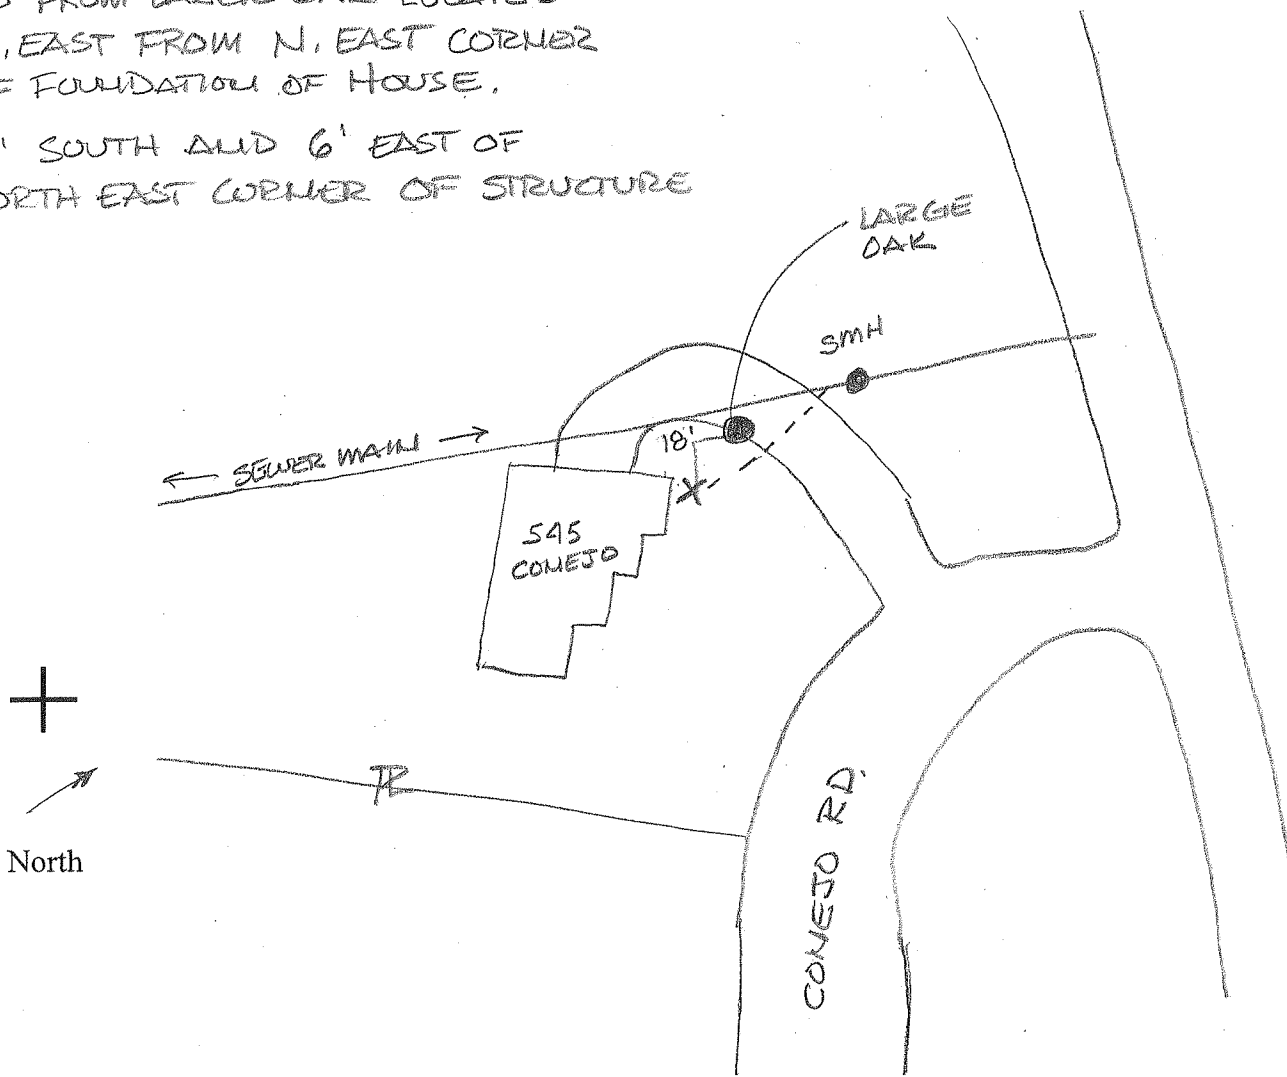


- Date: 1-9-09
- Property Address: 695 COYOTE RD.
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: N/A
- Size & material type of lateral: 4" PVC
- Depth of Wye connection: 27"
- Distance of lateral from centerline of downstream manhole: N/A
- Excavation dimensions: 2 x 2
- Brief description of the site (utility conflict/traffic/soil type/other issues):

X = CAP

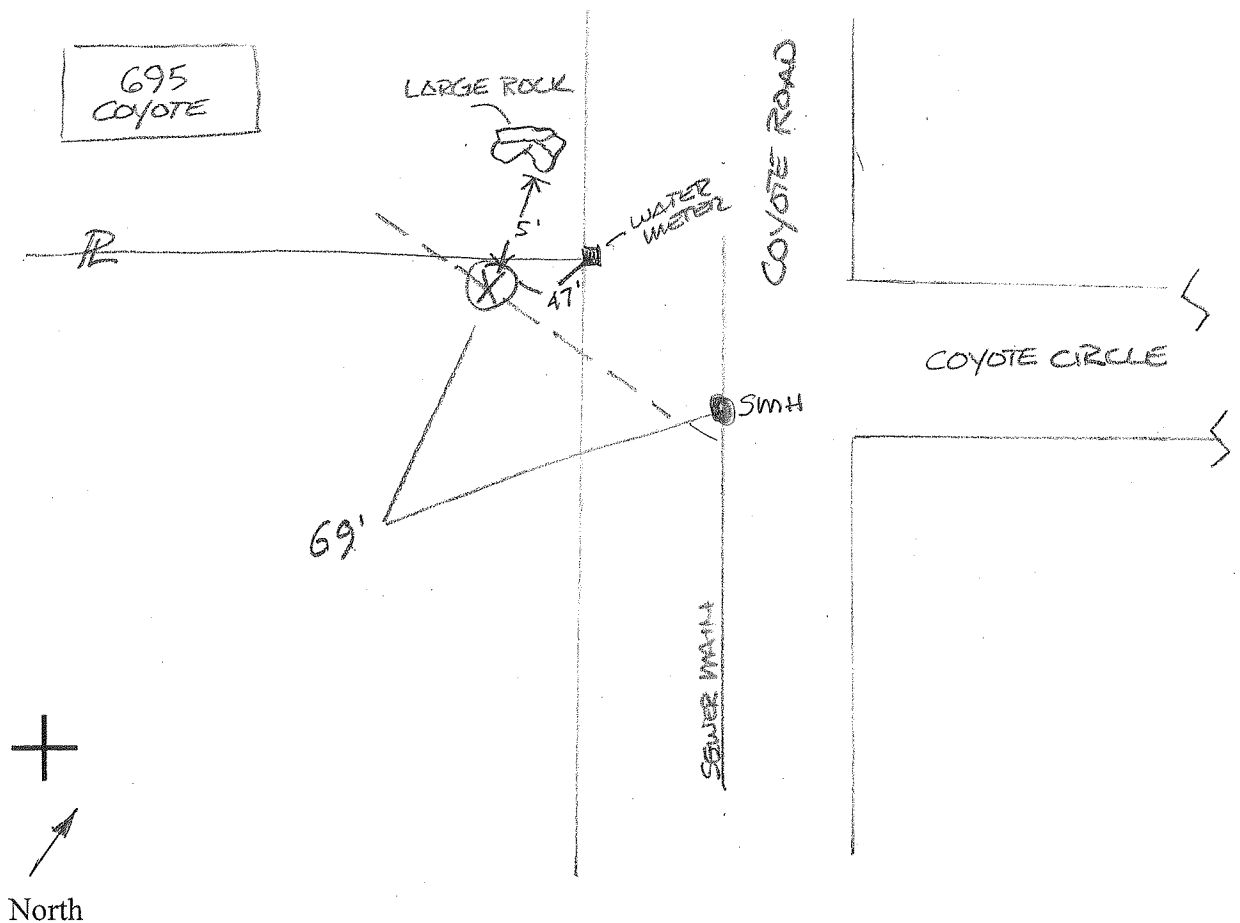

G


- Date: 1-9-09
- Property Address: 1944 GIBRALTOR
- Location/Address of actual excavation (also see diagram attached): SEE BELOW
- Size & material type of sewer main:
- Size & material type of lateral:
- Depth of Wye connection:
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

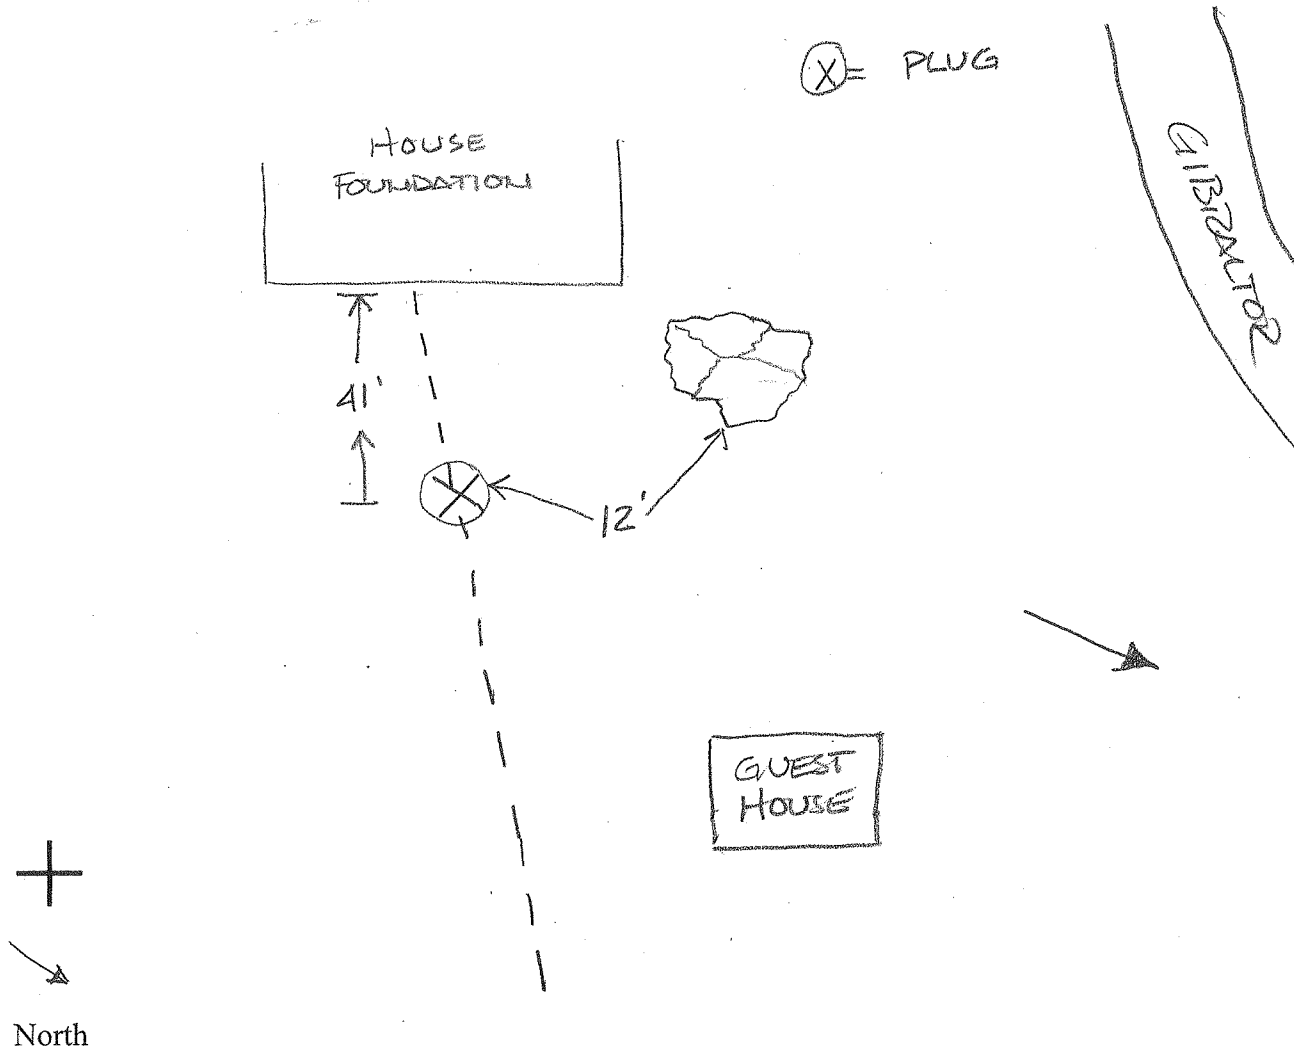


L

- Date: 1-8-09
- Property Address: 144 LAS ALTURAS
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: N/A
- Size & material type of lateral: 4" ABS
- Depth of ^{CAP}Wye connection: 24"
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions: 3x2
- Brief description of the site (utility conflict/traffic/soil type/other issues): 2 LATERALS IN 1 TRENCH, ONE SERVING 19 ALISA


X = PLUG

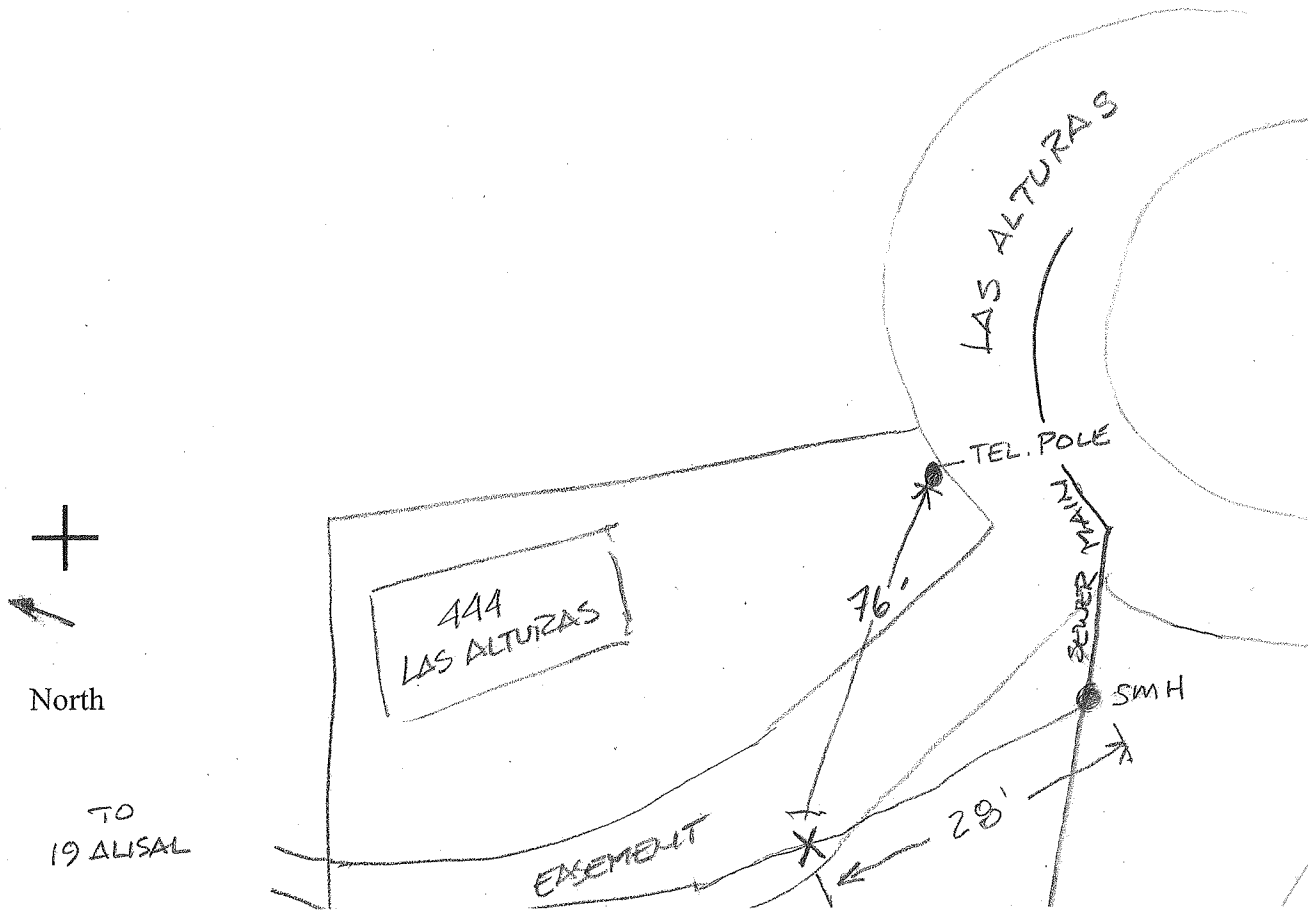


- Date: 1-5-09
- Property Address: 642 LAS ALTURAS
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral:
- Depth of Wye connection:
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

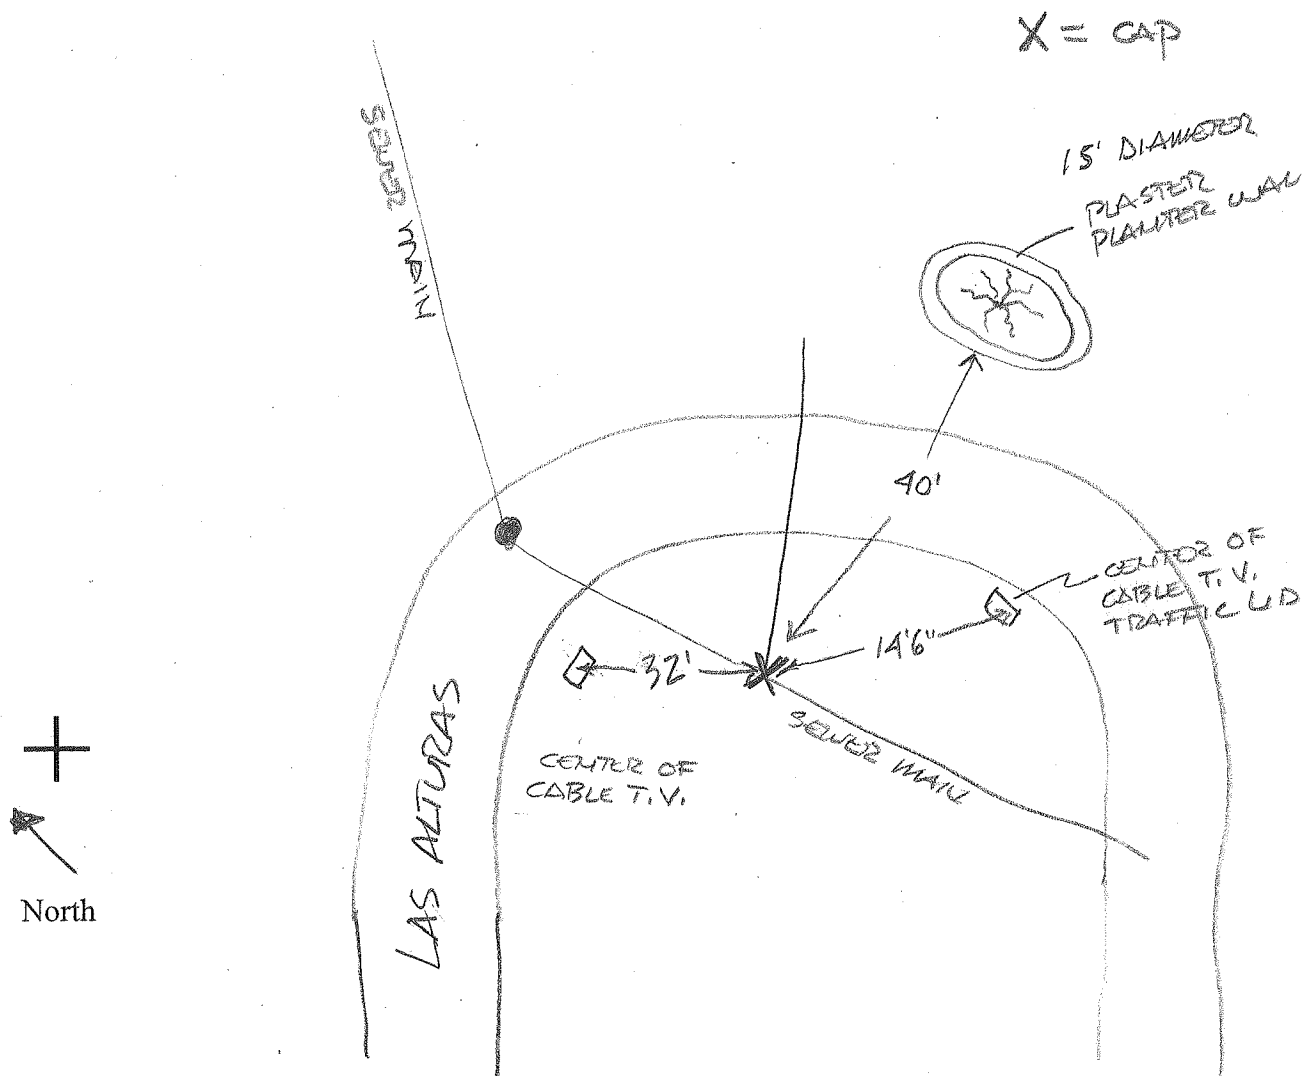

- Date: 1-5-09
- Property Address: 646 LAS ALTURAS
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral:
- Depth of Wye connection:
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues): FORCE LATERAL

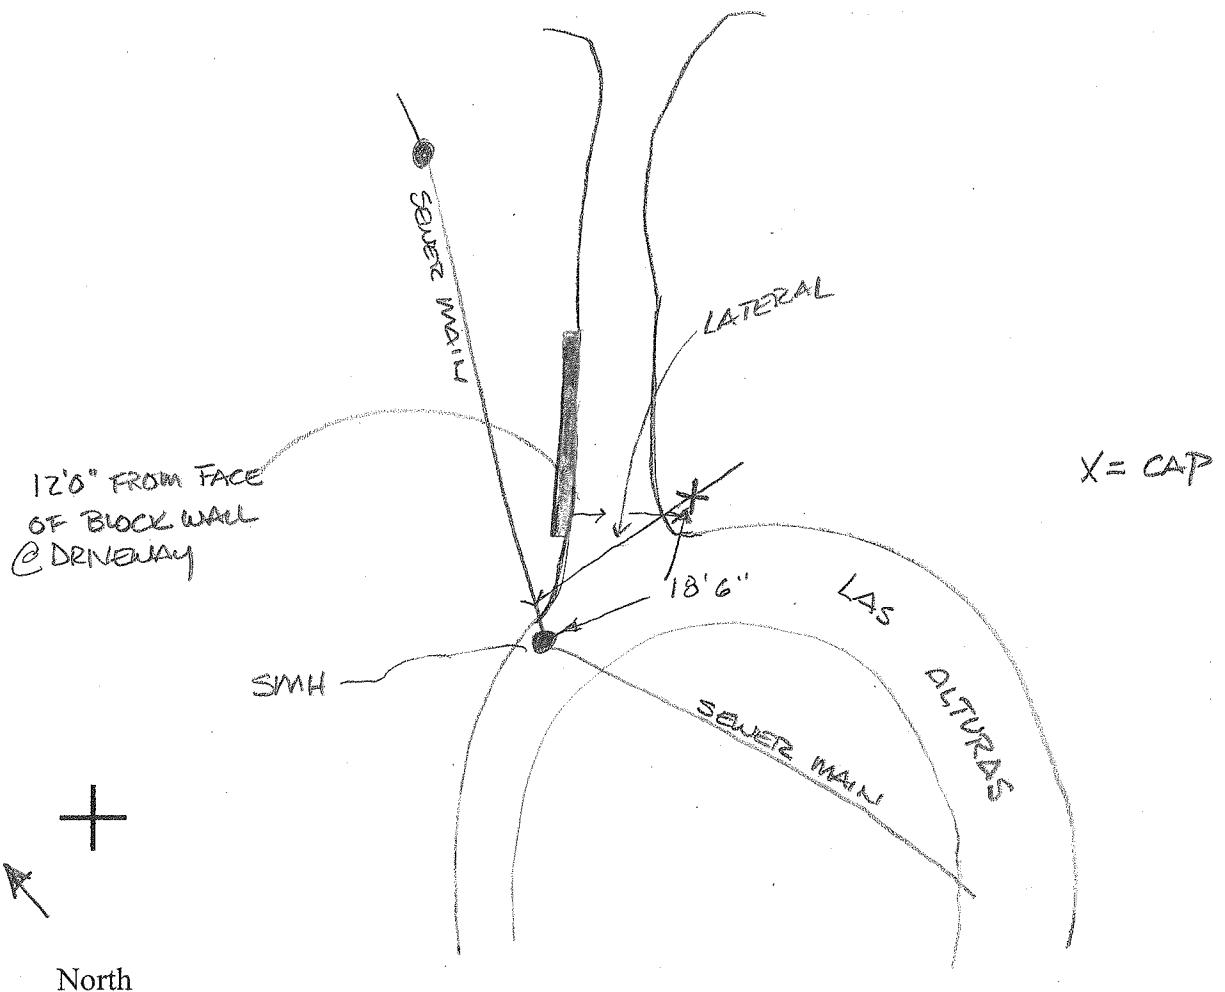


- Date: 1-16-09
- Property Address: 900 LAS ALTURAS
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: N/A
- Size & material type of lateral: 4" ABS
- Depth of ^{CAP}Wye connection: 30"
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions: 2x2
- Brief description of the site (utility conflict/traffic/soil type/other issues):

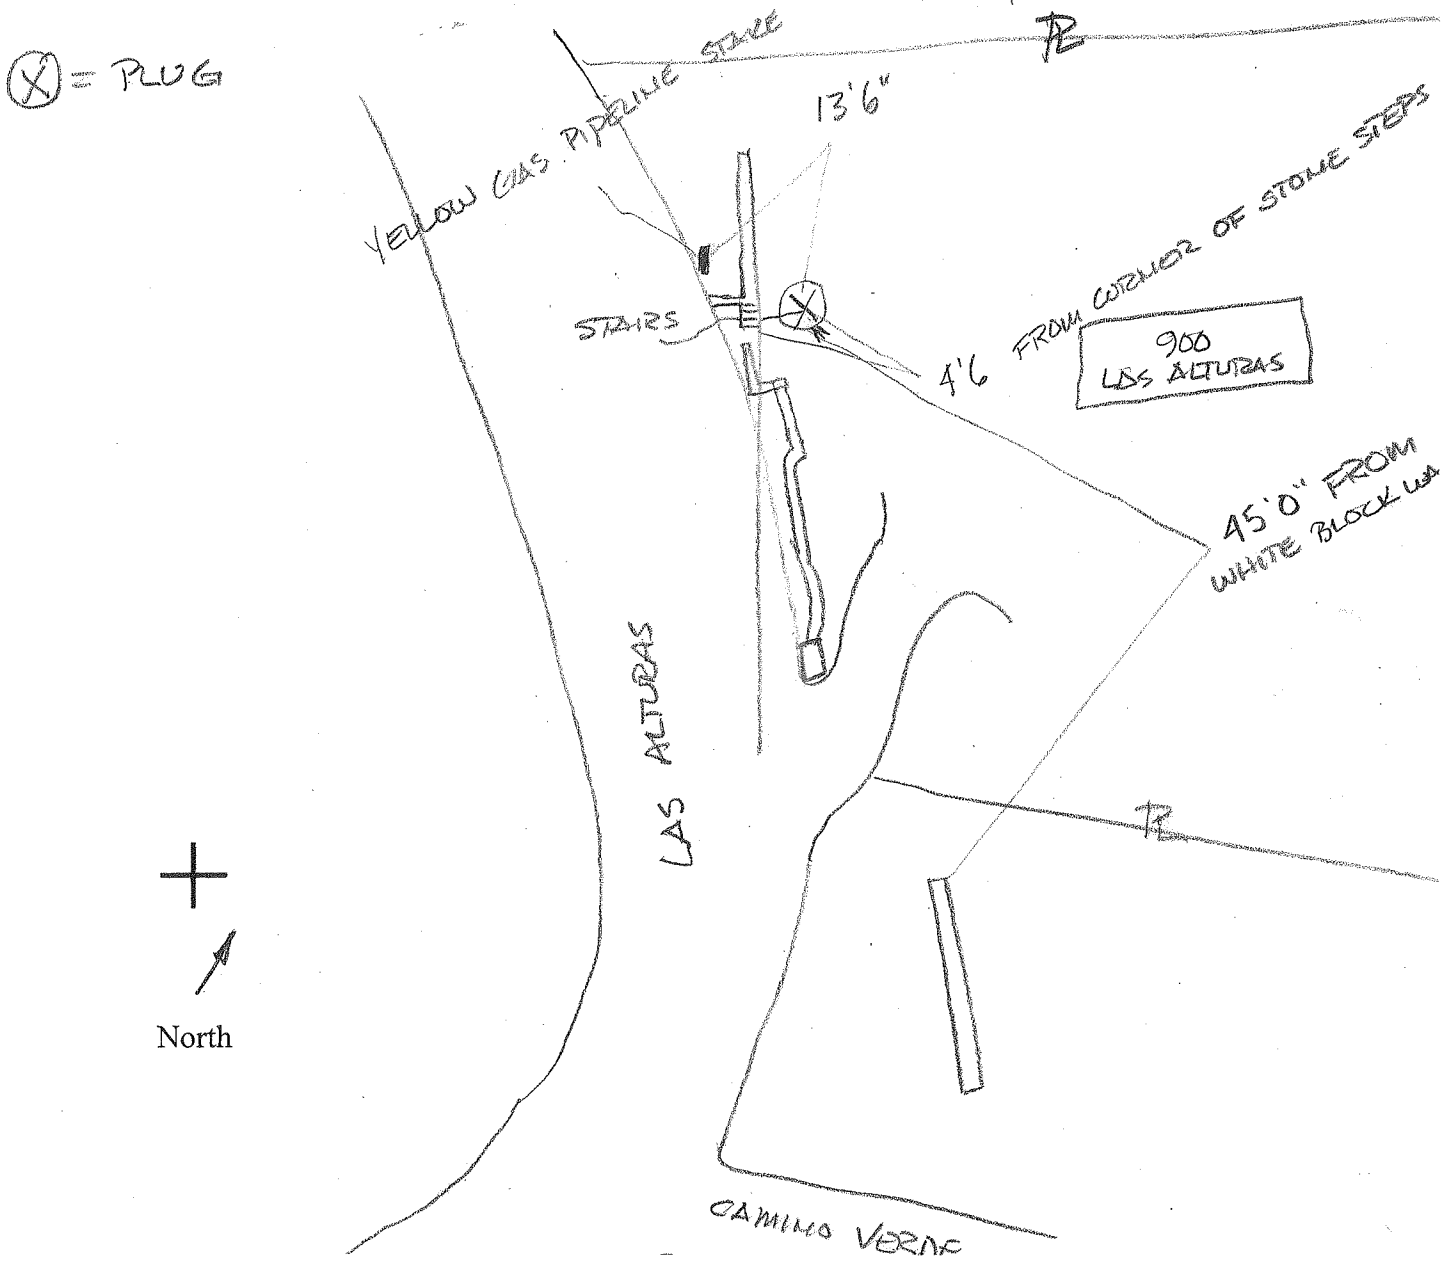

- Date: 1-14-09
- Property Address: 1050 Las Alturas
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: CLAY
- Size & material type of lateral: 4" CLAY
- Depth of Wye connection: 5'6"
- Distance of lateral from centerline of downstream manhole: N/A
- Excavation dimensions: 5x2
- Brief description of the site (utility conflict/traffic/soil type/other issues):

CLAY WYE FOR
1052 LAS ALTURA
15'8" SOUTH OF
1050 L.A.

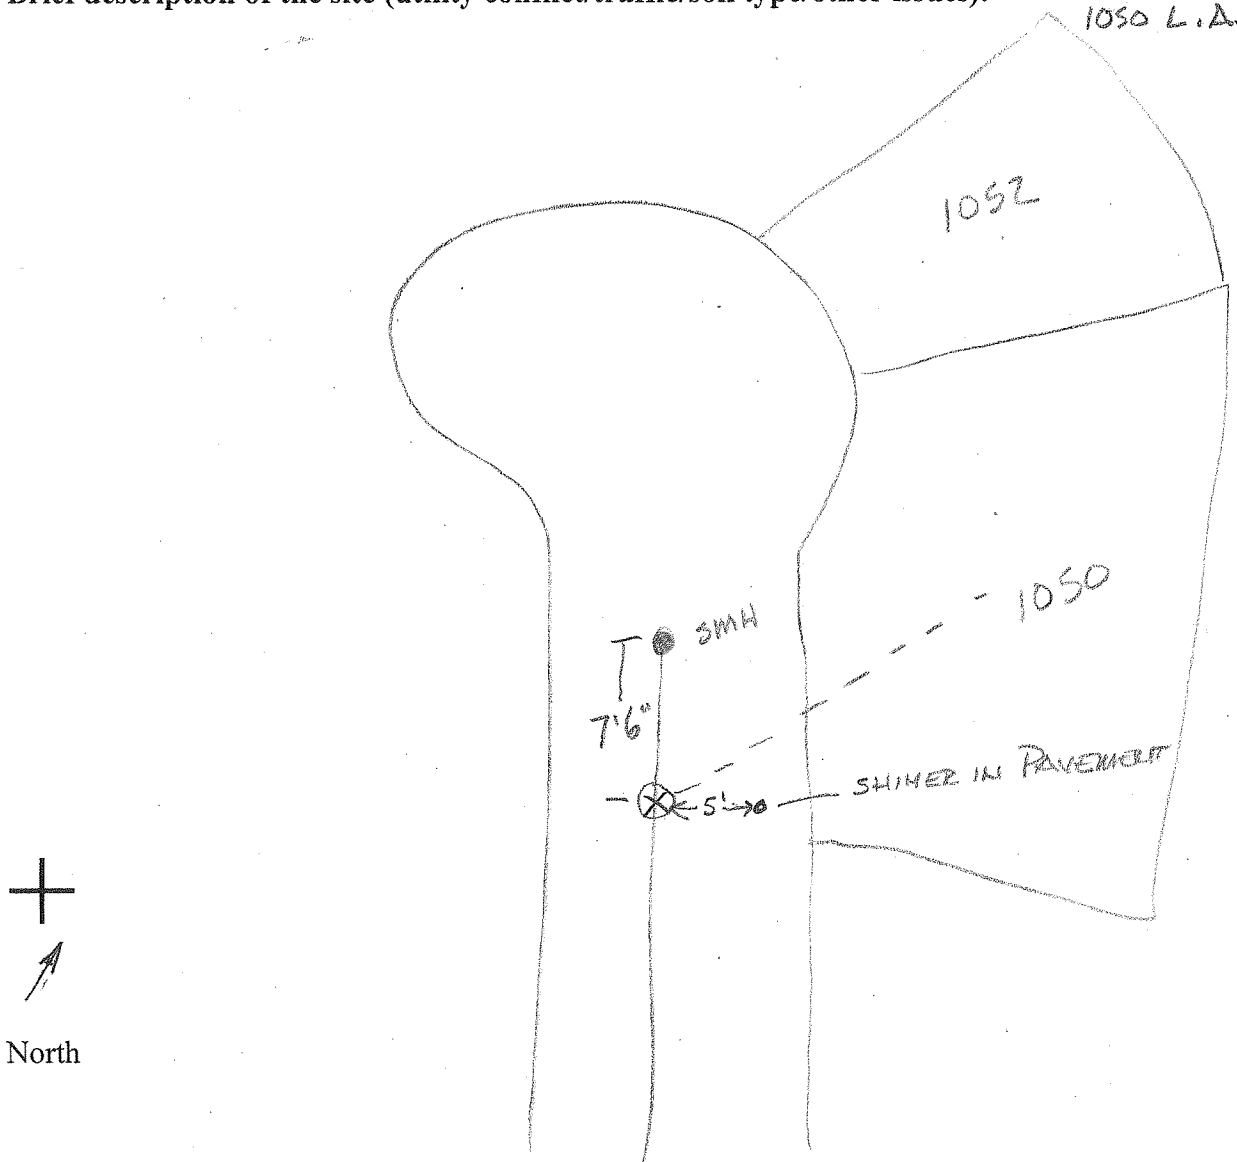


- Date: 1-14-09
- Property Address: 20 LAS ALTURAS CIRCLE
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral: 1" CLAY
- Depth of Wye connection: 4'6"
- Distance of lateral from centerline of downstream manhole: 86'
- Excavation dimensions: 2x4
- Brief description of the site (utility conflict/traffic/soil type/other issues):

⊗ = PLUG

20' SOUTHEAST FROM 23
LAS ALTURAS
(CORNER OF PAYER DENEWAY)




North

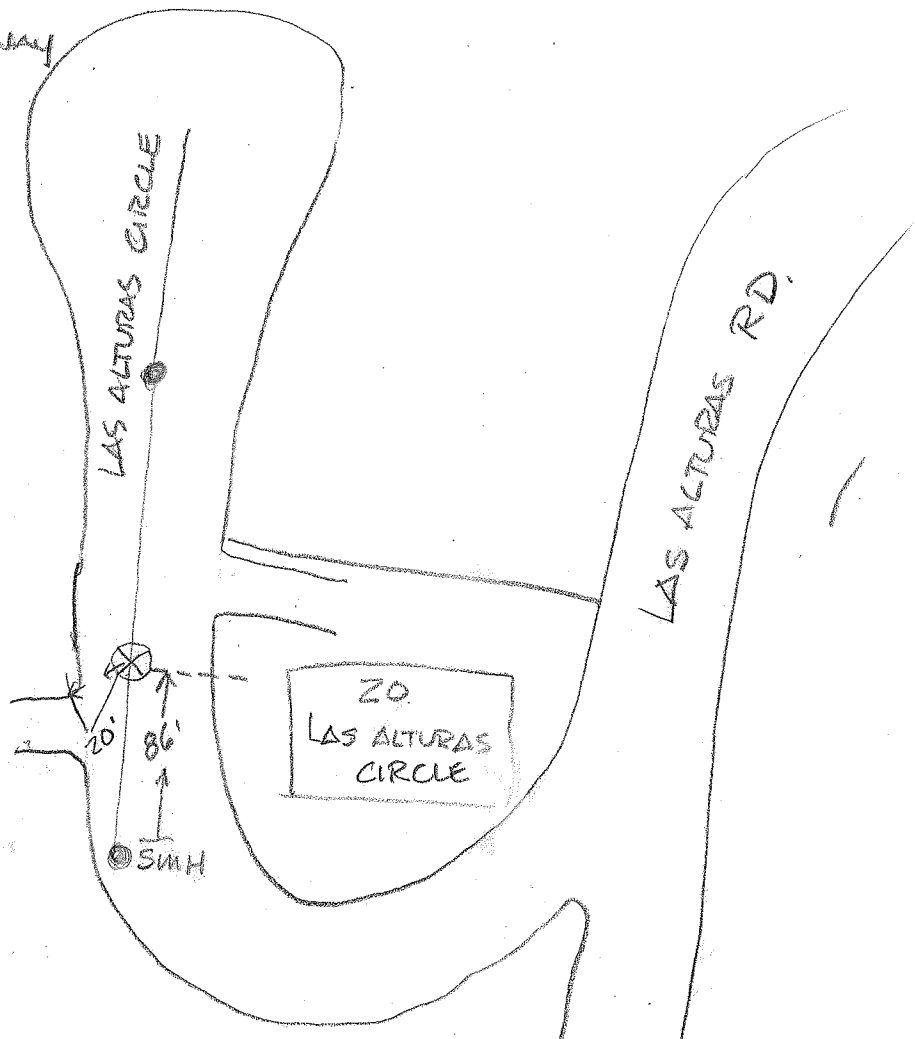


M

- Date: 1-16-09
- Property Address: 2220
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral: CAST IRON TO PVC (FORCE LATERAL)
- Depth of ^{PLUG}Wye connection: 18"
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions: 2x2
- Brief description of the site (utility conflict/traffic/soil type/other issues): FORCE LATERAL

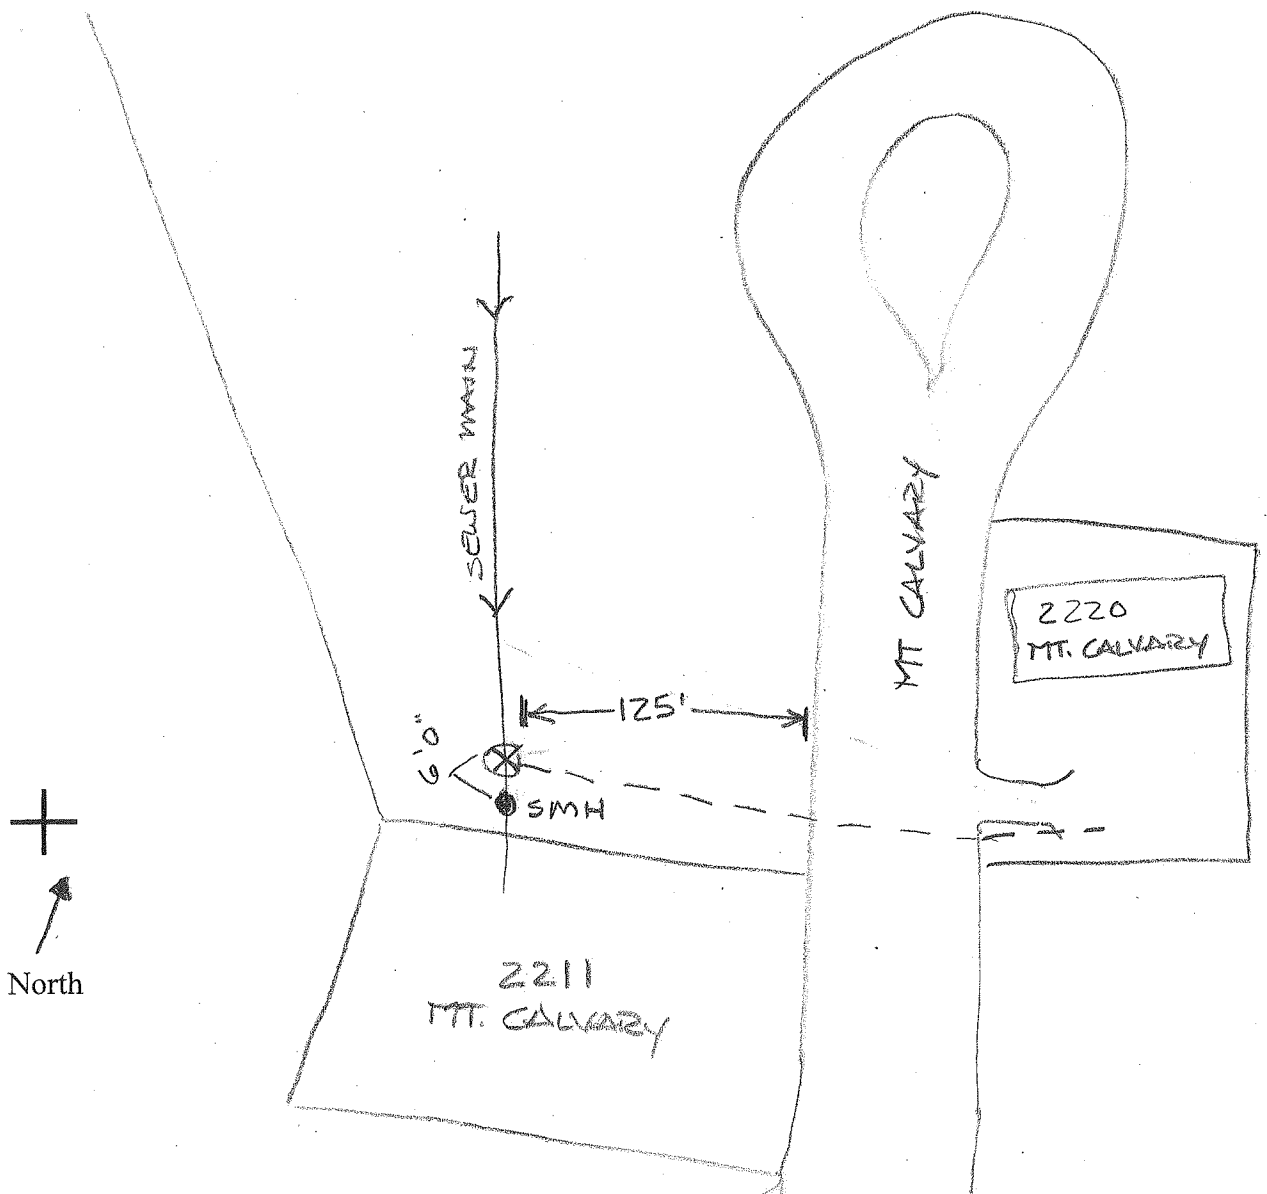


R

- Date: 1-7-09
- Property Address: 47 RINCOL VISTA
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: N/A
- Size & material type of lateral: 4" ABS
- Depth of ^{CAP}Wye connection: 27"
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

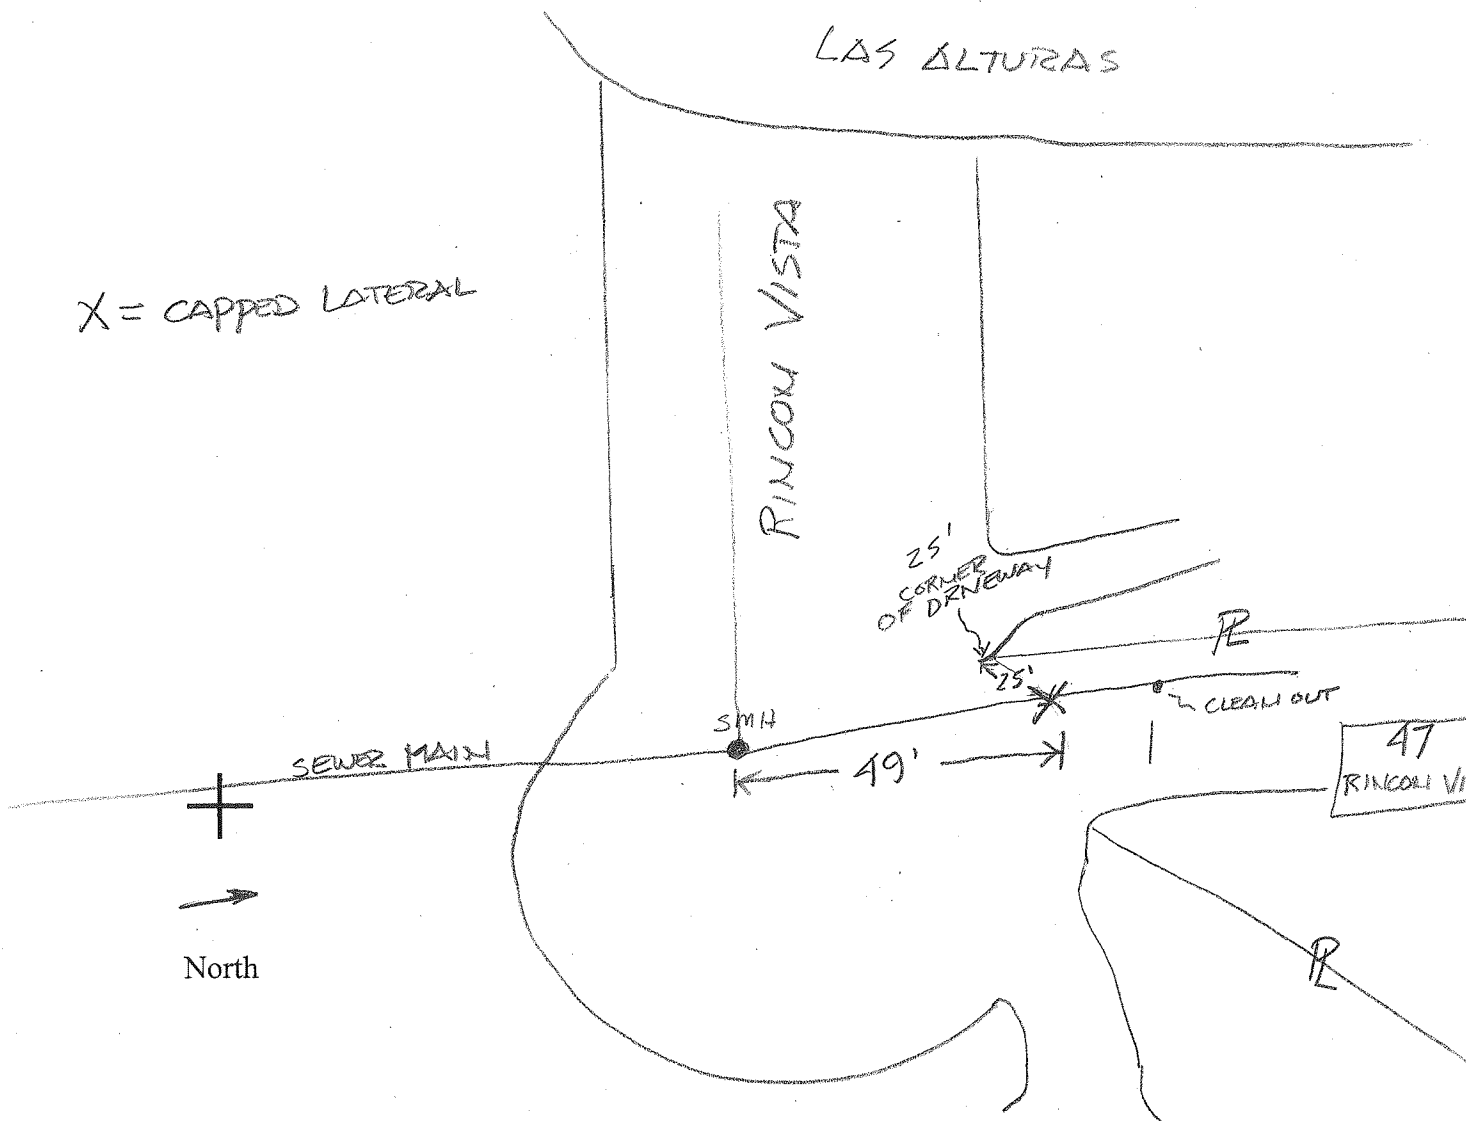


- Date: 1-7-09
- Property Address: 50 RINCON VISTA
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: CLAY
- Size & material type of lateral: 4" ABS
- Depth of ^{CAP}Wye connection: 30"
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions: 3 X 3
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

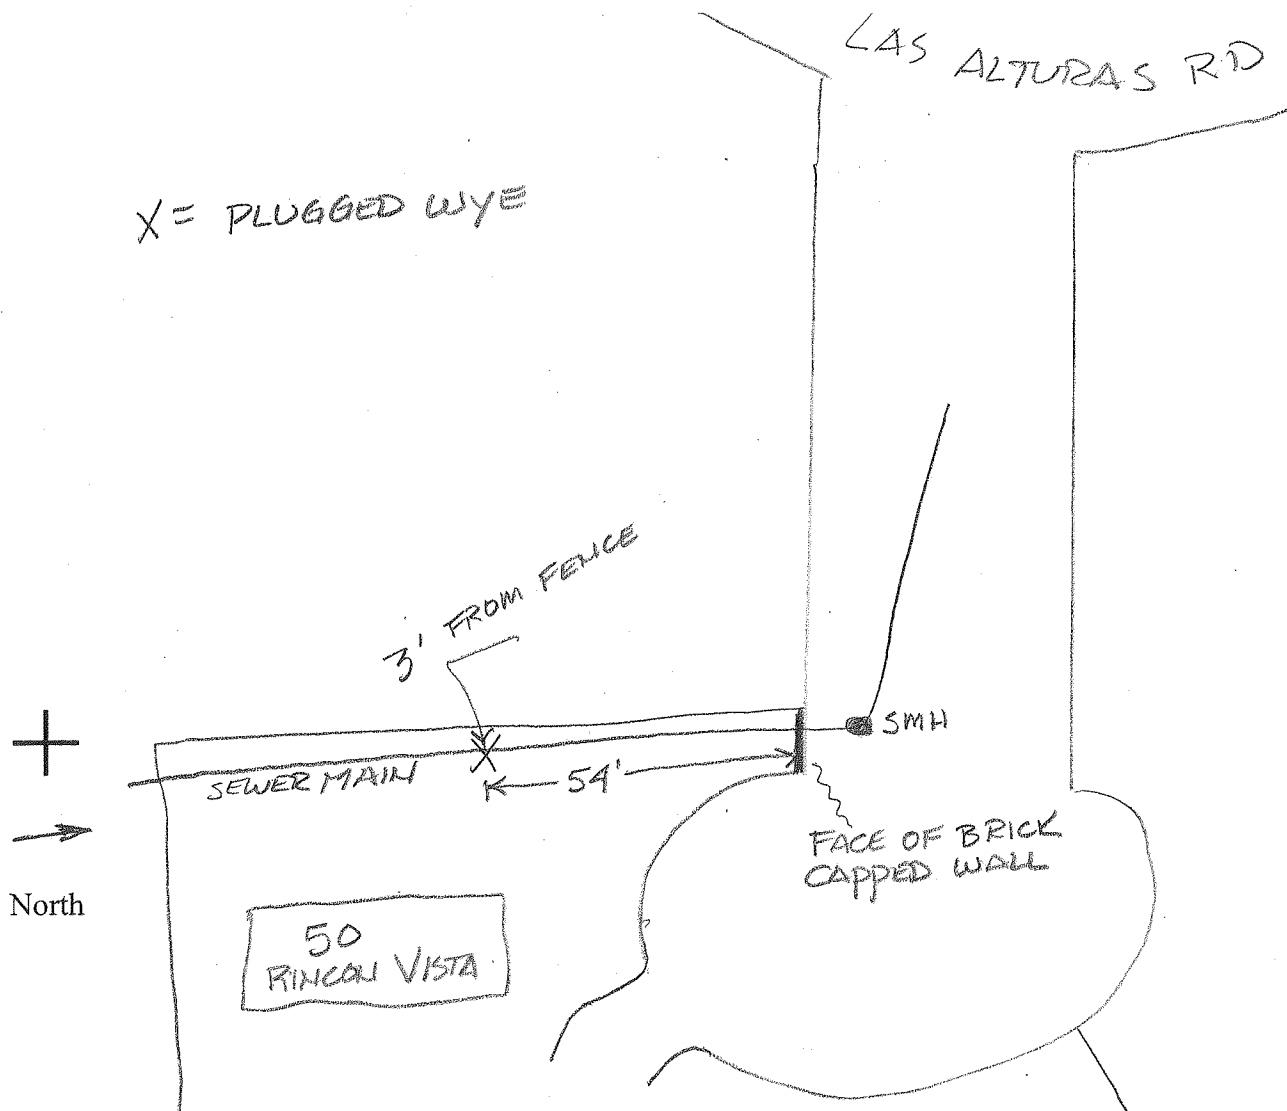

S


- Date: 1-13-09
- Property Address: 317 SHERMAN RD,
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: N/A
- Size & material type of lateral: 4" CLAY
- Depth of ^{PLUG}Wye connection: 6'
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions: 5 X 3
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

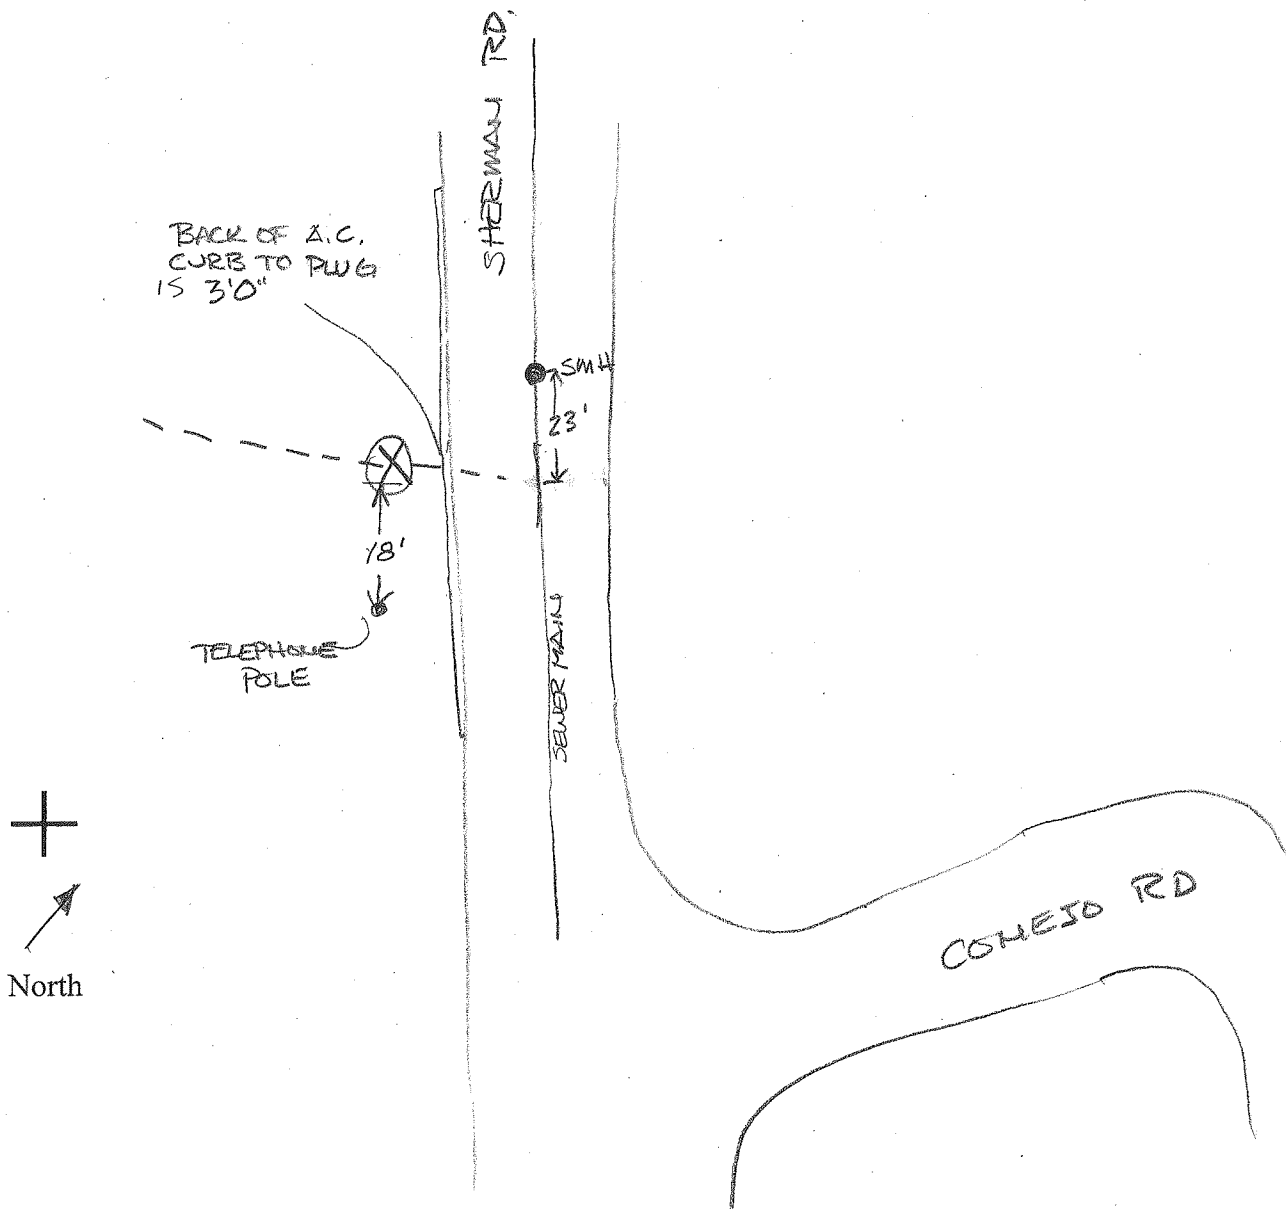

- Date: 1-16-09
- Property Address: 595 SYCAMORE VISTA
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: N/A
- Size & material type of lateral: 3" SDR
- Depth of ^{cap}Wye connection: @ GRADE
- Distance of lateral from centerline of downstream manhole: N/A
- Excavation dimensions: N/A
- Brief description of the site (utility conflict/traffic/soil type/other issues): EXPOSED LINE & PLUGS


⊗ = PLUG

20' 0" FROM EDGE OF PAVEMENT

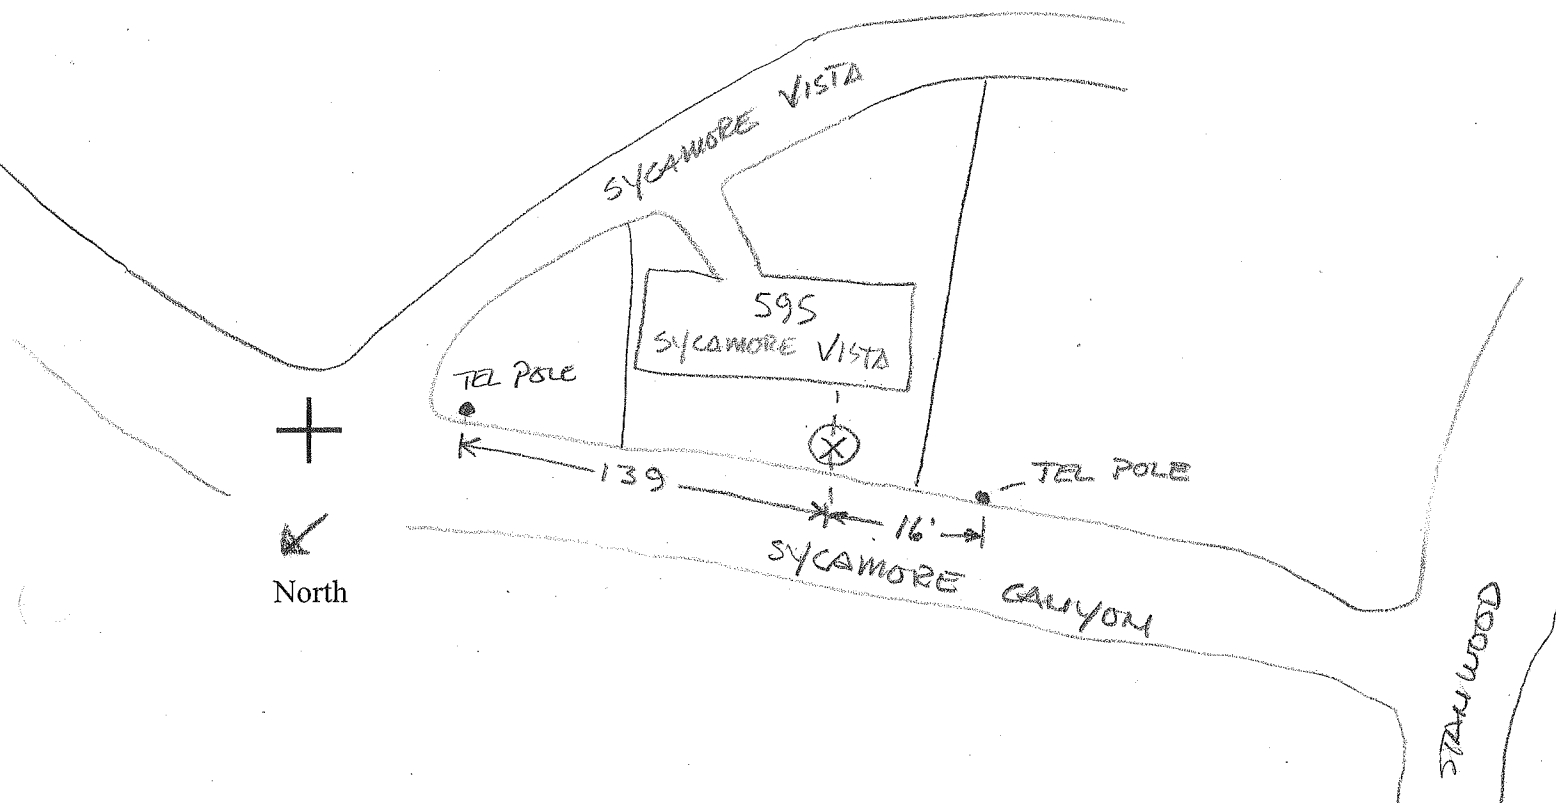


W


- Date: 1-5-09
- Property Address: 733 WESTMONT
- Location/Address of actual excavation (also see diagram attached): ON CIRCLE
- Size & material type of sewer main:
- Size & material type of lateral:
- Depth of Wye connection: 7'
- Distance of lateral from centerline of downstream manhole: 196'
- Excavation dimensions: 2x3
- Brief description of the site (utility conflict/traffic/soil type/other issues): KLOVE

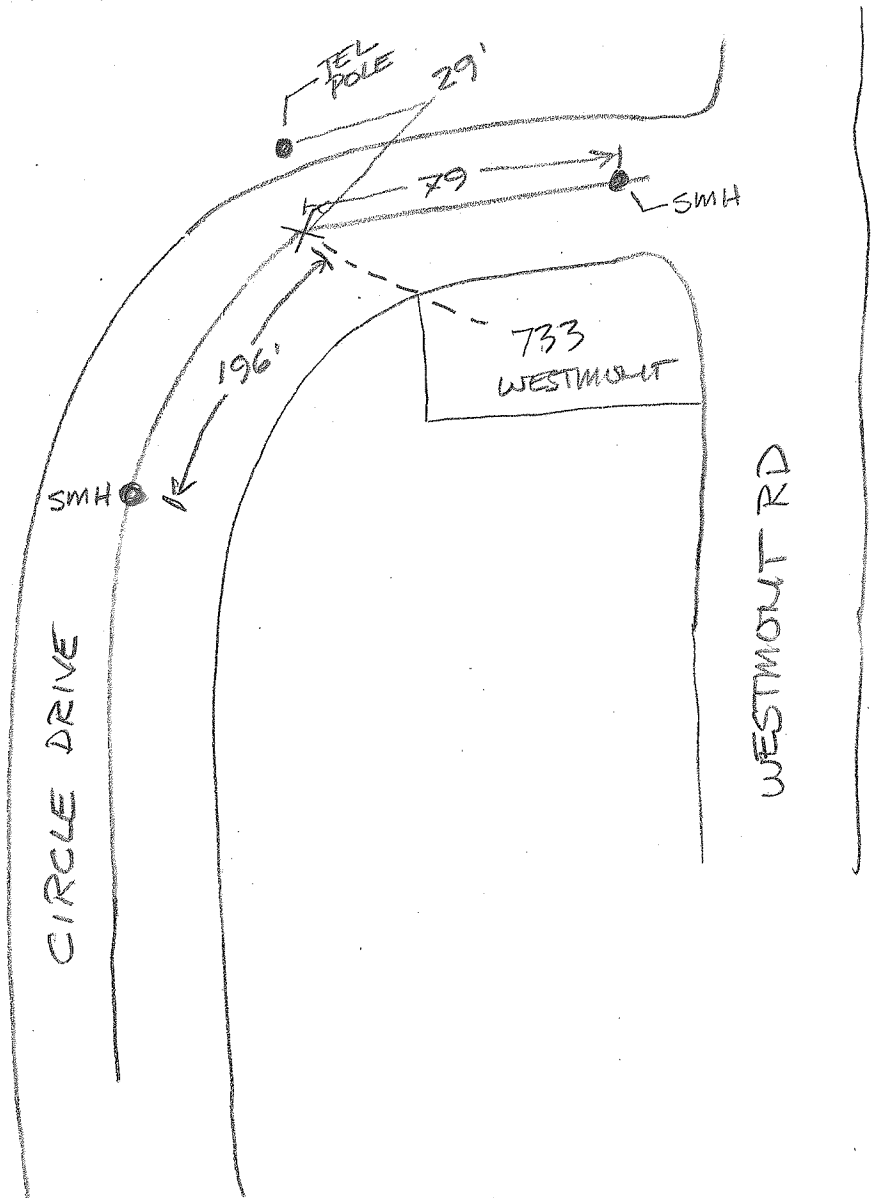

- Date: 1-5-09
- Property Address: 746 WESTMOUNT
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral:
- Depth of Wye connection: 4'
- Distance of lateral from centerline of downstream manhole: 345'
- Excavation dimensions: 2x4
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

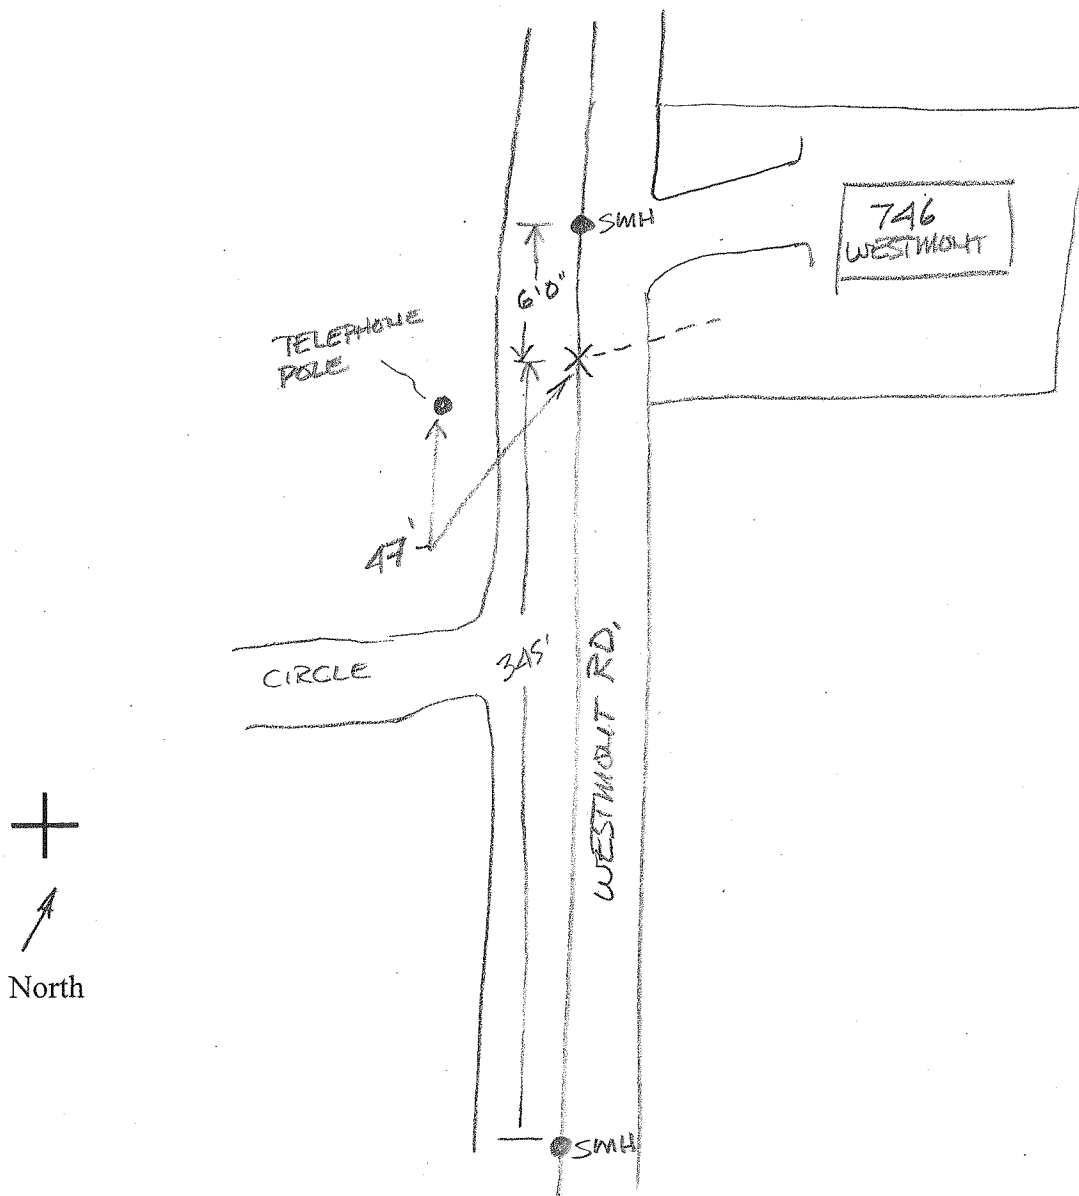


- Date: 12-23-08
- Property Address: 824
- Location/Address of actual excavation (also see diagram attached): SOME
- Size & material type of sewer main: N/A
- Size & material type of lateral: 3"
- Depth of Wye connection: N/A
- Distance of lateral from centerline of downstream manhole: 200' 6"
- Excavation dimensions: N/A
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

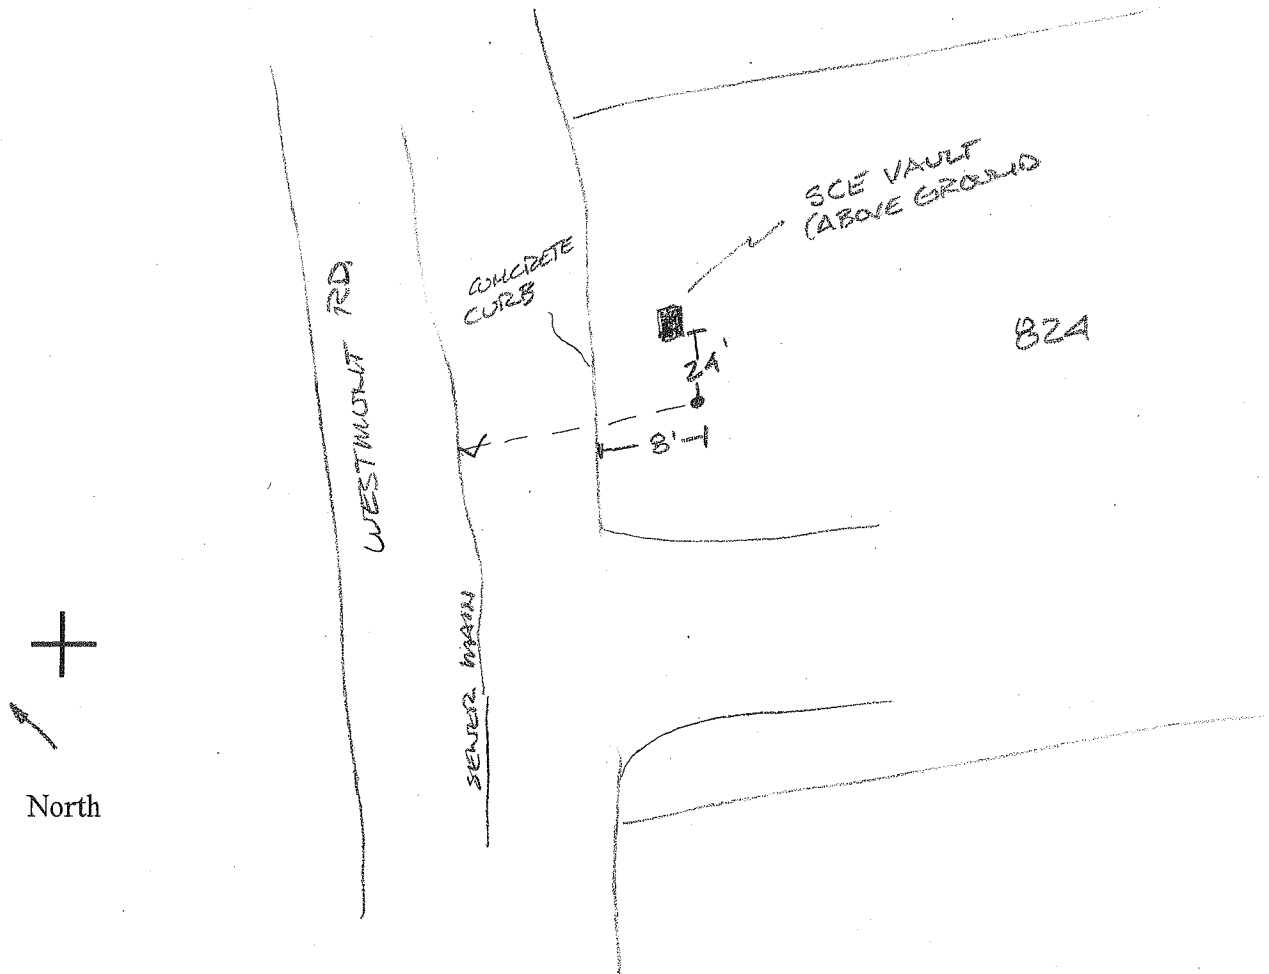


- Date: 12-23-08
- Property Address: 850 WESTMOLT RD.
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: N/A
- Size & material type of lateral: 4" SDR
- Depth of Wye connection: 6'6"
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions: N/A
- Brief description of the site (utility conflict/traffic/soil type/other issues): MANY UTILITIES DIRECTLY ABOVE SEWER LATERAL


4' BEHIND FACE OF CURB
7' NORTH OF CONCRETE
LIGHT STANDARD

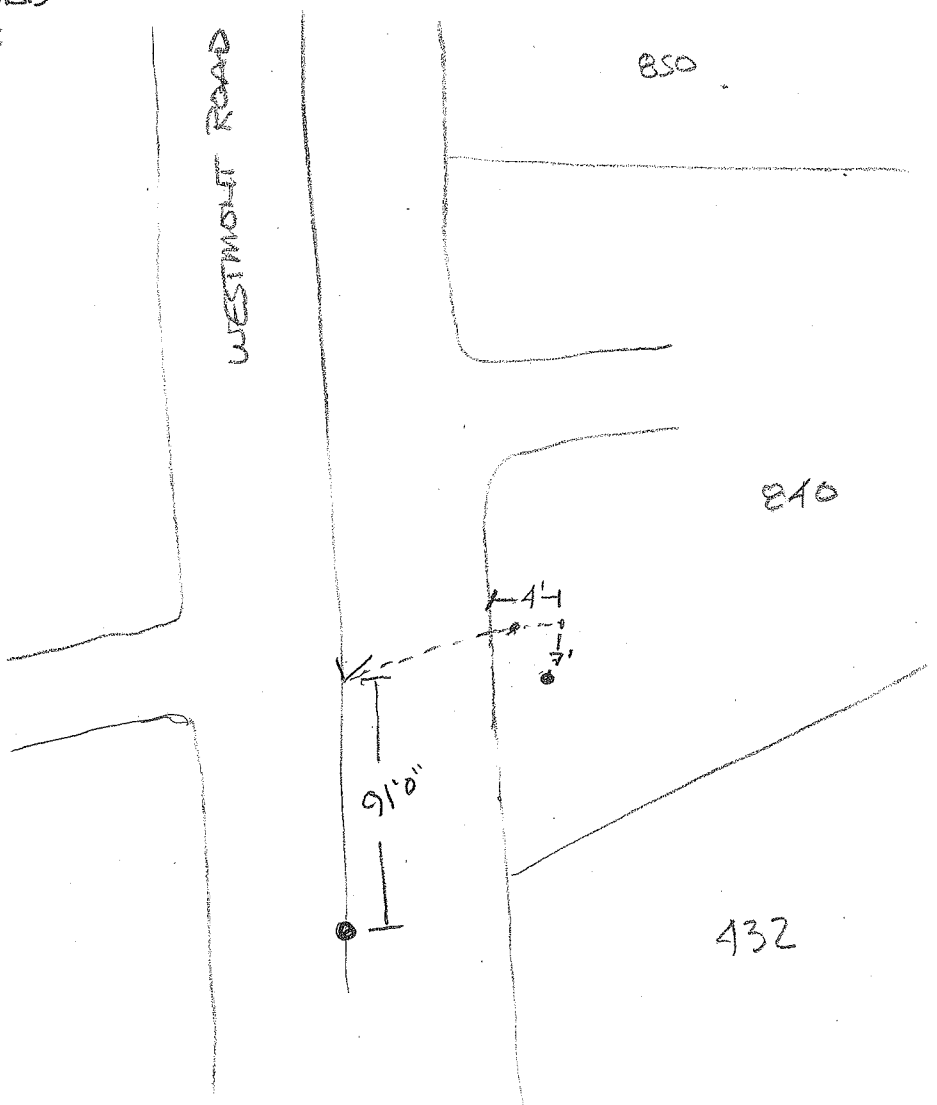


- Date: 12-29-08
- Property Address: 825 WESTMOUNT
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: H/A
- Size & material type of lateral: 4" PVC (CMU) & 3" ABS (PROP)
- Depth of Wye connection: 6'6"
- Distance of lateral from centerline of downstream manhole: 116'
- Excavation dimensions:
- Brief description of the site (utility conflict/traffic/soil type/other issues):

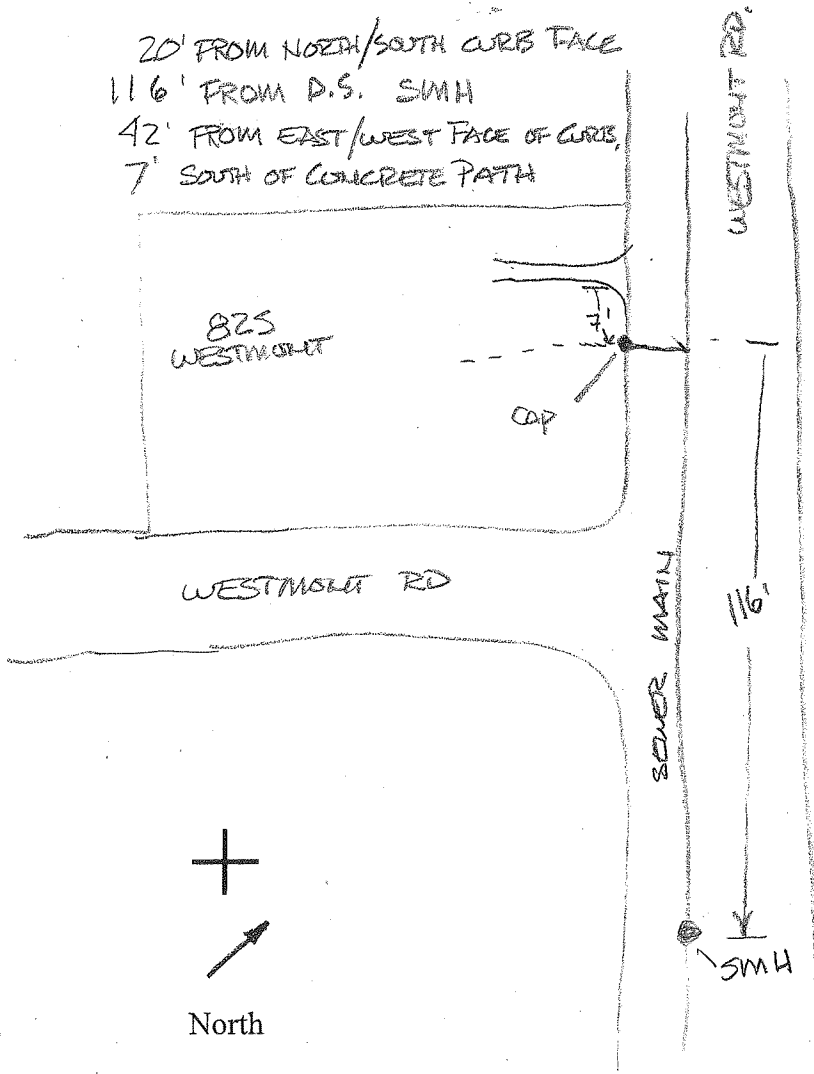

- Date: 12-23-08
- Property Address: 840 WESTMOUNT RD
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral: 3" ABS
- Depth of Wye connection: 5'
- Distance of lateral from centerline of downstream manhole: 11' 6"
- Excavation dimensions: 3 x 4
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

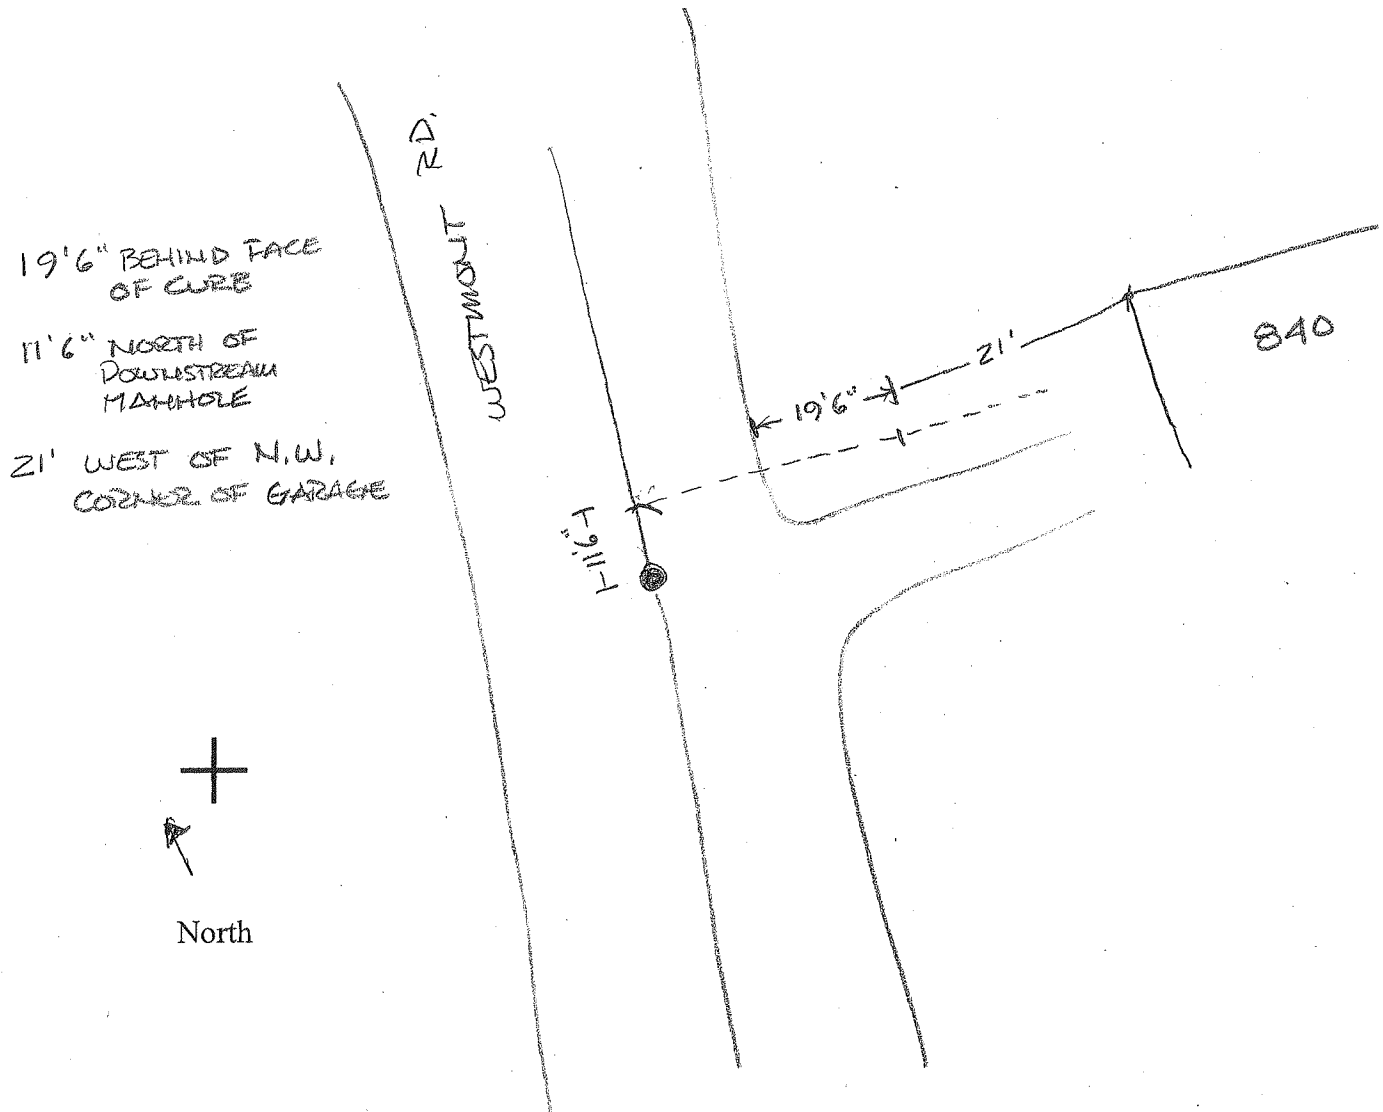


- Date: 12-23-08
- Property Address: 849 WESTMONT ROAD (CHECK TO SEE IF ON LIST)
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: N/A
- Size & material type of lateral: 3" ABS
- Depth of Wye connection: N/A
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions: N/A
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

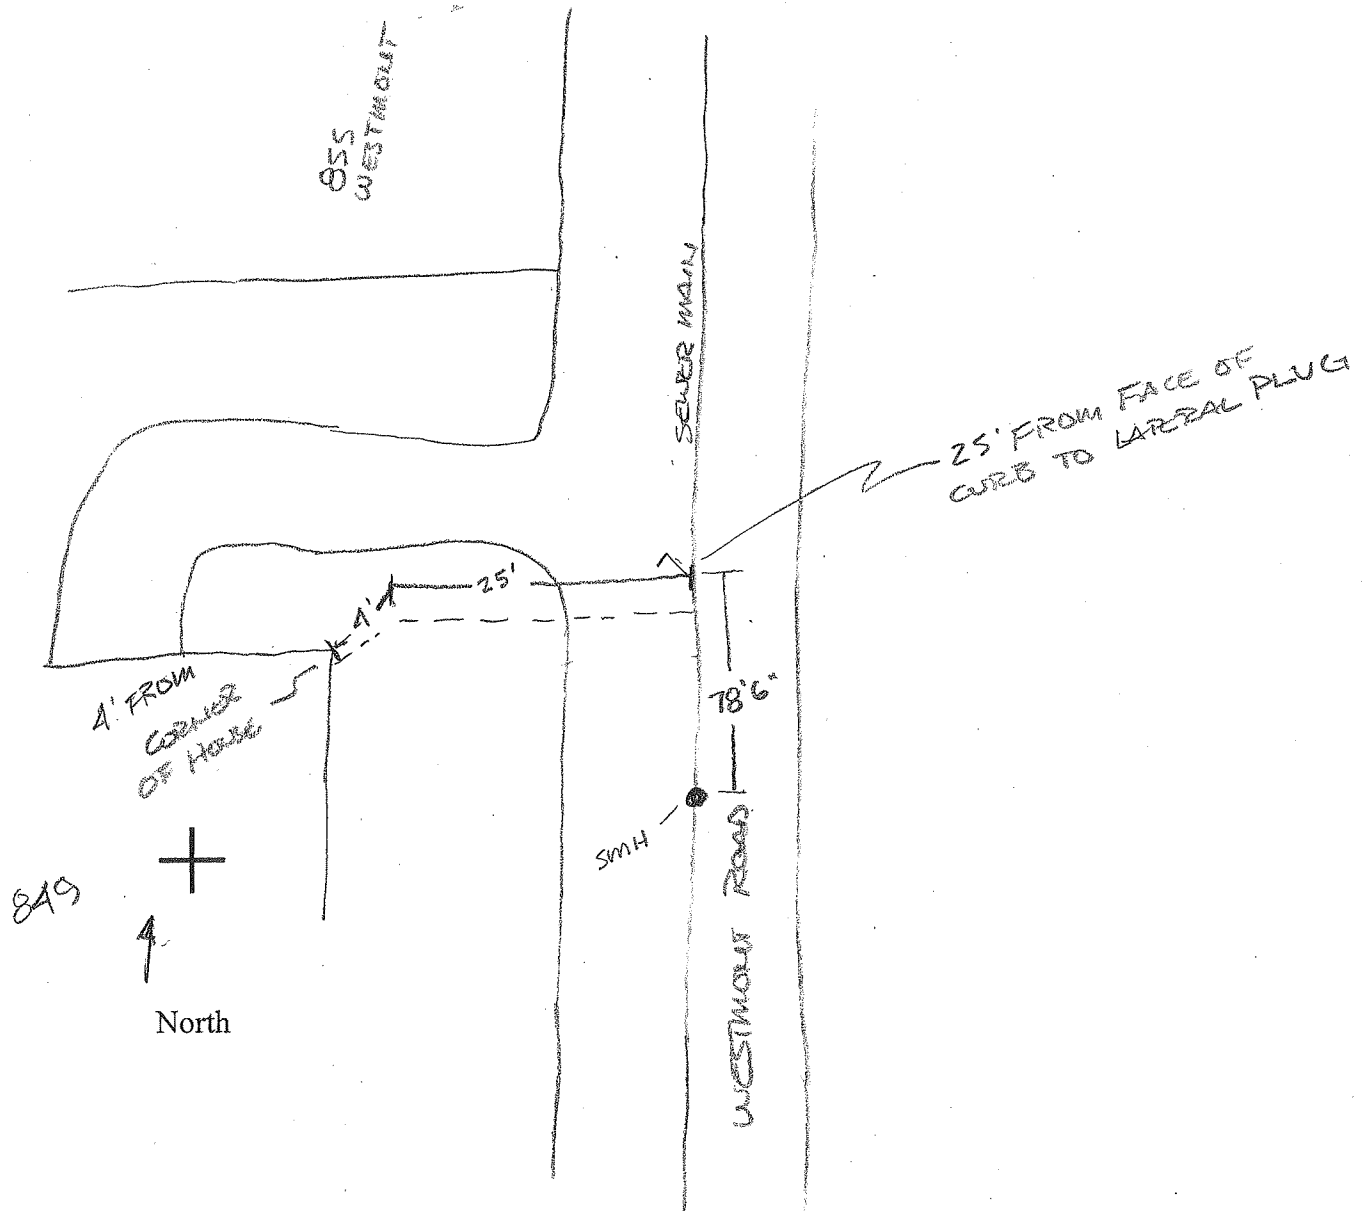

- Date: 12-23-08
- Property Address: 928 WESTMONT
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: N/A
- Size & material type of lateral: 4" SDR
- Depth of Wye connection: 3' 6"
- Distance of lateral from centerline of downstream manhole: 170'
- Excavation dimensions: 3x3
- Brief description of the site (utility conflict/traffic/soil type/other issues): NONE

8' BEHIND CURB
 170' FROM DOWNSTREAM SMH
 55' SOUTH OF LIGHT STANDARD

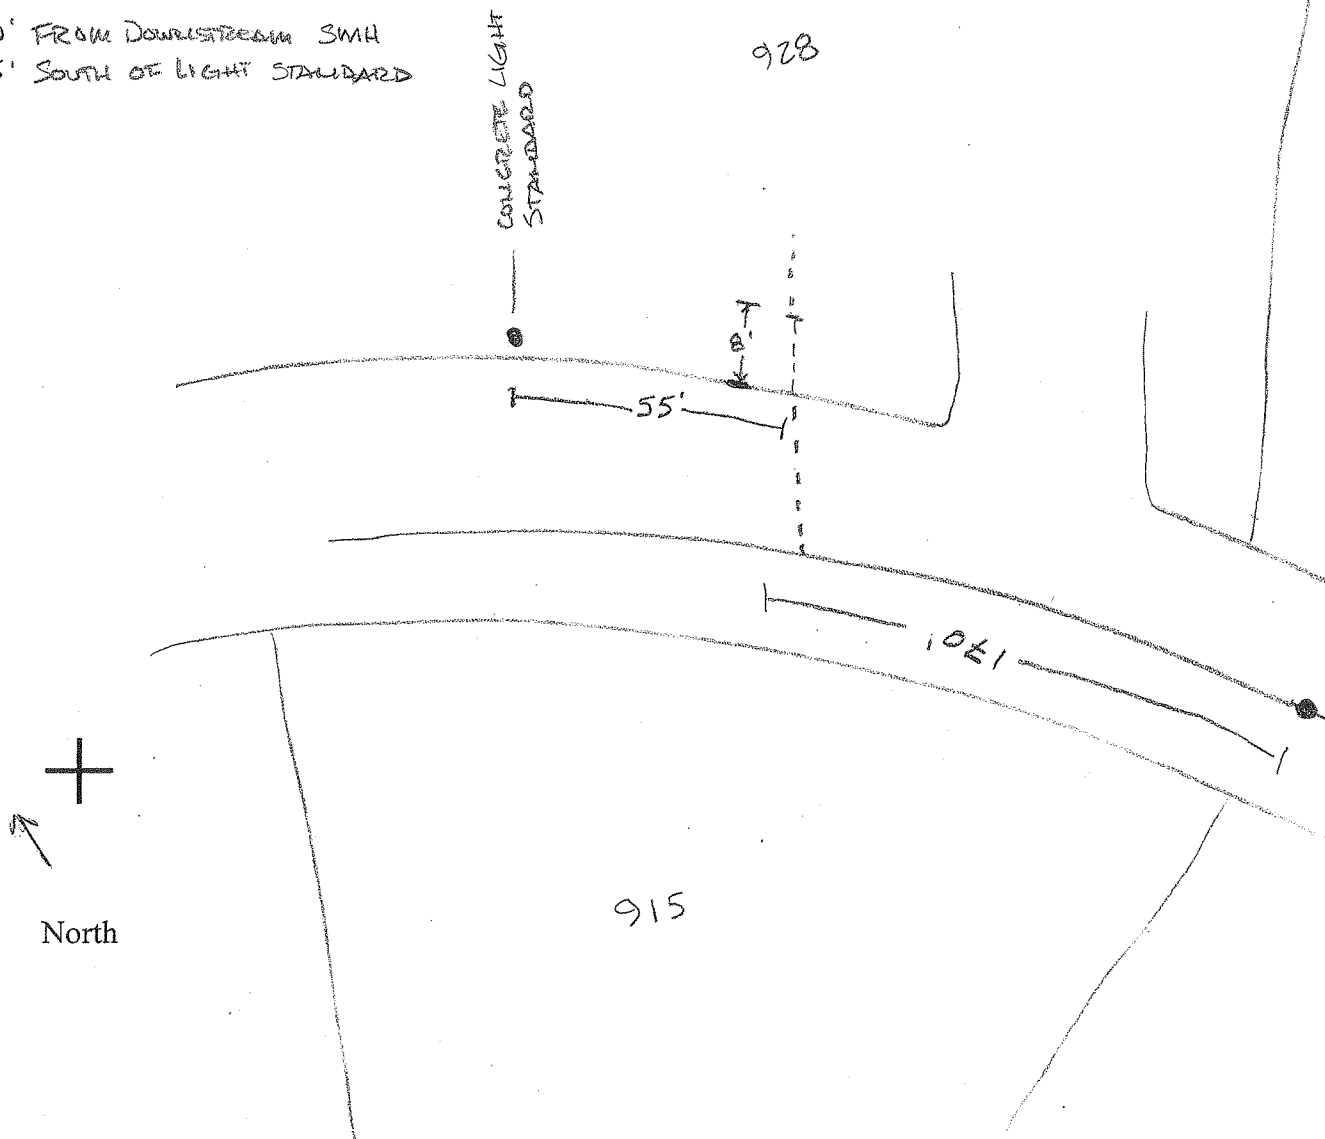

- Date: 12-24-01
- Property Address: 952 WESTMOUNT
- Location/Address of actual excavation (also see diagram attached): SAME
- Size & material type of sewer main: PVC
- Size & material type of lateral: PVC 4"
- Depth of Wye connection: 4'
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions: 3 x 3
- Brief description of the site (utility conflict/traffic/soil type/other issues):

11' BEHIND CURB FACE



North

- Date: 12-29
- Property Address: 1014 WESTMOUNT
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: N/8
- Size & material type of lateral: 4" ABS
- Depth of Wye connection: 3'
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions: 2 x 3
- Brief description of the site (utility conflict/traffic/soil type/other issues):



North

- **Date:** 12-24-08.
- **Property Address:** 1031 Westmore
- **Location/Address of actual excavation (also see diagram attached):**
- **Size & material type of sewer main:** N/A
- **Size & material type of lateral:** 4" ABS
- **Depth of Wye connection:** 5' 1/2"
- **Distance of lateral from centerline of downstream manhole:**
- **Excavation dimensions:** 3' x 3'
- **Brief description of the site (utility conflict/traffic/soil type/other issues):** None



North

- Date: 12-23-08
- Property Address: 1049 ~~Westmore~~
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main:
- Size & material type of lateral: 4" ABS @ Prop 4" PVC @ City
- Depth of Wye connection: 4'
- Distance of lateral from centerline of downstream manhole:
- Excavation dimensions: 3x3
- Brief description of the site (utility conflict/traffic/soil type/other issues): None




North

- **Date:** 12-24-08
- **Property Address:** 1103 Westmont
- **Location/Address of actual excavation (also see diagram attached):**
- **Size & material type of sewer main:**
- **Size & material type of lateral:** 4" ABS
- **Depth of Wye connection:** 2'
- **Distance of lateral from centerline of downstream manhole:**
- **Excavation dimensions:** 3x3
- **Brief description of the site (utility conflict/traffic/soil type/other issues):**



North


- Date: 12-30-08
- Property Address: 1108 WESTMONT RD.
- Location/Address of actual excavation (also see diagram attached): SEE BELOW
- Size & material type of sewer main:
- Size & material type of lateral: 4"
- Depth of Wye connection: 6' 6"
- Distance of lateral from centerline of downstream manhole: N/A
- Excavation dimensions: 3 X 3
- Brief description of the site (utility conflict/traffic/soil type/other issues): DOUBLE WYE - 1108 - 1124

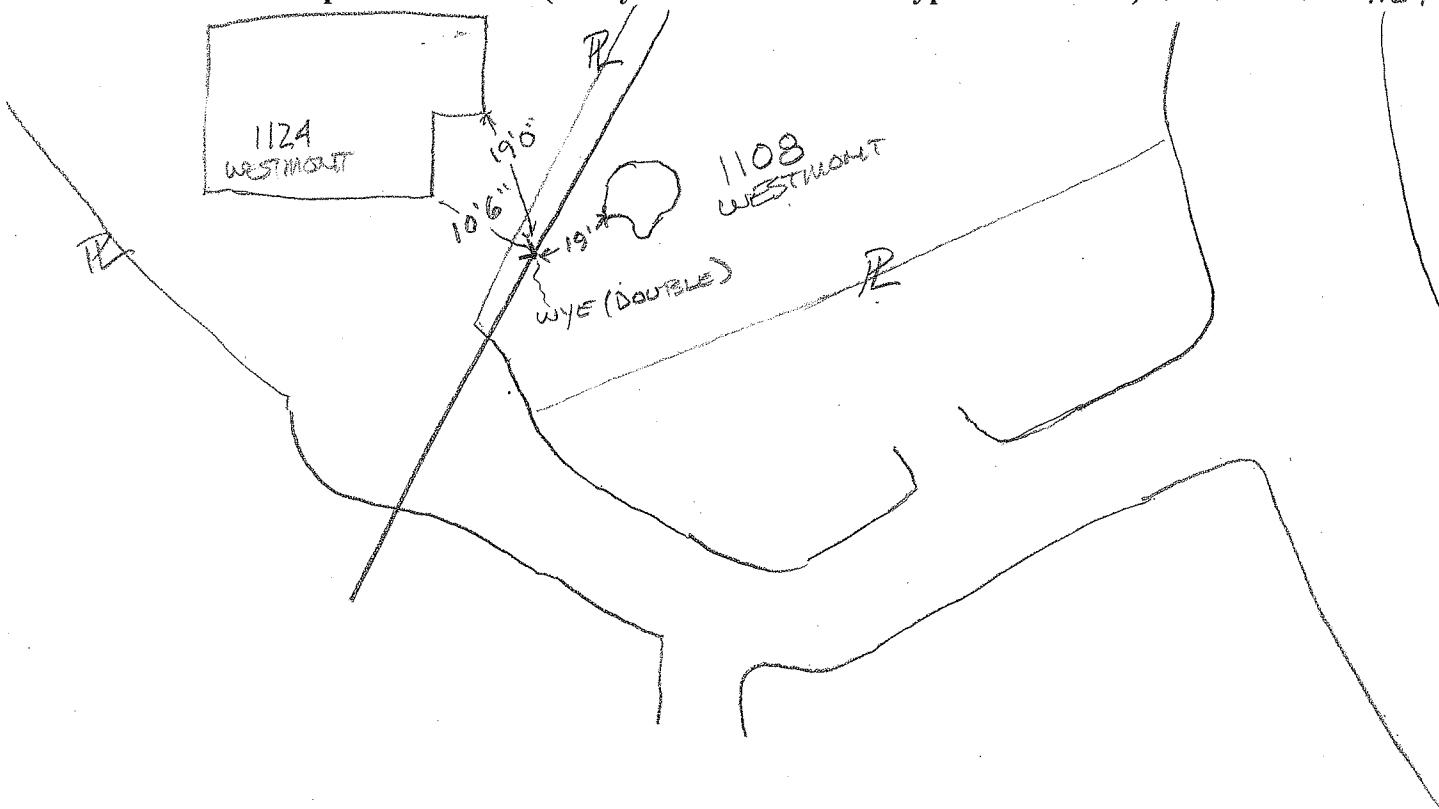

North

- Date: 12-30-08
- Property Address: 1125 WESTMONT
- Location/Address of actual excavation (also see diagram attached): SEE BELOW
- Size & material type of sewer main: N 1/2
- Size & material type of lateral: 4" PVC
- Depth of Wye connection: 2'
- Distance of lateral from centerline of downstream manhole: 40'
- Excavation dimensions: 2x2
- Brief description of the site (utility conflict/traffic/soil type/other issues): EDGE OF PAVEMENT

14'0" BEHIND CURB FACE
 4'0" FROM CENTER OF 4' ROCK
 40' FROM D.S. SMH

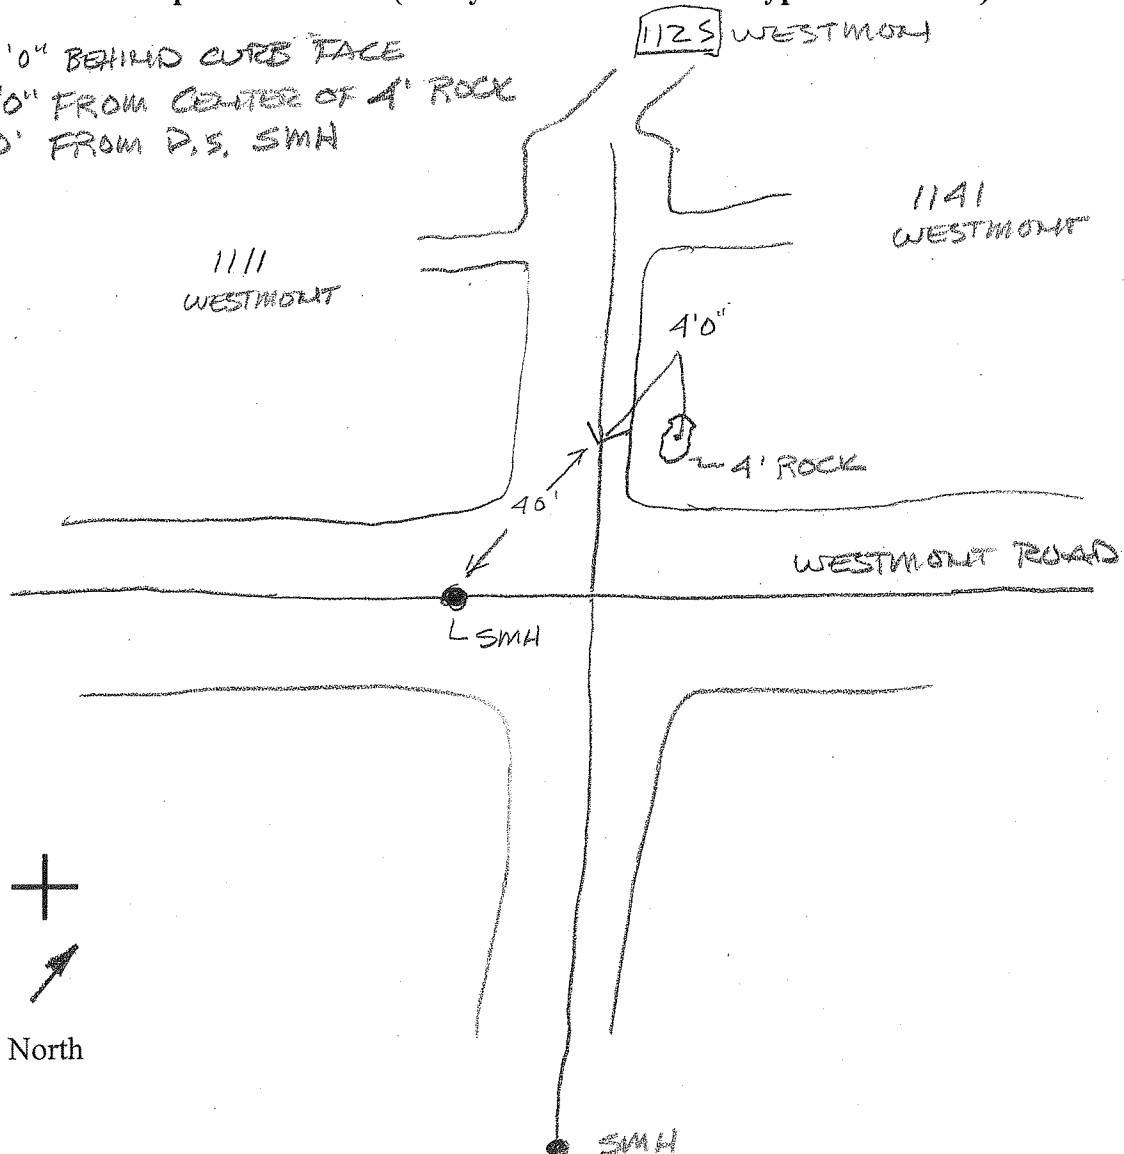

- Date: 12-29-08
- Property Address: 1132 WERTMONT
- Location/Address of actual excavation (also see diagram attached):
- Size & material type of sewer main: 14" / A
- Size & material type of lateral: 3" ABS
- Depth of Wye connection: 18"
- Distance of lateral from centerline of downstream manhole: N/A
- Excavation dimensions: 2x2
- Brief description of the site (utility conflict/traffic/soil type/other issues):

